

## **SIX-MONTH SURVEILLANCE AHERA REPORT**

**BUESD MAINTENANCE AND TRANSPORTATION YARD  
945 PIEDMONT ROAD  
SAN JOSE, CA 95132**

**PREPARED FOR:  
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT  
1376 PIEDMONT ROAD  
SAN JOSE, CA 95132**

**INSPECTED ON:  
FEBRUARY 13, 2023**

**HAZMAT DOC PROJECT #23-026**

**PREPARED BY:  
HAZMAT DOC  
3080 OLCOTT STREET • SUITE D135  
SANTA CLARA, CA 95054  
Tel: 408.748.0055**

**BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT  
BUESD MAINTENANCE AND TRANSPORTATION YARD**

**INSPECTED ON:  
FEBRUARY 13, 2023**

**INSPECTED BY:**

  
\_\_\_\_\_  
**Leland Kafeyan**  
**Cal/OSHA Certified Site Surveillance Technician**  
**Certification Number 06-4110**

**REPORTED BY:**

*Maheen B. Doctor*  
\_\_\_\_\_  
**Maheen B. Doctor**  
**Cal/OSHA Certified Asbestos Consultant**  
**Certification Number 95-1798**

## **CONTENTS**

### **PART - I**

#### **LEGEND AND GLOSSARY OF TERMS**

### **PART – II**

#### **AHERA REPORT A – LIST OF BUILDINGS**

### **PART – III**

#### **AHERA REPORT B – SURVEY REPORT**

### **PART – IV**

#### **HOMOGENEOUS MATERIALS REPORT**

### **PART – V**

#### **FRIABLE LOCATIONS REPORT**

### **PART – VI**

#### **NON-FRIABLE LOCATIONS REPORT**

### **PART – VII**

#### **RECOMMENDATIONS REPORT**

### **PART – VIII**

#### **SAMPLES REPORT**

### **PART – IX**

#### **DAMAGE REPORT**

### **PART - X**

#### **SITE MAPS**

## **LEGEND**

**THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:**

### **Asbestos Sample Types**

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYSOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

### **Measurements**

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

# LIST OF BUILDINGS AT

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME BUILDING USED AS ( #FLOORS ) CONSTRUCTION	BUILDING AREA (APPROXIMATE)
<b>GROUNDS PORTABLE</b>	
Storage ( 1 ) Wood, Metal	480 SF
<b>GROUNDS STORAGE BUILDING</b>	
Storage ( 1 ) Wood, Concrete, Metal	240 SF
<b>MAINTENANCE GARAGE BUILDING</b>	
Garage and Storage ( 1 ) Wood, Metal, Concrete	730 SF
<b>MAINTENANCE SHOPS OFFICE PORTABLE BUILDING</b>	
Offices, Shops, Storage, Plumbing, and Locksmith ( 1 ) Wood and Metal Portable	1,780 SF
<b>MENTOR'S HOUSE</b>	
Daycare ( 1 ) Wood, Metal, Plaster	1,840 SF
<b>METAL STORAGE CONTAINERS (25 EA)</b>	
Storage ( 1 ) Metal	7,550 SF
<b>METAL STORAGE SHED</b>	
Storage ( 1 ) Metal Wall and Ceiling, Wood, and Asphalt	725 SF
<b>PG&amp;E NORTH TOWER BUILDING</b>	
PG&E ( 1 ) Metal and Concrete	154 SF
<b>PG&amp;E SOUTH TOWER ENCLOSURE</b>	
PG&E ( 1 ) Wood Fence, and Concrete Floor	533 SF
<b>STUDENT NUTRITION SERVICE</b>	
Kitchen ( 1 ) Wood, Metal, Concrete	7,480 SF
<b>TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING</b>	
Office, Lounge, Storage, Restrooms ( 1 ) Portable with Wood Floor and Preformed Walls	3,750 SF
<b>WAREHOUSE BUILDING</b>	
Warehouse, Office, Storage, Lounge, Restrooms ( 1 ) Wood, Metal, Concrete	9,000 SF
<b>WELDING SHOP BUILDING</b>	
Welding Shop ( 1 ) Wood, Metal, Concrete	760 SF

# LIST OF BUILDINGS AT

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		BUILDING AREA (APPROXIMATE)
BUILDING USED AS ( #FLOORS ) CONSTRUCTION		
WOOD SHEDS (2 EA)		
Storage		200 SF
( 1 )	Wood	
WOOD STORAGE SHED		
Storage		330 SF
( 1 )	Wood Wall and Ceiling, Concrete Floor	
Total Number Of Buildings : <u>15</u>		(Approximate) Total Sq Ft. : <u><b>35,552</b></u>
End Of Report, Total Of 2 Pages		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### GROUPS PORTABLE

### GROUPS PORTABLE

EXTERIOR DOOR

FIRE DOOR CORE INSULATION

42 SF

07/30/2010 Fire Door Core Insulation (2 EA Double-Doors). This Material is in GOOD condition as of this date.

11/28/2011 Material Description reassessed and changed from 'Fire Door Core Insulation. (2 EA Double-Doors).' to 'Fire Door Core Insulation. (2 EA Single-Doors).' No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### GROUPS PORTABLE

INTERIOR DOOR

FIRE DOOR CORE INSULATION

21 SF

07/30/2010 Fire Door Core Insulation. (1 EA Double-Doors). This Material is in GOOD condition as of this date.

11/28/2011 Material Description reassessed and changed from ' Fire Door Core Insulation. (1 EA Double-Doors).' to ' Fire Door Core Insulation. (1 EA Single-Doors).' No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### GROUPS PORTABLE

#### PORTABLES

##### BASEBOARD MASTIC

130 LF

07/30/2010 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### GROUPS PORTABLE

#### PORTABLES

##### SUSPENDED CEILING TILE

450 SF

07/30/2010 2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. This Material is in GOOD condition as of this date.

08/28/2014 Damage observed. <5% Physical Damage - 1 Tile is Damaged. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/25/2017 Additional Damage Observed. 4 Tiles now have Physical Damage. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

10-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### GROUPS PORTABLE

#### PORTABLES

##### VINYL FLOOR TILE

480 SF

07/30/2010	12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date.		
11/28/2011	Damage Observed. <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
03/27/2017	Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	Additional Damage Observed. 13 Tiles in total with Cracks throughout Entire Building. No other changes as of this date.		

10-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### GROUPS PORTABLE

#### PORTABLES

VINYL FLOOR TILE MASTIC

480 SF

07/30/2010	Mastic/Adhesive for 12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date.
11/28/2011	Damage Observed. <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/27/2017	Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	Additional Damage Observed. 13 Tiles in total with Cracks throughout Entire Building. No other changes as of this date.

10-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### GROUPS STORAGE BUILDING

### GROUPS STORAGE BUILDING

10/13/2008 BUILDING NOTES:

10/13/2008 Metal Ceiling, Wood Wall, Concrete Floor.

12/01/2016 Building name changed from GROUNDS SHED to GROUNDS STORAGE BUILDING.

08/15/2022 No Suspect Material are present except Fire-Core Doors.

### GROUPS STORAGE BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

21 SF

09/16/2015 Fire Door Core Insulation (1 EA Doors). This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### MAINTENANCE GARAGE BUILDING

### MAINTENANCE GARAGE BUILDING

03/05/2007 BUILDING NOTES:

03/05/2007 Building Name changed from BUS GARAGE to BUS GARAGE BUILDING.

12/01/2016 Building Name changed from BUS GARAGE BUILDING to MAINTENANCE GARAGE BUILDING.

### MAINTENANCE GARAGE BUILDING

OFFICE

SINK UNDERCOATING

5 SF

05/11/2009 Black Thermal Undercoating on Sink (1 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 08/30/10.)

08/30/2010 Undercoating is Black. Original entry updated. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE GARAGE BUILDING

OFFICE

SUSPENDED CEILING TILE

260 SF

09/06/2005 2'X4' Suspended Ceiling Tile. This Material is in GOOD condition as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05/11/2009	Damage Observed. <5% Physical Damage in the form of minor cuts and holes. <10% Water Damage due to 3 Tiles with water stains. Material Condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.		
03/27/2017	Additional Damage Observed. 11 Tiles have Water Damage. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

2,650 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.		
03/03/2014	This Material is unchanged as of this date.		
03/18/2015	This Material is unchanged as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	Damage Observed. <5% Physical Damage in the form of 4 LF of Cracks at South and West Walls of Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE No.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

2,650 SF

04/18/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 Damage Observed. <5% Physical Damage in the form of 4 LF of Cracks at South and West Walls of Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE GARAGE BUILDING

REPAIR / SERVICES GARAGE

CHALK BOARD

8 SF

05/11/2009 20 SF Green Cementitious Chalkboard, (on Wall next to office). (1 EA). 8 SF Black Cementitious Chalkboard, (located on Door to office). (1 EA). This Material is in GOOD condition as of this date.

08/30/2010 Material Description clarified. Green Chalkboard is Wood not Cementitious. Material Description changed from '20 SF Green Cementitious Chalkboard, (on Wall next to office).' to '20 SF Green Wood Chalkboard, (on Wall next to office).' Quantity changed from 28 SF to 8 SF. No other changes as of this date.

11/28/2011 Chalkboard is Black and is located on Door to office. No other changes as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
09-098AAA	ASSUMED	NO SAMPLE	( NS )

### MAINTENANCE GARAGE BUILDING

REPAIR / SERVICES GARAGE

WALL MASTIC

8 SF

05/11/2009	Mastic/Adhesive for 20 SF Green Cementitious Chalkboard, (on Wall next to office). (1 EA). 8 SF Black Cementitious Chalkboard, (located on Door to office). (1 EA). This Material is in GOOD condition as of this date.		
08/30/2010	Material Re-Assessed. Material Description changed from '20 SF Green Cementitious Chalkboard, (on Wall next to office).' to '20 SF Green Wood Chalkboard, (on Wall next to office) .8 SF Black Cementitious Chalkboard, (located on Door to office)' Quantity changed from 28 SF to 8 SF. No other changes as of this date.		
11/28/2011	Chalkboard is Black and is located on Door to office. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE GARAGE BUILDING

RESTROOMS (2), AND SHOWER ROOM

HEAT SHIELD 7.5 SF

03/05/2007 Heat Shields (3 EA Round Light Fixtures). This Material is in GOOD condition as of this date.

04/13/2012 Quantity Re-Assessed and changed from 7.5 SF to 3.5 SF. No other changes as of this date.

10/08/2012 Material Re-Assessed and Quantity is 7.5 SF. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

03/05/2007	BUILDING NOTES:
03/05/2007	Building Name changed from OFFICE PORTABLE to OFFICE PORTABLE BUILDING.
12/01/2016	Building Name changed from OFFICE PORTABLE BUILDING to MAINTENANCE SHOPS OFFICE PORTABLE BUILDING.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### DOORS - EXTERIOR

FIRE DOOR CORE INSULATION 42 SF

10/08/2012	Fire Door Core Insulation (2 EA Doors). This Material is in GOOD condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

<b>12-185AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### DOORS - INTERIOR

FIRE DOOR CORE INSULATION 168 SF

05/11/2009	Fire Door Core Insulation (6 EA Doors). All Wood Interior Doors to Offices, Storage Rooms, and Utility Closet. This Material is in GOOD condition as of this date.
10/08/2012	Material Description changed from ' Fire Door Core Insulation. (6 EA Doors). ' to ' Fire Door Core Insulation. (8 EA Doors). ' Quantity changed from 144 SF to 168 SF. No other changes as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/17/2016	Location Description changed from OFFICE PORTABLE to DOORS-INTERIOR. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

**09-095AAA**

**ASSUMED**

**NO SAMPLE**

**( NS )**

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### EXTERIOR WALLS

#### WEATHER PROOFING (OUTSIDE)

2,800 SF

04/18/2006	Weather Proofing Wall Panels. This Material is in GOOD condition as of this date.
09/23/2013	Friability changed from Moderate to Non. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date
08/28/2014	This Material is unchanged as of this date..
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC

20 LF

04/18/2006 Mastic/Adhesive for 4" Blue Baseboard. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

SMOOTH WALL MISCELLANEOUS

1,000 SF

09/06/2005 Gypsum Wallboard System, Walls. This Material is in GOOD condition as of this date.

04/18/2006 Location changed from CENTRAL SHOP AREA to HVAC OFFICE AND HALLWAY. Quantity changed from 900 SF to 1,000 SF. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING

1,000 SF

09/06/2005 Skim Coat for Gypsum Wallboard System, Walls. This Material is in GOOD condition as of this date.

04/18/2006 Location changed from CENTRAL SHOP AREA to HVAC OFFICE AND HALLWAY. Quantity changed from 900 SF to 1,000 SF. No other changes as of this date.

08/28/2014 This Material is unchanged as of this date..

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

BASEBOARD MASTIC

265 LF

09/06/2005 Mastic/Adhesive for 3" Cream Baseboard. This Material is in GOOD condition as of this date.

11/05/2007 Material Re-Assessed. Damage Observed <5% Physical Damage - due to 5 LF loose in Front Office. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
11/28/2011	Additional Damage observed - in the form of approximately 20 LF is loose in 1 Office. No other changes as of this date.		
08/28/2014	Material Re-Assessed. Additional 40 LF of Damage found. Baseboard is missing and Mastic/Adhesive is exposed. No other changes as of this date.		
03/27/2017	Additional Damage Observed. 8 LF Loose Mastic Exposed in Office 1. 8 LF Loose and 4 LF Missing in Office 2. No other changes as of this date.		
08/25/2017	Additional Damage Observed. Front Office now has 25 LF of Baseboard Missing. Mastic/Adhesive is Exposed. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

2,660 SF

10/13/2008	4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date.		
03/27/2017	Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

PRESSED WOOD WALL PANEL MASTIC 2,660 SF

10/13/2008 Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date.

03/27/2017 Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

SUSPENDED CEILING TILE 1,600 SF

09/06/2005 2'X4' Suspended Ceiling Tile. This Material is in GOOD condition as of this date.

11/28/2011 Damage Observed. <10% Water Damage - in the form of 2 Tiles are Water Damaged in Office; <5% Physical Damage - in the form of 1 Tile is broken. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

09/09/2016 Additional Damage observed. 1 Tile is missing in Office. No other changes as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

VINYL WALL COVER

2,660 SF

09/06/2005	4'X10' Vinyl Cover on Pressed Wood Wall Panels. This Material is in GOOD condition as of this date.		
11/28/2011	Damage Observed. <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
03/27/2017	Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 Additional Damage Observed. 3 SF of Peeling Vinyl Wall Cover at Plumbing Office. No other changes as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

VINYL WALL COVER MASTIC

2,660 SF

10/13/2008 Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.

11/28/2011 Damage Observed. <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 Additional Damage Observed. 3 SF of Peeling Vinyl Wall Cover at Plumbing Office. No other changes as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

CARPET MASTIC

1,600 SF

04/18/2006 Mastic/Adhesive for Green Carpet. This Material is in GOOD condition as of this date.

03/18/2015 Damage Observed. Offices have Approximately 1 SF of Carpet Damaged exposing Mastic/Adhesive. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/25/2017 Additional Damage Observed. Water Damages and Stains found in all of the Rooms. No other changes as of this date.



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### MENTOR'S HOUSE

### MENTOR'S HOUSE

09/09/2016 BUILDING NOTES:

09/09/2016 Building name changed from DAYCARE BUILDING to MENTOR'S HOUSE.

08/06/2018 Rooms are currently underconstruction. DAYCARE is no longer in this building.

### MENTOR'S HOUSE

ATTIC

LOOSE FILL INSULATION

800 SF

09/06/2005 Blown-In Insulation. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

CHILDREN'S RESTROOM

VINYL FLOOR TILE

70 SF

08/06/2018 12"x12" Gray Pattern Vinyl Floor Tile. 1Tile is Loose. This Material is in FAIR condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
18-127AAA	NEW	NONE DETECTED	( ND )

### MENTOR'S HOUSE

CHILDREN'S RESTROOM

VINYL FLOOR TILE MASTIC

70 SF

08/06/2018	Mastic/Adhesive for 2"x12" Gray Pattern Vinyl Floor Tile. 1 Tile is Loose. This Material is in FAIR condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

18-127AAA	NEW	NONE DETECTED	( ND )
-----------	-----	---------------	--------

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING

250 SF

09/06/2005	Green Vinyl Sheeting. This Material is in GOOD condition as of this date.		
04/18/2006	Vinyl Sheeting has Square Patterns. No other changes as of this date.		
04/14/2008	1 SF is cut and missing in the center of the Kitchen and this Material is in FAIR condition as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10/13/2008	Damages Re-Assessed. Material has been Repaired. This Material changed from FAIR to GOOD condition as of this date.		
09/23/2013	Friability changed from Low to Non. No other changes as of this date.		
03/17/2016	New Gray Speckled Vinyl Floor Sheeting installed. Old Material may remain under New Material. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING

250 SF

03/17/2016	Gray Speckle Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

16-071AAA

ASSUMED

NO SAMPLE

( NS )

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	
LOCATION	
MATERIAL TYPE	
COMMENTS	QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-074AAA	ASSUMED	NO SAMPLE	( NS )

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC 250 SF

09/06/2005	Backing Paper for Green Vinyl Sheeting. This Material is in GOOD condition as of this date.
04/14/2008	1 SF is cut and missing in the center of the Kitchen and this Material is in FAIR condition as of this date.
10/13/2008	Damages reassessed. Material has been replaced. This Material has changed from FAIR to GOOD condition as of this date.
09/23/2013	Friability changed from High to Low. No other changes as of this date.
03/03/2014	Friability changed from Low to Moderate. No other changes as of this date.
03/17/2016	New Gray Speckled Vinyl Floor Sheeting installed. Old Material may remain under New Material. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC 250 SF

03/17/2016	Backing Paper for Gray Speckle Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

16-074AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

500 SF

09/06/2005 Mastic/Adhesive for 1'X1' Ceiling Tile. This Material is in GOOD condition as of this date.

02/12/2018 Damage Observed. <5% Physically Damage - in the form of 4 Tiles have small Cracks and Chips in them. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

08/06/2018 Material Re-assessed. Partial Repairs made some Tiles have been Patched with Mud. Remains in FAIR condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### MENTOR'S HOUSE

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE

500 SF

09/06/2005	1'X1' Ceiling Tile. This Material is in GOOD condition as of this date.
02/12/2018	Damage Observed. <5% Physically Damage - in the form of 4 Tiles have small Cracks and Chips in them. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/06/2018	Material Re-assessed. Partial Repairs made some Tiles have been Patched with Mud. Remains in FAIR condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 3 Loose Tiles at Entry into Kitchen. Material remains in FAIR condition overall. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

**05-212AAA**

**ASSUMED**

**NO SAMPLE**

**( NS )**

### MENTOR'S HOUSE

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

240 SF

04/14/2008	Mastic/Adhesive for Brown/Grey Carpet. This Material is in GOOD condition as of this date.
02/12/2018	Damage Observed. <10% Water Damage - in the form of a 12 SF Water Stain by the Desk. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 3 Loose Tiles at Entry into Kitchen. Material remains in FAIR condition overall. No other changes as of this date.

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	
<b>COMMENTS</b>	<b>QTY (APPROXIMATE)</b>

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
08-075AAA	ASSUMED	NO SAMPLE	( NS )

### MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

6,400 SF

09/06/2005	Gypsum Wallboard System Walls, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.
04/18/2006	This Material is also on ceilings. No other changes as of this date.
08/28/2014	Damage observed. Physical Damage <5% in the of form of a crack in the Hallway. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
03/17/2016	Additional Damage observed. 6 LF is cracked in Kitchen. No other changes as of this date.
03/27/2017	Additional Damage Observed. 12 LF is Cracked in Kitchen. No other changes as of this date.
02/12/2018	Additional Damage Observed. 12 LF Crack in Kithchen is no 1/4" Split to it. No other changes as of this date.
08/06/2018	Material Re-assessed. 12 LF Crack in Kithchen has been Patched with Mud. 6 LF Crack now in the same spot. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 Additional Damage Observed. 4 SF of Water Damage in Day Care Room. No other changes as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL SURFACING

6,400 SF

04/18/2006 Skim Coat for Gypsum Wallboard System Walls, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.

08/28/2014 Damage observed. Physical Damage <5% in the of form of a crack in the Hallway. Material condition changed from GOOD to FAIR overall. No other changes as of this date.

03/17/2016 Additional Damage observed. 6 LF is cracked in Kitchen. No other changes as of this date.

03/27/2017 Additional Damage Observed. 12 LF is Cracked in Kitchen. 2 Small Holes in Large Room with Wood Ceilings. No other changes as of this date.

02/12/2018 Additional Damage Observed. 12 LF Crack in Kithchen is no 1/4" Split to it. No other changes as of this date.

08/06/2018 Material Re-assessed. 12 LF Crack in Kithchen has been Patched with Mud. 6 LF Crack now in the same spot. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 Additional Damage Observed. 4 SF of Water Damage in Day Care Room. No other changes as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### MENTOR'S HOUSE

EXTERIOR WALLS

ROUGH WALL

1,400 SF

09/06/2005	Stucco Walls. This Material is in GOOD condition as of this date.
03/05/2007	Material changed from 'Stucco Walls.' to 'Exterior Stucco Walls.' No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

EXTERIOR WALLS

ROUGH WALL SURFACING

1,400 SF

09/06/2005	Skim Coat for Stucco Walls. This Material is in GOOD condition as of this date.
03/05/2007	Material changed from 'Skim Coat for Stucco Walls.' to 'Skim Coat for Exterior Stucco Walls.' No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

EXTERIOR WINDOWS

CAULKING

400 LF

09/06/2005 Window Caulking. Damaged in various areas. This Material is in FAIR condition as of this date.

05/11/2009 Damage Observed. <10% Water Damage due to moisture and heat degradation on various surfaces. Material remains in FAIR condition overall as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

KITCHEN (COUNTER TOP) AND RESTROOM

MORTAR MISCELLANEOUS

750 SF

04/18/2006 Grout/Mortar for 4"x4" Tan/Light Brown Ceramic Tile. This Material is in GOOD condition as of this date. (Original Entry updated on 04/14/08.)

04/14/2008 4"x4" Ceramic Tile are Tan/Light Brown. Original entry updated. No other changes as of this date.

05/11/2009 Material Re-Assessed. Approximately 70 SF is covering the floor, and approx. 50 SF is under the rubber floor mat. Quantity changed from 750 SF to 820 SF. No other changes as of this date.

08/06/2018 Material Re-assessed. 70 SF has been Removed from Floor. Quantity changed from 820 SF to 750 SF

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### MENTOR'S HOUSE

OFFICE AND DAYCARE ROOMS

CARPET MASTIC

1,300 SF

09/06/2005	Mastic/Adhesive for Blue Carpet. This Material is in GOOD condition as of this date. (Original Entry updated on 04/14/08.)		
04/14/2008	Carpet is Blue. Original entry updated. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### MENTOR'S HOUSE

RESTROOM

BASEBOARD MASTIC

20 LF

10/13/2008 Mastic/Adhesive for 4" Blue Baseboard. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

RESTROOM

VINYL FLOOR TILE

32 SF

10/13/2008 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.

09/23/2013 Friability changed from Low to Non. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08-241AAA	ASSUMED	NO SAMPLE	( NS )

### MENTOR'S HOUSE

RESTROOM

VINYL FLOOR TILE MASTIC

32 SF

10/13/2008 Mastic/Adhesive for 12"x12" off White Vinyl Floor Tile. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### MENTOR'S HOUSE

SOUTHEAST ROOM

LAMINATE FLOORING

421 SF

08/06/2018 Pergo Laminate Flooring. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
18-127AAA	NEW	NONE DETECTED	( ND )

### MENTOR'S HOUSE

SOUTHEAST ROOM

LAMINATE FLOORING MASTIC

421 SF

08/06/2018 Mastic/Adhesive for Pergo Laminate Flooring. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

18-127AAA	NEW	NONE DETECTED	( ND )
-----------	-----	---------------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

<b>SAMPLE NO.</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS CODE</b>
-------------------	-------------------------	----------------------	----------------------

### METAL STORAGE CONTAINERS (25 EA)

### METAL STORAGE CONTAINERS (25 EA)

09/06/2005	BUILDING NOTES:
09/06/2005	Assumed Non-ACM. All Metal Construction.
11/28/2011	Building Name changed from METAL STORAGE SHEDS to METAL STORAGE CONTAINERS (8 EA). Area changed from 3,180 SF to 2,560 SF.
08/09/2021	Quantity Re-Assessed from METAL STORAGE CONTAINER (8 EA) to METAL STORAGE CONTAINER (10 EA). Material Quantity changed from 2,560 SF to 2,750 SF. No other changes as of this date.

### METAL STORAGE CONTAINERS (25 EA)

#### METAL STORAGE CONTAINERS (25 EA)

#### STORAGE CONTAINER

7,550 SF

09/06/2005	Metal Storage Containers 6 EA, approximately 426 SF EA.
04/18/2006	Material redefined as (3) Metal Storage Units. Quantity changed from 530 SF to 1,590 SF. No other changes as of this date.
03/05/2007	Location Name changed from METAL STORAGE SHEDS to METAL STORAGE SHEDS (3). No other changes as of this date.
08/30/2010	Location Description changed from METAL STORAGE SHEDS (3) to METAL STORAGE SHEDS (6). Quantity changed from 1,590 SF to 3,180 SF. No other changes as of this date.
11/28/2011	Location Description changed from METAL STORAGE SHEDS (6) to METAL STORAGE CONTAINERS (8). Quantity changed from 3,180 SF to 2,560 SF. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/09/2021	Quantity Re-Assessed from METAL STORAGE CONTAINER (8 EA) to METAL STORAGE CONTAINER (10 EA). Material Quantity changed from 2,560 SF to 2,750 SF. No other changes as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	Additional Material Quantity Observed. 15 (EA) Additional containers Observed on site. Material Quantity changed from 2,750 SF to 7,550 SF. This Material is in GOOD condition as of this date. No other changes as of this date.		
02/13/2023	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212.NS	ASSUMED	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### METAL STORAGE SHED

### METAL STORAGE SHED

11/28/2011 BUILDING NOTES:

11/28/2011 Metal Storage Shed.

### METAL STORAGE SHED

METAL STORAGE SHED

STORAGE BUILDING

725 SF

11/28/2011 Metal Storage Shed 1 EA.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

11-202.NS	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### PG&E NORTH TOWER BUILDING

### PG&E NORTH TOWER BUILDING

11/28/2011 BUILDING NOTES:

11/28/2011 Metal and Concrete Building.

12/01/2016 Building name changed from PG&E to PG&E NORTH TOWER BUILDING.

### PG&E NORTH TOWER BUILDING

PG&E

MISCELLANEOUS

154 SF

03/17/2016 Metal and Concrete Building. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

16-074.NS	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE No.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### PG&E SOUTH TOWER ENCLOSURE

### PG&E SOUTH TOWER ENCLOSURE

12/01/2016 BUILDING NOTES:

12/01/2016 Building name changed from TOWER to PG&E SOUTH TOWER ENCLOSURE.

### PG&E SOUTH TOWER ENCLOSURE

TOWER

WOOD WALL

533 SF

11/28/2011 Wood Wall. Non-ACM Material identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

11-202.NS	NON-ACM	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### STUDENT NUTRITION SERVICE

### STUDENT NUTRITION SERVICE

02/16/2022 BUILDING NOTES:

02/16/2022 Student Nutricion Services, constrcuted about 3 years ago.

### STUDENT NUTRITION SERVICE

STUDENT NUTRITION SERVICES - KITCHEN

PERMANENT BUILDING

7,480 SF

02/16/2022 New Permant Building. Material in GOOD condtion as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

22-025.NS	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

03/05/2007 BUILDING NOTES:

03/05/2007 Building Name changed from MAIN OFFICE to MAIN OFFICE BUILDING.

12/01/2016 Building Name changed from MAIN OFFICE BUILDING to TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE

38 SF

11/28/2011 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/27/2017 Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/25/2017 Additional Damage Observed. 3 Tiles are now Cracked. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

38 SF

11/28/2011	Mastic/Adhesive for 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
03/27/2017	Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/25/2017	Additional Damage Observed. 3 Tiles are now Cracked. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

1,500 SF

05/12/2009	2'x4' Suspended Ceiling Tile, (with small uneven cuts and holes pattern). Damage Observed. <5% Physical Damage due to 3 missing Tiles. This Material is in FAIR condition as of this date.
03/08/2010	Location Description changed from STAFF'S LOUNGE ROOM to CONFERENCE ROOM AND STAFF'S LOUNGE ROOM. Quantity changed from 500 SF to 1,500 SF. Additional Damage: <10% Water Damage in the form of 2 Tiles are Water Damaged. No other changes as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/30/2010	Location Description changed from CONFERENCE ROOM AND STAFF'S LOUNGE ROOM to CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND STORAGE ROOM. Additional Damage observed in Conference Room in the form of 3 Tiles are Water Damaged and 1 has a hole. No other changes as of this date.		
11/28/2011	Additional Damage observed - in the form of 3 more Tiles are Water Damaged, and 1 Tile is missing in Storage Room. No other changes as of this date.		
10/08/2012	Damage Re-Assessed and Conference Room now has a total of 4 Water Damaged Tiles. No other changes as of this date.		
09/23/2013	Material Re-Assessed. Conference Room now has Debris on Floor due to Water leaks from the Roof. No other changes as of this date.		
03/03/2014	Debris has been cleaned up. No other changes as of this date.		
08/28/2014	Material Re-Assessed. 2 Suspended Ceiling Tiles have Water Damage in the Office.		
03/18/2015	Additional Damage Observed. 3 Suspended Ceiling Tiles Water Damaged. No other change as of this date.		
03/17/2016	Additional Damage observed. 1 Tile is missing in Director's Office. No other changes as of this date.		
09/09/2016	Partial Repairs observed. Current Damage: 2 Tiles with Water Damage in the Storage Room, and 1 Tile with Water Damage in the Conference Room. No other changes as of this date.		
03/27/2017	Additional Damage Observed. 2 Tiles with Water Stains and Several Tiles Have been repainted in Staff Room. However 11 Tiles have Cracks and Cuts with Broken Edges in Staff Room. 5 Tiles have Water Damage while other have been Painted Over. Several Tiles have Cracks and Broken Edges in the Conference Room. 2 Tiles have Water Damage in the Storage by Front of the Building. 2 Tiles have Water Damage and 1 Tile Missing in the Storage by Rear of the Building. No other changes as of this date.		
08/25/2017	Additional Damage Observed. Conference Room now has 3 Tiles with Water Damage. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

00 000000

ASSUMED

NO SAMPLE

( NS )

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-008AAA	ASSUMED	NO SAMPLE	( NS )

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

252 SF

09/06/2005	Fire Door Core Insulation (12 EA DOORS). This Material is in GOOD condition as of this date.
03/05/2007	This Material is unchanged as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

EXTERIOR BUILDING

WEATHER PROOFING (OUTSIDE)

1,100 SF

03/05/2007	Weather Proofing Material. This Material is in GOOD condition as of this date.
11/28/2011	Damage Observed. <5% Physical Damage - in the form of approximately 2 SF of Wall is peeling. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
03/17/2016	Repairs observed. Damage has been Repaired. Material condition changed from FAIR to GOOD. Friability changed from Low to Non. No other changes as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/06/2018	Damage Observed. <5% Physical Damage - in the form of 1 SF to 1 Panel is Broken on North Wall. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

**07-041AAA**

**ASSUMED**

**NO SAMPLE**

**( NS )**

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

LOUNGE ROOM

SINK UNDERCOATING

4 SF

04/14/2008	Black Thermal Undercoating on Sink (1 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 03/17/16.)
08/30/2010	Undercoating is Black. Original entry updated. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 This Material is unchanged as of this date.

08-075AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

BASEBOARD MASTIC

1,400 LF

09/06/2005 Mastic/Adhesive for Baseboard. Approximately 15 LF exposed in Womens Restroom. This Material is in FAIR condition as of this date.

04/18/2006 Material redefined as 4" Black Baseboard (in Offices and Hallways) and 4" Blue Baseboard (in Conference Room). All Damages have been repaired. Friability changed from Non-Friable to Friable. No other changes as of this date.

03/08/2010 Material Re-Assessed. 4" Brown Baseboard was also observed in several Offices and Main Entry Office. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 New Material Installed. Men's and Women's Restrooms Floor and Baseboard now Covered with Vinyl Sheeting. Old Material is Possibly Behind. No other changes as of this date.

03/27/2017 Damage Observed. <5% Physical Damage - in the form of 4" of Baseboard is missing in Main Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### MAIN OFFICE

#### SMOOTH WALL MISCELLANEOUS

5,100 SF

09/06/2005	Gypsum Wallboard System, Walls. Damages noticed. This Material is in FAIR condition as of this date.
05/11/2009	Additional Damages Observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date.
11/28/2011	Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Additional Damage Observed. <10% Water Damage in the form of 1 SF of Water Damage on Wall under Urinal in Mens Retroom in Drivers Lounge. Material remains in FAIR condition overall. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### MAIN OFFICE

#### SMOOTH WALL SURFACING

5,100 SF

04/18/2006	Skim Coat for Gypsum Wallboard System, Walls. Various Damages noticed. This Material is in FAIR condition as of this date.
05/11/2009	Additional Damages observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
11/28/2011	Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. No other changes as of this date.		
03/03/2014	This Material is unchanged as of this date.		
08/28/2014	This Material is unchanged as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	Additional Damage Observed. <10% Water Damage in the form of 1 SF of Water Damage on Wall under Urinal in Mens Restroom in Drivers Lounge. Material remains in FAIR condition overall. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

SUSPENDED CEILING TILE

2,150 SF

09/06/2005	2'X4' Suspended Ceiling Tile. Several Tiles Damaged and Water stained. This Material is in FAIR condition as of this date.		
11/05/2007	Material Re-Assessed. Damage: <5% Physical Damage - 1 Tile in Telephone Panel Closet and 1 Tile in Mens Restroom; <10% Water Damage - 2 Tiles in Blueprint Office and 4 Tiles in Trainer Office. This Material is in FAIR condition overall as of this date.		
04/14/2008	Additional Damage noted: 1/2 Tile is missing in the Supply Storage Room as of this date.		
10/13/2008	Additional 3 Tiles missing at Lounge area. Also several Tiles Damaged at Hallway. No other changes as of this date.		
05/11/2009	Damages Re-Assessed. 1 Tile is missing above the Main Entry Door, (next to Receptionist Office). Physical damage is in various locations. Tiles damaged in Telephone Panel Closet has increased to 3 Tiles. Quantity changed from 2,650 SF to 3,150 SF. No change to damage in Hallway. Friability changed from Moderate to High to reflect these changes.		

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

47

***HazMat Doc***

AHERA Report B - Survey

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/03/2009	Repairs have been made in Main Lobby. Missing Tile has been replaced. Also, 3 Tiles Damaged at Hallway have been repaired. Telephone Panel Closet and Storage Closet are Water Damaged. No other changes as of this date.		
03/08/2010	Material Re-Assessed. Approx. 1,000 SF of 2'x4' Suspended Ceiling Tile is the same as Staff's Lounge. Quantity changed from 3,150 SF to 2,150 SF. Additional Damage in the form of 6 Tiles are cracked in Hallway and Main Office. Also, 2 Tiles are Water Damaged in Office, adjacent to Lounge Room. Material remains in FAIR condition. No other changes as of this date.		
11/28/2011	Additional Damage observed - in the form of Hallway has some Tiles broken. No other changes as of this date.		
10/08/2012	Additional Damage - in the form of 1 hole observed on Hallway Ceiling. Also, 2 additional Water Damaged Tiles observed in Telephone Panel Closet. No other changes as of this date.		
03/03/2014	This Material is unchanged as of this date.		
08/28/2014	Material Re-Assessed. Additional Water Damage Observed. No other changes as of this date.		
03/17/2016	Additional Damage observed and Partial Repairs made. Director's Office has 1 Tile with Water Damage. Missing Tile above Main Entry Door has been Replaced. No other changes as of this date.		
09/09/2016	Additional Damage observed. 2 Tiles with Water Damage in Trainer's Office. No other changes as of this date.		
03/27/2017	Additional Damage Observed. 4 Tiles with Water Damage and Several other have broken edges and are Cracked in the Director's Office. 4 Water Damage Tiles, 7 other Tiles have Cracks, in the Project Manager's Office. 4 Tiles with Cracked and Chipped Tiles in the Executive Assistant Office. No other changes as of this date.		
08/25/2017	Additional Damage Observed. Trainer's Office now has 3 Tiles. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

05-212AAA

ASSUMED

NO SAMPLE

( NS )

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

48

***HazMat Doc***

AHERA Report B - Survey

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC 3,300 SF

04/18/2006	Mastic/Adhesive for Carpets (Approximately 80% Blue and 20% Mix of Red, Brown and Grey Colors). This Material is in FAIR condition as of this date.
05/11/2009	Damage Observed. <5% Physical Damage in the form of the Carpet has been Damaged due to several separations observed in locations of seams. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
03/27/2017	Additional Damage Observed. Storage Room by Rear of Building there is Water Damage in the form of Stains and Mold, still damp. 20 LF of Blue Carpet in the Staff Lounge is loose. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	Additional Damage Observed. 6 SF of Detached and Wavy Carpet in Conference Room. No other changes as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER 7,800 SF

10/13/2008	Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date.
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/26/2020	This Material is unchanged as of this date.		
02/08/2021	Additional Damage Observed. 1 Panel with Holes in it and 1 Panle has Scrapes and Cuts in Project Manager's Office. No other changes as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

<b>08-214AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC 7,800 SF

10/13/2008	Mastic/Adhesive for Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date.		
09/03/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.		
03/03/2014	This Material is unchanged as of this date.		
08/28/2014	This Material is unchanged as of this date.		
03/18/2015	This Material is unchanged as of this date.		
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	Additional Damage Observed. 1 Panel with Holes in it and 1 Panle has Scrapes and Cuts in Project Manager's Office. No other changes as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/13/2023 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

7,800 SF

09/06/2005 Pressed wood wall panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date.

10/13/2008 Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date.

09/03/2009 Material remains in <5% Physical Damage. No changes as of this date.

03/03/2014 This Material is unchanged as of this date.

03/27/2017 Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL MASTIC

7,800 SF

09/06/2005 Mastic/Adhesive for Pressed Wood Wall Panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10/13/2008	Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date.		
09/03/2009	Material remains in <5% Physical Damage. No changes as of this date.		
03/03/2014	This Material is unchanged as of this date.		
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

PLENUM

WALL INSULATION

2,500 SF

09/06/2005	Spray-On Foam Insulation. Material is loose and Water Damaged in several locations. This Material is in FAIR condition as of this date.		
09/03/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
08/28/2014	This Material is unchanged as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

STAFF RESTROOMS (2)

VINYL SHEETING

400 SF

04/18/2006 Grey Vinyl Sheeting. (Apparent New Material identified by the AHERA Accredited Inspector). This material is in GOOD condition as of this date.

03/05/2007 Location Name changed from TWO STAFF RESTROOMS to STAFF RESTROOMS (2). No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

STAFF RESTROOMS (2)

VINYL SHEETING BACKING PAPER/MASTIC

400 SF

04/18/2006 Backing Paper for Grey Vinyl Sheeting. (Apparent New Material identified by the AHERA Accredited Inspector). This material is in GOOD condition as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

03/05/2007	Location Name changed from TWO STAFF RESTROOMS to STAFF RESTROOMS (2). No other changes as of this date.		
03/03/2014	This Material is unchanged as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE

700 SF

09/06/2005	9"X9" Vinyl Floor Tile, under carpeting in programming room. Approximately 10 SF missing in Womens Restroom, also Damaged in 2 Restrooms. This Material is in FAIR condition as of this date.		
04/18/2006	Approximately 400 SF of Material Removed in two Restrooms. Quantity changed from 1,100 SF to 700 SF. Material replaced with New Grey Vinyl Sheeting. No other changes as of this date.		
05/11/2009	Material Re-Assessed. Material is not visible in remaining locations due to being covered with existing Carpet. New Grey Vinyl Sheeting is in Restrooms. Material condition is TBD.		
09/23/2013	Material Re-Assessed. This Material changed from FAIR to GOOD condition. No other changes as of this date.		
03/03/2014	This Material is unchanged as of this date.		
08/28/2014	This Material is unchanged as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

700 SF

09/06/2005 Mastic/Adhesive for 9"X9" Vinyl Floor Tile, under carpeting in programming room. Approximately 10 SF missing in Womens Restroom, also Damaged in 2 Restrooms. This Material is in FAIR condition as of this date.

04/18/2006 Approximately 400 SF of Material removed in 2 Restrooms. Quantity changed from 1,100 SF to 700 SF. Material replaced with New Backing Paper for Grey Vinyl Sheeting. No other changes as of this date.

05/11/2009 Material Re-Assessed. Material is not visible in remaining locations due to being covered with existing Carpet. New Grey Vinyl Sheeting is in Restrooms. Material condition is TBD.

09/23/2013 Material Re-Assessed. This Material changed from FAIR to GOOD condition. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### WAREHOUSE BUILDING

### WAREHOUSE BUILDING

08/15/2022 BUILDING NOTES:  
08/15/2022 Building is inaccessible on this date due to fire damage.  
02/13/2023 Building is inaccessible on this date due to fire damage.

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

470 LF

09/06/2005 Mastic/Adhesive for 4" Black and brown Baseboards. Material is exposed in Carpenters Shop and Restroom. This Material is in FAIR condition as of this date.  
04/18/2006 Approximately 120 LF is exposed in Shop and Main Office. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date.  
05/11/2009 Damages Re-Assessed. Physical Damages remains at <50%. This Material is unchanged as of this date.  
02/04/2019 This Material is unchanged as of this date.  
08/12/2019 This Material is unchanged as of this date.  
08/26/2020 Additional Damage Observed. <5% Physical Damage in the form of 2 LF of Missing Baseboard with Brown Mastic exposed in Restroom. Material remains in FAIR condition overall. No other changes as of this date.  
02/08/2021 This Material is unchanged as of this date.  
08/09/2021 This Material is unchanged as of this date.  
02/16/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

2,310 SF

09/06/2005 12"X12" Multi-Color Vinyl Floor Tile. Broken and missing in various locations. This Material is in FAIR condition as of this date.

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/14/2008	50 SF Removed in the Restroom. Quantity changed from 2,360 SF to 2,310 SF. This Material condition is unchanged as of this date.		
05/11/2009	Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Recommendation changed to reflect this change.		
04/13/2012	Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date.		
10/08/2012	Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date.		
08/28/2014	Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE MASTIC

2,360 SF

09/06/2005	Mastic/Adhesive for 12"X12" Multi-Color Vinyl Floor Tile. Material is exposed in broken and missing Tile locations. This Material is in FAIR condition as of this date.		
04/14/2008	50 SF is exposed in the Restroom. This Material condition is unchanged as of this date.		
05/11/2009	Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is Damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Friability changed from Low to Moderate. Recommendation changed to reflect this change. 50 SF that was exposed in Restroom has been repaired. Material has been replaced with Off-White 12"x12".		
04/13/2012	Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date.		

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

58

***HazMat Doc***

AHERA Report B - Survey



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10/08/2012	Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date.		
08/28/2014	Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM

CEILING MASTIC

1,000 SF

03/05/2007	Mastic/Adhesive for 1'x1' Ceiling Tile. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. No other changes as of this date.		
05/11/2009	Material condition is FAIR overall. This Material is unchanged as of this date.		
09/03/2009	Material Re-Assessed. Physical Damage is <50% and remains in FAIR condition overall as of this date.		
10/08/2012	Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date.		
08/28/2014	Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. No other changes as of this date.		
03/27/2017	Additional Damage Observed. Storage Room has 100 SF of Water Damage and 6 Tiles are Missing. 40 Sf of Water Damage and 25 loose Tiles in the Shop. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

07-041AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM

CEILING TILE

1,000 SF

09/06/2005 1'X1' Nailed-On Ceiling Tile. Material is damaged in the form of holes and cuts. This Material is in FAIR condition as of this date.

04/18/2006 Damage Observed. >10% Water Damaged. Friability changed from Moderate to High. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date.

03/05/2007 Material Description changed from ' 1'x1' Nailed-on Ceiling Tile. ' to '1'x1' Ceiling Tile, (Glued-on). Mastic/Adhesive entry added for this Material. Damage reassessed. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. Friability changed to High. No other changes as of this date.

09/03/2009 Damage Re-Assessed. Physical Damage has changed to <50% due to scratches and gouging observed. Water Damage remains <10% and in POOR condition as of this date.

10/08/2012 Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date.

08/28/2014 Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. Friability changed from Low to Moderate. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### WAREHOUSE BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

294 SF

09/06/2005	Fire Door Core Insulation (14 EA DOOR). This Material is in GOOD condition as of this date. (Original entry updated 09/16/15)
09/16/2015	Location and Quantity Re-Assessed. Location Description changed from 'SPRINKLER AND GROUND SHOP' to 'ENTIRE BUILDING'. There are 14 Fire Doors. Original entry updated, Material description changed from 'FIRE DOOR CORE INSULATION. (1 EA DOOR)' to ' FIRE DOOR CORE INSULATION. (14 EA DOOR)'. Quantity changed from 21 SF to 294 SF. No other change as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.

<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

### WAREHOUSE BUILDING

EXTERIOR WALL OF WAREHOUSE OFFICE

CHALK BOARD

20 SF

05/11/2009	Green Cementitious Chalkboard (1 EA). This Material is in GOOD condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.

<b>09-098AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### WAREHOUSE BUILDING

EXTERIOR WALL OF WAREHOUSE OFFICE

WALL MASTIC

20 SF

05/11/2009	Mastic/Adhesive for Green Cementitious Chalkboard (1 EA). This Material is in GOOD condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

09-098AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### WAREHOUSE BUILDING

WAREHOUSE OFFICE

CARPET MASTIC

72 SF

09/06/2005	Mastic/Adhesive for Grey Carpet. This Material is in GOOD condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL MISCELLANEOUS

6,620 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.		
------------	---	--	--

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/05/2007	Damage Re-Assessed. Damage Observed. <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date.		
04/14/2008	Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF Damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date.		
09/03/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
09/23/2013	Friability changed from Moderate to Low. No other changes as of this date.		
03/27/2017	No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 10 SF of Cracks and Peeling on Ceiling in Woodshop Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

6,620 SF

04/18/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.		
03/05/2007	Damage Re-Assessed. Damage: <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date.		
04/14/2008	Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date.		
09/03/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.		
09/23/2013	Friability changed from Moderate to Low. No other changes as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/03/2014	Friability changed from Low to Moderate. No other changes as of this date.		
03/27/2017	No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 10 SF of Cracks and Peeling on Ceiling in Woodshop Restroom. Material remains in FAIR condition overall. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

### WAREHOUSE BUILDING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE

50 SF

05/11/2009	12"x12" Off-White Vinyl Floor Tile. Old Mastic/Adhesive may exist under new Vinyl Floor Tile and Mastic/Adhesive. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

09-098AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### WAREHOUSE BUILDING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE MASTIC

50 SF

05/11/2009	Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. Old Mastic/Adhesive may exist under new Vinyl Floor Tile and Mastic/Adhesive. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		

09-098AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

<b>BUILDING NAME</b>	
<b>LOCATION</b>	
<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>	

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### WELDING SHOP BUILDING

### WELDING SHOP BUILDING

03/05/2007	BUILDING NOTES:
03/05/2007	Building Name changed from SIGNS / TOOLS / PARTS SHOP to SIGNS / TOOLS / PARTS SHOP BUILDING.
03/17/2016	Building Name changed from SIGNS/TOOLS/PARTS SHOP BUILDING to WELDING SHOP BUILDING.

### WELDING SHOP BUILDING

#### EXTERIOR

FIRE DOOR CORE INSULATION 21 SF

09/16/2015	Fire Door Core Insulation (1 EA Doors). This Material is in GOOD condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### WELDING SHOP BUILDING

#### SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL MISCELLANEOUS 650 SF

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
04/18/2006	Material Re-Assessed. Damage: <10% Physical Damage - noted in forms of holes and cuts. This Material is in FAIR condition overall as of this date.



# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05/11/2009	Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Recommendation changed to reflect this change. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

**05-212AAA**

**ASSUMED**

**NO SAMPLE**

**( NS )**

### WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

650 SF

04/18/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. <10% Physical Damages noted in forms of holes and cuts. This Material is in FAIR condition as of this date.		
05/11/2009	Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Recommendation changed to reflect this change.		
09/23/2013	This Material changed from POOR condition to FAIR condition as of this date. No other changes as of this date.		
08/28/2014	This Material is in POOR condition as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	This Material is unchanged as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE No.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**WOOD SHEDS (2 EA)**

**WOOD SHEDS (2 EA)**

03/08/2010 BUILDING NOTES:

03/08/2010 Wood Storage Sheds are located on back side of Daycare Building.

03/17/2016 Building Name changed from WOOD SHEDS (3) to WOOD SHEDS (2 EA) (by Daycare).

**WOOD SHEDS (2 EA)**

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

200 SF

03/08/2010 Wood Wall Panels. Non-ACM Material identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

10-052AAA	NON-ACM	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### WOOD STORAGE SHED

### WOOD STORAGE SHED

WOOD STORAGE SHED

WOOD WALL

330 SF

11/28/2011 Wood Walls. Non-ACM Material identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

11-202.NS	NON-ACM	NO SAMPLE	( NS )
-----------	---------	-----------	--------

End Of Report, Total Of 70 Pages

# HOMOGENEOUS MATERIALS IN

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### MATERIAL CATEGORY

### LOCATION

### MATERIAL TYPE

#### GROUPS PORTABLE

##### MISCELLANEOUS MATERIAL

EXTERIOR DOOR

FIRE DOOR CORE INSULATION

INTERIOR DOOR

FIRE DOOR CORE INSULATION

PORTABLES

BASEBOARD MASTIC

PORTABLES

SUSPENDED CEILING TILE

PORTABLES

VINYL FLOOR TILE

PORTABLES

VINYL FLOOR TILE MASTIC

#### GROUPS STORAGE BUILDING

##### MISCELLANEOUS MATERIAL

EXTERIOR

FIRE DOOR CORE INSULATION

#### MAINTENANCE GARAGE BUILDING

##### MISCELLANEOUS MATERIAL

OFFICE

SINK UNDERCOATING

OFFICE

SUSPENDED CEILING TILE

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL  
MISCELLANEOUS

REPAIR / SERVICES GARAGE

CHALK BOARD

REPAIR / SERVICES GARAGE

WALL MASTIC

RESTROOMS (2), AND SHOWER ROOM

HEAT SHIELD

##### SURFACING MATERIAL

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

#### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

##### MISCELLANEOUS MATERIAL

DOORS - EXTERIOR

FIRE DOOR CORE INSULATION

DOORS - INTERIOR

FIRE DOOR CORE INSULATION

EXTERIOR WALLS

WEATHER PROOFING  
(OUTSIDE)

HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC

HVAC OFFICE AND HALLWAY

SMOOTH WALL  
MISCELLANEOUS

OFFICE PORTABLE

BASEBOARD MASTIC

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

OFFICE PORTABLE

PRESSED WOOD WALL PANEL  
MASTIC

OFFICE PORTABLE

SUSPENDED CEILING TILE

OFFICE PORTABLE

VINYL WALL COVER

OFFICE PORTABLE

VINYL WALL COVER MASTIC

OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

CARPET MASTIC

# HOMOGENEOUS MATERIALS IN

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### MATERIAL CATEGORY

### LOCATION

### MATERIAL TYPE

#### SURFACING MATERIAL

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING

### MENTOR'S HOUSE

#### MISCELLANEOUS MATERIAL

ATTIC

LOOSE FILL INSULATION

CHILDREN'S RESTROOM

VINYL FLOOR TILE

CHILDREN'S RESTROOM

VINYL FLOOR TILE MASTIC

DAYCARE KITCHEN

VINYL SHEETING

DAYCARE KITCHEN

VINYL SHEETING

DAYCARE KITCHEN

VINYL SHEETING BACKING  
PAPER/MASTIC

DAYCARE KITCHEN

VINYL SHEETING BACKING  
PAPER/MASTIC

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

ENTIRE BUILDING

SMOOTH WALL  
MISCELLANEOUS

EXTERIOR WINDOWS

CAULKING

KITCHEN (COUNTER TOP) AND RESTROOM

MORTAR MISCELLANEOUS

OFFICE AND DAYCARE ROOMS

CARPET MASTIC

RESTROOM

BASEBOARD MASTIC

RESTROOM

VINYL FLOOR TILE

RESTROOM

VINYL FLOOR TILE MASTIC

SOUTHEAST ROOM

LAMINATE FLOORING

SOUTHEAST ROOM

LAMINATE FLOORING MASTIC

#### SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

EXTERIOR WALLS

ROUGH WALL

EXTERIOR WALLS

ROUGH WALL SURFACING

### METAL STORAGE CONTAINERS (25 EA)

#### MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINERS (25 EA)

STORAGE CONTAINER

### METAL STORAGE SHED

#### MISCELLANEOUS MATERIAL

METAL STORAGE SHED

STORAGE BUILDING

### PG&E NORTH TOWER BUILDING

# HOMOGENEOUS MATERIALS IN

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### MATERIAL CATEGORY

### LOCATION

### MATERIAL TYPE

MISCELLANEOUS MATERIAL

PG&E

MISCELLANEOUS

### PG&E SOUTH TOWER ENCLOSURE

MISCELLANEOUS MATERIAL

TOWER

WOOD WALL

### STUDENT NUTRITION SERVICE

MISCELLANEOUS MATERIAL

STUDENT NUTRITION SERVICES - KITCHEN

PERMANENT BUILDING

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MISCELLANEOUS MATERIAL

ASSISTANT DIRECTOR

VINYL FLOOR TILE

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

EXTERIOR BUILDING

WEATHER PROOFING  
(OUTSIDE)

LOUNGE ROOM

SINK UNDERCOATING

MAIN OFFICE

BASEBOARD MASTIC

MAIN OFFICE

SMOOTH WALL  
MISCELLANEOUS

MAIN OFFICE

SUSPENDED CEILING TILE

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL  
MASTIC

PLENUM

WALL INSULATION

STAFF RESTROOMS (2)

VINYL SHEETING

STAFF RESTROOMS (2)

VINYL SHEETING BACKING  
PAPER/MASTIC

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

SURFACING MATERIAL

MAIN OFFICE

SMOOTH WALL SURFACING

### WAREHOUSE BUILDING

# HOMOGENEOUS MATERIALS IN

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### MATERIAL CATEGORY

### LOCATION

### MATERIAL TYPE

#### MISCELLANEOUS MATERIAL

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM  
ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE  
STORAGE ROOM  
ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE  
STORAGE ROOM  
CARPENTERS SHOP, AND RESTROOM  
CARPENTERS SHOP, AND RESTROOM  
ENTIRE BUILDING  
EXTERIOR WALL OF WAREHOUSE OFFICE  
EXTERIOR WALL OF WAREHOUSE OFFICE  
WAREHOUSE OFFICE  
WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS  
  
WOOD SHOP (RESTROOM ONLY)  
WOOD SHOP (RESTROOM ONLY)

BASEBOARD MASTIC  
VINYL FLOOR TILE  
  
VINYL FLOOR TILE MASTIC  
  
CEILING MASTIC  
CEILING TILE  
FIRE DOOR CORE INSULATION  
CHALK BOARD  
WALL MASTIC  
CARPET MASTIC  
SMOOTH WALL  
MISCELLANEOUS  
VINYL FLOOR TILE  
VINYL FLOOR TILE MASTIC

#### SURFACING MATERIAL

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

### WELDING SHOP BUILDING

#### MISCELLANEOUS MATERIAL

EXTERIOR  
SIGNS / TOOLS / PARTS SHOP

FIRE DOOR CORE INSULATION  
SMOOTH WALL  
MISCELLANEOUS

#### SURFACING MATERIAL

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

### WOOD SHEDS (2 EA)

#### MISCELLANEOUS MATERIAL

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

### WOOD STORAGE SHED

#### MISCELLANEOUS MATERIAL

WOOD STORAGE SHED

WOOD WALL

End Of Report, Total Of 4 Pages



# FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
	MATERIAL TYPE		
<b>GROUPS PORTABLE</b>			
	EXTERIOR DOOR		
	FIRE DOOR CORE INSULATION	42 SF	Assumed
	INTERIOR DOOR		
	FIRE DOOR CORE INSULATION	21 SF	Assumed
	PORTABLES		
	BASEBOARD MASTIC	130 LF	Assumed
	PORTABLES		
	SUSPENDED CEILING TILE	450 SF	Assumed
	PORTABLES		
	VINYL FLOOR TILE	480 SF	Assumed
	PORTABLES		
	VINYL FLOOR TILE MASTIC	480 SF	Assumed
<b>GROUPS STORAGE BUILDING</b>			
	EXTERIOR		
	FIRE DOOR CORE INSULATION	21 SF	Assumed
<b>MAINTENANCE GARAGE BUILDING</b>			
	OFFICE		
	SUSPENDED CEILING TILE	260 SF	Assumed
	OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM		
	SMOOTH WALL MISCELLANEOUS	2,650 SF	Assumed
	OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM		
	SMOOTH WALL SURFACING	2,650 SF	Assumed
	RESTROOMS (2), AND SHOWER ROOM		
	HEAT SHIELD	7.5 SF	Assumed
<b>MAINTENANCE SHOPS OFFICE PORTABLE BUILDING</b>			
	DOORS - EXTERIOR		
	FIRE DOOR CORE INSULATION	42 SF	Assumed
	DOORS - INTERIOR		
	FIRE DOOR CORE INSULATION	168 SF	Assumed
	HVAC OFFICE AND HALLWAY		
	SMOOTH WALL MISCELLANEOUS	1,000 SF	Assumed
	HVAC OFFICE AND HALLWAY		
	SMOOTH WALL SURFACING	1,000 SF	Assumed

# FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
OFFICE PORTABLE			
BASEBOARD MASTIC		265 LF	Assumed
OFFICE PORTABLE			
PRESSED WOOD WALL PANEL		2,660 SF	Assumed
OFFICE PORTABLE			
PRESSED WOOD WALL PANEL MASTIC		2,660 SF	Assumed
OFFICE PORTABLE			
SUSPENDED CEILING TILE		1,600 SF	Assumed
OFFICE PORTABLE			
VINYL WALL COVER		2,660 SF	Assumed
OFFICE PORTABLE			
VINYL WALL COVER MASTIC		2,660 SF	Assumed
OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE			
CARPET MASTIC		1,600 SF	Assumed
<b>MENTOR'S HOUSE</b>			
ATTIC			
LOOSE FILL INSULATION		800 SF	Assumed
CHILDREN'S RESTROOM			
VINYL FLOOR TILE		70 SF	New Material
CHILDREN'S RESTROOM			
VINYL FLOOR TILE MASTIC		70 SF	New Material
DAYCARE KITCHEN			
VINYL SHEETING BACKING PAPER/MASTIC		250 SF	Assumed
DAYCARE KITCHEN			
VINYL SHEETING BACKING PAPER/MASTIC		250 SF	Assumed
DAYCARE ROOM AND ENTRY TO KITCHEN			
CEILING MASTIC		500 SF	Assumed
DAYCARE ROOM AND ENTRY TO KITCHEN			
CEILING TILE		500 SF	Assumed
DAYCARE ROOM (IN SE CORNER OF BUILDING)			
CARPET MASTIC		240 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL MISCELLANEOUS		6,400 SF	Assumed
ENTIRE BUILDING			
SMOOTH WALL SURFACING		6,400 SF	Assumed

S= Sq. Ft, I=Inches, L=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
EXTERIOR WINDOWS			
CAULKING		400 LF	Assumed
<b>TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING</b>			
ASSISTANT DIRECTOR			
VINYL FLOOR TILE		38 SF	Assumed
ASSISTANT DIRECTOR			
VINYL FLOOR TILE MASTIC		38 SF	Assumed
CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM			
SUSPENDED CEILING TILE		1,500 SF	Assumed
ENTIRE BUILDING			
FIRE DOOR CORE INSULATION		252 SF	Assumed
EXTERIOR BUILDING			
WEATHER PROOFING (OUTSIDE)		1,100 SF	Assumed
MAIN OFFICE			
BASEBOARD MASTIC		1,400 LF	Assumed
MAIN OFFICE			
SMOOTH WALL MISCELLANEOUS		5,100 SF	Assumed
MAIN OFFICE			
SMOOTH WALL SURFACING		5,100 SF	Assumed
MAIN OFFICE			
SUSPENDED CEILING TILE		2,150 SF	Assumed
MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM			
CARPET MASTIC		3,300 SF	Assumed
MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM			
VINYL WALL COVER		7,800 SF	Assumed
MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM			
VINYL WALL COVER MASTIC		7,800 SF	Assumed
MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM			
PRESSED WOOD WALL PANEL		7,800 SF	Assumed
MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM			
PRESSED WOOD WALL PANEL MASTIC		7,800 SF	Assumed
PLENUM			
WALL INSULATION		2,500 SF	Assumed
STAFF RESTROOMS (2)			
VINYL SHEETING BACKING PAPER/MASTIC		400 SF	Assumed

S= Sq. Ft, I=Inches, L=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
<b>WAREHOUSE BUILDING</b>				
	ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM			
	BASEBOARD MASTIC		470 LF	Assumed
	ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM			
	VINYL FLOOR TILE		2,310 SF	Assumed
	ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM			
	VINYL FLOOR TILE MASTIC		2,360 SF	Assumed
	CARPENTERS SHOP, AND RESTROOM			
	CEILING MASTIC		1,000 SF	Assumed
	CARPENTERS SHOP, AND RESTROOM			
	CEILING TILE		1,000 SF	Assumed
	ENTIRE BUILDING			
	FIRE DOOR CORE INSULATION		294 SF	Assumed
	WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS			
	SMOOTH WALL MISCELLANEOUS		6,620 SF	Assumed
	WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS			
	SMOOTH WALL SURFACING		6,620 SF	Assumed
<b>WELDING SHOP BUILDING</b>				
	EXTERIOR			
	FIRE DOOR CORE INSULATION		21 SF	Assumed
	SIGNS / TOOLS / PARTS SHOP			
	SMOOTH WALL MISCELLANEOUS		650 SF	Assumed
	SIGNS / TOOLS / PARTS SHOP			
	SMOOTH WALL SURFACING		650 SF	Assumed

End Of Report, Total Of 4 Pages

# Non- Friable Locations In BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME			
LOCATION		QTY	ASBESTOS
MATERIAL TYPE		(APPROXIMATE)	CONTENT
<b>MAINTENANCE GARAGE BUILDING</b>			
OFFICE			
SINK UNDERCOATING		5 SF	Assumed
REPAIR / SERVICES GARAGE			
CHALK BOARD		8 SF	Assumed
REPAIR / SERVICES GARAGE			
WALL MASTIC		8 SF	Assumed
<b>MAINTENANCE SHOPS OFFICE PORTABLE BUILDING</b>			
EXTERIOR WALLS			
WEATHER PROOFING (OUTSIDE)		2,800 SF	Assumed
HVAC OFFICE AND HALLWAY			
BASEBOARD MASTIC		20 LF	Assumed
<b>MENTOR'S HOUSE</b>			
DAYCARE KITCHEN			
VINYL SHEETING		250 SF	Assumed
DAYCARE KITCHEN			
VINYL SHEETING		250 SF	Assumed
EXTERIOR WALLS			
ROUGH WALL		1,400 SF	Assumed
EXTERIOR WALLS			
ROUGH WALL SURFACING		1,400 SF	Assumed
KITCHEN (COUNTER TOP) AND RESTROOM			
MORTAR MISCELLANEOUS		750 SF	Assumed
OFFICE AND DAYCARE ROOMS			
CARPET MASTIC		1,300 SF	Assumed
RESTROOM			
BASEBOARD MASTIC		20 LF	Assumed
RESTROOM			
VINYL FLOOR TILE		32 SF	Assumed
RESTROOM			
VINYL FLOOR TILE MASTIC		32 SF	Assumed
SOUTHEAST ROOM			
LAMINATE FLOORING		421 SF	New Material
SOUTHEAST ROOM			
LAMINATE FLOORING MASTIC		421 SF	New Material
<b>METAL STORAGE SHED</b>			

# Non- Friable Locations In BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	ASBESTOS CONTENT
MATERIAL TYPE			
<b>STUDENT NUTRITION SERVICE</b>			
STUDENT NUTRITION SERVICES - KITCHEN			
	PERMANENT BUILDING	7,480 SF	New Material
<b>TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING</b>			
LOUNGE ROOM			
	SINK UNDERCOATING	4 SF	Assumed
STAFF RESTROOMS (2)			
	VINYL SHEETING	400 SF	Assumed
SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM			
	VINYL FLOOR TILE	700 SF	Assumed
SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM			
	VINYL FLOOR TILE MASTIC	700 SF	Assumed
<b>WAREHOUSE BUILDING</b>			
EXTERIOR WALL OF WAREHOUSE OFFICE			
	CHALK BOARD	20 SF	Assumed
EXTERIOR WALL OF WAREHOUSE OFFICE			
	WALL MASTIC	20 SF	Assumed
WAREHOUSE OFFICE			
	CARPET MASTIC	72 SF	Assumed
WOOD SHOP (RESTROOM ONLY)			
	VINYL FLOOR TILE	50 SF	Assumed
WOOD SHOP (RESTROOM ONLY)			
	VINYL FLOOR TILE MASTIC	50 SF	Assumed
End Of Report, Total Of 2 Pages			

**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**GROUND'S PORTABLE**

**EXTERIOR DOOR**

FIRE DOOR CORE INSULATION 42 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**INTERIOR DOOR**

FIRE DOOR CORE INSULATION 21 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**PORTABLES**

BASEBOARD MASTIC 130 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**PORTABLES**

SUSPENDED CEILING TILE 450 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**PORTABLES**

VINYL FLOOR TILE 480 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**PORTABLES**

VINYL FLOOR TILE MASTIC 480 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**GROUND'S STORAGE BUILDING**

**EXTERIOR**

FIRE DOOR CORE INSULATION 21 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.



**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**MAINTENANCE GARAGE BUILDING**

**OFFICE**

SINK UNDERCOATING

5 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**OFFICE**

SUSPENDED CEILING TILE

260 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM**

SMOOTH WALL MISCELLANEOUS

2,650 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM**

SMOOTH WALL SURFACING

2,650 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**REPAIR / SERVICES GARAGE**

CHALK BOARD

8 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**REPAIR / SERVICES GARAGE**

WALL MASTIC

8 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**RESTROOMS (2), AND SHOWER ROOM**

HEAT SHIELD

7.5 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**MAINTENANCE SHOPS OFFICE PORTABLE BUILDING**

**DOORS - EXTERIOR**

FIRE DOOR CORE INSULATION 42 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**DOORS - INTERIOR**

FIRE DOOR CORE INSULATION 168 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**EXTERIOR WALLS**

WEATHER PROOFING (OUTSIDE) 2,800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**HVAC OFFICE AND HALLWAY**

BASEBOARD MASTIC 20 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### HVAC OFFICE AND HALLWAY

SMOOTH WALL MISCELLANEOUS 1,000 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING 1,000 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### OFFICE PORTABLE

BASEBOARD MASTIC 265 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### OFFICE PORTABLE

PRESSED WOOD WALL PANEL 2,660 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### OFFICE PORTABLE

PRESSED WOOD WALL PANEL MASTIC

2,660 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### OFFICE PORTABLE

SUSPENDED CEILING TILE

1,600 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### OFFICE PORTABLE

VINYL WALL COVER

2,660 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### OFFICE PORTABLE

VINYL WALL COVER MASTIC

2,660 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### LOCATION

### MATERIAL TYPE

### RECOMMENDATION

### QTY

### (APPROXIMATE)

#### OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

##### CARPET MASTIC

1,600 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

#### MENTOR'S HOUSE

#### ATTIC

##### LOOSE FILL INSULATION

800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

#### CHILDREN'S RESTROOM

##### VINYL FLOOR TILE

70 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

#### CHILDREN'S RESTROOM

##### VINYL FLOOR TILE MASTIC

70 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### DAYCARE KITCHEN

VINYL SHEETING

250 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### DAYCARE KITCHEN

VINYL SHEETING

250 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

250 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

250 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

500 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE

500 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

240 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

6,400 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.



# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### ENTIRE BUILDING

SMOOTH WALL SURFACING

6,400 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### EXTERIOR WALLS

ROUGH WALL

1,400 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### EXTERIOR WALLS

ROUGH WALL SURFACING

1,400 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### EXTERIOR WINDOWS

CAULKING

400 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### KITCHEN (COUNTER TOP) AND RESTROOM

MORTAR MISCELLANEOUS

750 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### OFFICE AND DAYCARE ROOMS

CARPET MASTIC

1,300 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### RESTROOM

BASEBOARD MASTIC

20 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### RESTROOM

VINYL FLOOR TILE

32 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

### RESTROOM

VINYL FLOOR TILE MASTIC

32 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

---

### SOUTHEAST ROOM

LAMINATE FLOORING

421 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

---

### SOUTHEAST ROOM

LAMINATE FLOORING MASTIC

421 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
-

**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**METAL STORAGE CONTAINERS (25 EA)**

**METAL STORAGE CONTAINERS (25 EA)**

STORAGE CONTAINER 7,550 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

**METAL STORAGE SHED**

**METAL STORAGE SHED**

STORAGE BUILDING 725 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

## RECOMMENDATIONS FOR

### BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

#### **PG&E NORTH TOWER BUILDING**

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

**PG&E**

**MISCELLANEOUS**

**154 SF**

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

#### **PG&E SOUTH TOWER ENCLOSURE**

**TOWER**

**WOOD WALL**

**533 SF**

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### STUDENT NUTRITION SERVICE

#### STUDENT NUTRITION SERVICES - KITCHEN

PERMANENT BUILDING 7,480 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### ASSISTANT DIRECTOR

VINYL FLOOR TILE 38 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

#### ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC 38 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

#### CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE 1,500 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### ENTIRE BUILDING

FIRE DOOR CORE INSULATION 252 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### EXTERIOR BUILDING

WEATHER PROOFING (OUTSIDE) 1,100 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### LOUNGE ROOM

SINK UNDERCOATING 4 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### MAIN OFFICE

BASEBOARD MASTIC 1,400 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### MAIN OFFICE

SMOOTH WALL MISCELLANEOUS 5,100 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### MAIN OFFICE

SMOOTH WALL SURFACING 5,100 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### MAIN OFFICE

SUSPENDED CEILING TILE 2,150 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC 3,300 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.



# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER 7,800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC 7,800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL 7,800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL MASTIC 7,800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### PLENUM

WALL INSULATION 2,500 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### STAFF RESTROOMS (2)

VINYL SHEETING 400 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

### STAFF RESTROOMS (2)

VINYL SHEETING BACKING PAPER/MASTIC 400 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

### SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE 700 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### LOCATION

### MATERIAL TYPE

### RECOMMENDATION

### QTY

### (APPROXIMATE)

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

700 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

470 LF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

2,310 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE MASTIC

2,360 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### CARPENTERS SHOP, AND RESTROOM

CEILING MASTIC

1,000 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

### CARPENTERS SHOP, AND RESTROOM

CEILING TILE

1,000 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

### ENTIRE BUILDING

FIRE DOOR CORE INSULATION

294 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

### EXTERIOR WALL OF WAREHOUSE OFFICE

CHALK BOARD

20 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

### EXTERIOR WALL OF WAREHOUSE OFFICE

WALL MASTIC

20 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### WAREHOUSE OFFICE

CARPET MASTIC

72 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL MISCELLANEOUS

6,620 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

### WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

6,620 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### LOCATION

### MATERIAL TYPE

### RECOMMENDATION

### QTY

### (APPROXIMATE)

#### WOOD SHOP (RESTROOM ONLY)

##### VINYL FLOOR TILE

50 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

#### WOOD SHOP (RESTROOM ONLY)

##### VINYL FLOOR TILE MASTIC

50 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

### WELDING SHOP BUILDING

#### EXTERIOR

##### FIRE DOOR CORE INSULATION

21 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

#### SIGNS / TOOLS / PARTS SHOP

##### SMOOTH WALL MISCELLANEOUS

650 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

#### SIGNS / TOOLS / PARTS SHOP

##### SMOOTH WALL SURFACING

650 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**BUESD MAINTENANCE AND TRANSPORTATION YARD**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**WOOD SHEDS (2 EA)**

---

**WOOD STORAGE SHEDS (2 EA)**

WOOD WALL

200 SF

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

---

**WOOD STORAGE SHED**

**WOOD STORAGE SHED**

WOOD WALL

330 SF

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

---

---

**End Of Report, Total Of 25 Pages**

---

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### GROUPS PORTABLE

### GROUPS PORTABLE

EXTERIOR DOOR

FIRE DOOR CORE INSULATION

**10-174AAA**

7/30/2010

Positive

ASSUMED

NO SAMPLE

NS

### GROUPS PORTABLE

INTERIOR DOOR

FIRE DOOR CORE INSULATION

**10-174AAA**

7/30/2010

Positive

ASSUMED

NO SAMPLE

NS

### GROUPS PORTABLE

PORTABLES

BASEBOARD MASTIC

**10-174AAA**

7/30/2010

Positive

ASSUMED

NO SAMPLE

NS

### GROUPS PORTABLE

PORTABLES

SUSPENDED CEILING TILE

**10-174AAA**

7/30/2010

Positive

ASSUMED

NO SAMPLE

NS

### GROUPS PORTABLE

PORTABLES

VINYL FLOOR TILE

**10-174AAA**

7/30/2010

Positive

ASSUMED

NO SAMPLE

NS

### GROUPS PORTABLE

PORTABLES

VINYL FLOOR TILE MASTIC

**10-174AAA**

7/30/2010

Positive

ASSUMED

NO SAMPLE

NS



# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

GROUPS STORAGE BUILDING

GROUPS STORAGE BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

**15-174AAA**

9/16/2015

Positive

ASSUMED

NO SAMPLE

NS

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MAINTENANCE GARAGE BUILDING

### MAINTENANCE GARAGE BUILDING

OFFICE

SINK UNDERCOATING

**09-098AAA**

5/11/2009

Positive

ASSUMED

NO SAMPLE

NS

### MAINTENANCE GARAGE BUILDING

OFFICE

SUSPENDED CEILING TILE

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

**05-212AAA**

4/18/2006

Positive

ASSUMED

NO SAMPLE

NS

### MAINTENANCE GARAGE BUILDING

REPAIR / SERVICES GARAGE

CHALK BOARD

**09-098AAA**

5/11/2009

Positive

ASSUMED

NO SAMPLE

NS

### MAINTENANCE GARAGE BUILDING

REPAIR / SERVICES GARAGE

WALL MASTIC

**09-098AAA**

5/11/2009

Positive

ASSUMED

NO SAMPLE

NS

### MAINTENANCE GARAGE BUILDING

RESTROOMS (2), AND SHOWER ROOM

HEAT SHIELD

**05-212AAA**

3/5/2007

Positive

ASSUMED

NO SAMPLE

NS

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

DOORS - EXTERIOR

FIRE DOOR CORE INSULATION

<b><u>12-185AAA</u></b>	10/8/2012	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

DOORS - INTERIOR

FIRE DOOR CORE INSULATION

<b><u>09-095AAA</u></b>	5/11/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

EXTERIOR WALLS

WEATHER PROOFING (OUTSIDE)

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

SMOOTH WALL MISCELLANEOUS

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

<b>08-241AAA</b>	10/13/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

SUSPENDED CEILING TILE

<b>05-212AAA</b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

VINYL WALL COVER

<b>05-212AAA</b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

VINYL WALL COVER MASTIC

<b>08-241AAA</b>	10/13/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

CARPET MASTIC

<b>05-212AAA</b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MENTOR'S HOUSE

### MENTOR'S HOUSE

ATTIC

LOOSE FILL INSULATION

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

CHILDREN'S RESTROOM

VINYL FLOOR TILE

**18-127AAA**

8/6/2018

Negative

NEW MATERIAL

NONE DETECTED

ND

### MENTOR'S HOUSE

CHILDREN'S RESTROOM

VINYL FLOOR TILE MASTIC

**18-127AAA**

8/6/2018

Negative

NEW MATERIAL

NONE DETECTED

ND

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING

**16-074AAA**

3/17/2016

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

**16-074AAA**

3/17/2016

Positive

ASSUMED

NO SAMPLE

NS

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MENTOR'S HOUSE

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### MENTOR'S HOUSE

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### MENTOR'S HOUSE

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

<b><u>08-075AAA</u></b>	4/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL SURFACING

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### MENTOR'S HOUSE

EXTERIOR WALLS

ROUGH WALL

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### MENTOR'S HOUSE

EXTERIOR WALLS

ROUGH WALL SURFACING

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MENTOR'S HOUSE

EXTERIOR WINDOWS

CAULKING

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

KITCHEN (COUNTER TOP) AND RESTROOM

MORTAR MISCELLANEOUS

**05-212AAA**

4/18/2006

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

OFFICE AND DAYCARE ROOMS

CARPET MASTIC

**05-212AAA**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

RESTROOM

BASEBOARD MASTIC

**08-241AAA**

10/13/2008

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

RESTROOM

VINYL FLOOR TILE

**08-241AAA**

10/13/2008

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

RESTROOM

VINYL FLOOR TILE MASTIC

**08-241AAA**

10/13/2008

Positive

ASSUMED

NO SAMPLE

NS

### MENTOR'S HOUSE

SOUTHEAST ROOM

LAMINATE FLOORING

**18-127AAA**

8/6/2018

Negative

NEW MATERIAL

NONE DETECTED

ND

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### MENTOR'S HOUSE

SOUTHEAST ROOM

LAMINATE FLOORING MASTIC

<b><u>18-127AAA</u></b>	8/6/2018	Negative	NEW MATERIAL	NONE DETECTED	ND
-------------------------	----------	----------	--------------	---------------	----



# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**METAL STORAGE CONTAINERS (25 EA)**

**METAL STORAGE CONTAINERS (25 EA)**

METAL STORAGE CONTAINERS (25 EA)

STORAGE CONTAINER

**05-212.NS**

9/6/2005

Positive

ASSUMED

NO SAMPLE

NS

Metal Storage Containers.

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

METAL STORAGE SHED

METAL STORAGE SHED

METAL STORAGE SHED

STORAGE BUILDING

**11-202.NS**

11/28/2011 Positive

ASSUMED

NO SAMPLE

NS

Metal Storage Shed.

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

PG&E NORTH TOWER BUILDING

PG&E NORTH TOWER BUILDING

PG&E

MISCELLANEOUS

**16-074.NS**

3/17/2016

Positive

ASSUMED

NO SAMPLE

NS

Metal and Concrete Building.

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

PG&E SOUTH TOWER ENCLOSURE

PG&E SOUTH TOWER ENCLOSURE

TOWER

WOOD WALL

**11-202.NS**

11/28/2011 Negative

NON-ACM

NO SAMPLE

NS

Wood Walls.

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### STUDENT NUTRITION SERVICE

### STUDENT NUTRITION SERVICE

STUDENT NUTRITION SERVICES - KITCHEN

PERMANENT BUILDING

<b><u>22-025.NS</u></b>	2/16/2022	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE

<b><u>11-202AAA</u></b>	11/28/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

<b><u>11-202AAA</u></b>	11/28/2011	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

<b><u>09-098AAA</u></b>	5/11/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

EXTERIOR BUILDING

WEATHER PROOFING (OUTSIDE)

<b><u>07-041AAA</u></b>	3/5/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

LOUNGE ROOM

SINK UNDERCOATING

<b><u>08-075AAA</u></b>	4/14/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

SMOOTH WALL MISCELLANEOUS

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

SMOOTH WALL SURFACING

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

SUSPENDED CEILING TILE

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

<b><u>08-214AAA</u></b>	10/13/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

<b><u>08-241AAA</u></b>	10/13/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

PLENUM

WALL INSULATION

<b>05-212AAA</b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

STAFF RESTROOMS (2)

VINYL SHEETING

<b>05-212AAA</b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

STAFF RESTROOMS (2)

VINYL SHEETING BACKING PAPER/MASTIC

<b>05-212AAA</b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE

<b>05-212AAA</b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

<b>05-212AAA</b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----



# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### WAREHOUSE BUILDING

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM  
BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM  
VINYL FLOOR TILE

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM  
VINYL FLOOR TILE MASTIC

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM  
CEILING MASTIC

<b><u>07-041AAA</u></b>	3/5/2007	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM  
CEILING TILE

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

ENTIRE BUILDING  
FIRE DOOR CORE INSULATION

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

EXTERIOR WALL OF WAREHOUSE OFFICE  
CHALK BOARD

<b><u>09-098AAA</u></b>	5/11/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### LOCATION

### MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### WAREHOUSE BUILDING

EXTERIOR WALL OF WAREHOUSE OFFICE

WALL MASTIC

<b><u>09-098AAA</u></b>	5/11/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

WAREHOUSE OFFICE

CARPET MASTIC

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL MISCELLANEOUS

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE

<b><u>09-098AAA</u></b>	5/11/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### WAREHOUSE BUILDING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE MASTIC

<b><u>09-098AAA</u></b>	5/11/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### WELDING SHOP BUILDING

### WELDING SHOP BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

<b><u>15-174AAA</u></b>	9/16/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

### WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL MISCELLANEOUS

<b><u>05-212AAA</u></b>	9/6/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

### WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

<b><u>05-212AAA</u></b>	4/18/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

WOOD SHEDS (2 EA)

WOOD SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

**10-052AAA**

3/8/2010

Negative

NON-ACM

NO SAMPLE

NS

Wood Wall Panels.

# SAMPLES REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

### WOOD STORAGE SHED

### WOOD STORAGE SHED

WOOD STORAGE SHED

WOOD WALL

**11-202.NS**

11/28/2011 Negative

NON-ACM

NO SAMPLE

NS

Wood Walls.

End Of Report, Total Of 22 Pages

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	--

### GROUPS PORTABLE

#### GROUPS PORTABLE

##### PORTABLES

VINYL FLOOR TILE

480 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

07/30/2010	12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date.
11/28/2011	Damage Observed. <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/27/2017	Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	Additional Damage Observed. 13 Tiles in total with Cracks throughout Entire Building. No other changes as of this date.

### GROUPS PORTABLE

##### PORTABLES

VINYL FLOOR TILE MASTIC

480 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

07/30/2010	Mastic/Adhesive for 12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date.
11/28/2011	Damage Observed. <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/27/2017	Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	Additional Damage Observed. 13 Tiles in total with Cracks throughout Entire Building. No other changes as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

### MAINTENANCE GARAGE BUILDING

### MAINTENANCE GARAGE BUILDING

OFFICE

SUSPENDED CEILING TILE

260 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	2'X4' Suspended Ceiling Tile. This Material is in GOOD condition as of this date.
05/11/2009	Damage Observed. <5% Physical Damage in the form of minor cuts and holes. <10% Water Damage due to 3 Tiles with water stains. Material Condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/27/2017	Additional Damage Observed. 11 Tiles have Water Damage. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

2,650 SF

**P:** Less Than 5%

**W:** No Evidence

### DAMAGED FRIABLE SURFACING ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
03/03/2014	This Material is unchanged as of this date.
03/18/2015	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Damage Observed. <5% Physical Damage in the form of 4 LF of Cracks at South and West Walls of Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.



# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

2,650 SF

**P:** Less Than 5%

**W:** No Evidence

### DAMAGED FRIABLE SURFACING ACM

04/18/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date. This Material is in GOOD condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Damage Observed. <5% Physical Damage in the form of 4 LF of Cracks at South and West Walls of Storage Room. Material condition changed from GOOD to FAIR overall. Friability updated from Non-Friable to Friable. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

### BUILDING NAME

### LOCATION

### MATERIAL TYPE

### RISK ASSESMENT CATEGORY

### COMMENTS

QTY  
(APPROXIMATE)

PHYSICAL DAMAGE (P:)  
WATER DAMAGE (W:)

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

#### BASEBOARD MASTIC

265 LF

**P:** Less Than 10%

**W:** No Evidence

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for 3" Cream Baseboard. This Material is in GOOD condition as of this date.
11/05/2007	Material Re-Assessed. Damage Observed <5% Physical Damage - due to 5 LF loose in Front Office. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
11/28/2011	Additional Damage observed - in the form of approximately 20 LF is loose in 1 Office. No other changes as of this date.
08/28/2014	Material Re-Assessed. Additional 40 LF of Damage found. Baseboard is missing and Mastic/Adhesive is exposed. No other changes as of this date.
03/27/2017	Additional Damage Observed. 8 LF Loose Mastic Exposed in Office 1. 8 LF Loose and 4 LF Missing in Office 2. No other changes as of this date.
08/25/2017	Additional Damage Observed. Front Office now has 25 LF of Baseboard Missing. Mastic/Adhesive is Exposed. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

#### PRESSED WOOD WALL PANEL

2,660 SF

**P:** No Visible Damage

**W:** <10% Stains or Flaking

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/13/2008	4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date.
03/27/2017	Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

PRESSED WOOD WALL PANEL MASTIC

2,660 SF

**P:** No Visible Damage

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/13/2008	Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date.
03/27/2017	Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

SUSPENDED CEILING TILE

1,600 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	2'X4' Suspended Ceiling Tile. This Material is in GOOD condition as of this date.
------------	---

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

11/28/2011	Damage Observed. <10% Water Damage - in the form of 2 Tiles are Water Damaged in Office; <5% Physical Damage - in the form of 1 Tile is broken. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
09/09/2016	Additional Damage observed. 1 Tile is missing in Office. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

VINYL WALL COVER

2,660 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	4'X10' Vinyl Cover on Pressed Wood Wall Panels. This Material is in GOOD condition as of this date.
11/28/2011	Damage Observed. <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/27/2017	Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			

02/13/2023 Additional Damage Observed. 3 SF of Peeling Vinyl Wall Cover at Plumbing Office. No other changes as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICE PORTABLE

VINYL WALL COVER MASTIC

2,660 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/13/2008 Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date.

11/28/2011 Damage Observed. <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 Additional Damage Observed. 3 SF of Peeling Vinyl Wall Cover at Plumbing Office. No other changes as of this date.

### MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

#### OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

CARPET MASTIC

1,600 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

04/18/2006 Mastic/Adhesive for Green Carpet. This Material is in GOOD condition as of this date.

03/18/2015 Damage Observed. Offices have Approximately 1 SF of Carpet Damaged exposing Mastic/Adhesive. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/25/2017 Additional Damage Observed. Water Damages and Stains found in all of the Rooms. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
COMMENTS					

### MENTOR'S HOUSE

### MENTOR'S HOUSE

#### DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC	500 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
----------------	--------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for 1'X1' Ceiling Tile. This Material is in GOOD condition as of this date.
02/12/2018	Damage Observed. <5% Physically Damage - in the form of 4 Tiles have small Cracks and Chips in them. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
08/06/2018	Material Re-assessed. Partial Repairs made some Tiles have been Patched with Mud. Remains in FAIR condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### MENTOR'S HOUSE

#### DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE	500 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
--------------	--------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	1'X1' Ceiling Tile. This Material is in GOOD condition as of this date.
02/12/2018	Damage Observed. <5% Physically Damage - in the form of 4 Tiles have small Cracks and Chips in them. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/06/2018	Material Re-assessed. Partial Repairs made some Tiles have been Patched with Mud. Remains in FAIR condition as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 3 Loose Tiles at Entry into Kitchen. Material remains in FAIR condition overall. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

### MENTOR'S HOUSE

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

240 SF

**P:** No Visible Damage

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

04/14/2008	Mastic/Adhesive for Brown/Grey Carpet. This Material is in GOOD condition as of this date.		
02/12/2018	Damage Observed. <10% Water Damage - in the form of a 12 SF Water Stain by the Desk. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/04/2019	This Material is unchanged as of this date.		
08/12/2019	This Material is unchanged as of this date.		
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 3 Loose Tiles at Entry into Kitchen. Material remains in FAIR condition overall. No other changes as of this date.		
02/08/2021	This Material is unchanged as of this date.		
08/09/2021	This Material is unchanged as of this date.		
02/16/2022	This Material is unchanged as of this date.		
08/15/2022	This Material is unchanged as of this date.		
02/13/2023	This Material is unchanged as of this date.		

### MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

6,400 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.		
04/18/2006	This Material is also on ceilings. No other changes as of this date.		



# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/28/2014	Damage observed. Physical Damage <5% in the of form of a crack in the Hallway. Material condition changed from GOOD to FAIR overall. No other changes as of this date.					
03/17/2016	Additional Damage observed. 6 LF is cracked in Kitchen. No other changes as of this date.					
03/27/2017	Additional Damage Observed. 12 LF is Cracked in Kitchen. No other changes as of this date.					
02/12/2018	Additional Damage Observed. 12 LF Crack in Kithchen is no 1/4" Split to it. No other changes as of this date.					
08/06/2018	Material Re-assessed. 12 LF Crack in Kithchen has been Patched with Mud. 6 LF Crack now in the same spot. No other changes as of this date.					
02/04/2019	This Material is unchanged as of this date.					
08/12/2019	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	This Material is unchanged as of this date.					
02/13/2023	Additional Damage Observed. 4 SF of Water Damage in Day Care Room. No other changes as of this date.					

### MENTOR'S HOUSE

#### EXTERIOR WINDOWS

##### CAULKING

400 LF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Window Caulking. Damaged in various areas. This Material is in FAIR condition as of this date.					
05/11/2009	Damage Observed. <10% Water Damage due to moisture and heat degradation on various surfaces. Material remains in FAIR condition overall as of this date.					
02/04/2019	This Material is unchanged as of this date.					
08/12/2019	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	This Material is unchanged as of this date.					
02/13/2023	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME			
LOCATION		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
MATERIAL TYPE			
RISK ASSESMENT CATEGORY			
COMMENTS			

### STUDENT NUTRITION SERVICE

### STUDENT NUTRITION SERVICE

STUDENT NUTRITION SERVICES - KITCHEN

PERMANENT BUILDING

7,480 SF

**P:** No Visible Damage

**W:** No Evidence

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

02/16/2022 New Permant Building. Material in GOOD condtion as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE

38 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

11/28/2011	12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
03/27/2017	Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/25/2017	Additional Damage Observed. 3 Tiles are now Cracked. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

38 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

11/28/2011	Mastic/Adhesive for 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
03/27/2017	Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

08/25/2017	Additional Damage Observed. 3 Tiles are now Cracked. No other changes as of this date.				
02/04/2019	This Material is unchanged as of this date.				
08/12/2019	This Material is unchanged as of this date.				
08/26/2020	This Material is unchanged as of this date.				
02/08/2021	This Material is unchanged as of this date.				
08/09/2021	This Material is unchanged as of this date.				
02/16/2022	This Material is unchanged as of this date.				
08/15/2022	This Material is unchanged as of this date.				
02/13/2023	This Material is unchanged as of this date.				

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

1,500 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/12/2009	2'x4' Suspended Ceiling Tile, (with small uneven cuts and holes pattern). Damage Observed. <5% Physical Damage due to 3 missing Tiles. This Material is in FAIR condition as of this date.				
03/08/2010	Location Description changed from STAFF'S LOUNGE ROOM to CONFERENCE ROOM AND STAFF'S LOUNGE ROOM. Quantity changed from 500 SF to 1,500 SF. Additional Damage: <10% Water Damage in the form of 2 Tiles are Water Damaged. No other changes as of this date.				
08/30/2010	Location Description changed from CONFERENCE ROOM AND STAFF'S LOUNGE ROOM to CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND STORAGE ROOM. Additional Damage observed in Conference Room in the form of 3 Tiles are Water Damaged and 1 has a hole. No other changes as of this date.				
11/28/2011	Additional Damage observed - in the form of 3 more Tiles are Water Damaged, and 1 Tile is missing in Storage Room. No other changes as of this date.				
10/08/2012	Damage Re-Assessed and Conference Room now has a total of 4 Water Damaged Tiles. No other changes as of this date.				
09/23/2013	Material Re-Assessed. Conference Room now has Debris on Floor due to Water leaks from the Roof. No other changes as of this date.				
03/03/2014	Debris has been cleaned up. No other changes as of this date.				
08/28/2014	Material Re-Assessed. 2 Suspended Ceiling Tiles have Water Damage in the Office.				
03/18/2015	Additional Damage Observed. 3 Suspended Ceiling Tiles Water Damaged. No other change as of this date.				
03/17/2016	Additional Damage observed. 1 Tile is missing in Director's Office. No other changes as of this date.				
09/09/2016	Partial Repairs observed. Current Damage: 2 Tiles with Water Damage in the Storage Room, and 1 Tile with Water Damage in the Conference Room. No other changes as of this date.				

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

03/27/2017	Additional Damage Observed. 2 Tiles with Water Stains and Several Tiles Have been repainted in Staff Room. However 11 Tiles have Cracks and Cuts with Broken Edges in Staff Room. 5 Tiles have Water Damage while other have been Painted Over. Several Tiles have Cracks and Broken Edges in the Conference Room. 2 Tiles have Water Damage in the Storage by Front of the Building. 2 Tiles have Water Damage and 1 Tile Missing in the Storage by Rear of the Building. No other changes as of this date.					
08/25/2017	Additional Damage Observed. Conference Room now has 3 Tiles with Water Damage. No other changes as of this date.					
02/04/2019	This Material is unchanged as of this date.					
08/12/2019	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	This Material is unchanged as of this date.					
02/13/2023	This Material is unchanged as of this date.					

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### MAIN OFFICE

##### BASEBOARD MASTIC

1,400 LF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for Baseboard. Approximately 15 LF exposed in Womens Restroom. This Material is in FAIR condition as of this date.				
04/18/2006	Material redefined as 4" Black Baseboard (in Offices and Hallways) and 4" Blue Baseboard (in Conference Room). All Damages have been repaired. Friability changed from Non-Friable to Friable. No other changes as of this date.				
03/08/2010	Material Re-Assessed. 4" Brown Baseboard was also observed in several Offices and Main Entry Office. No other changes as of this date.				
03/03/2014	This Material is unchanged as of this date.				
08/28/2014	This Material is unchanged as of this date.				
03/18/2015	New Material Installed. Men's and Women's Restrooms Floor and Baseboard now Covered with Vinyl Sheeting. Old Material is Possibly Behind. No other changes as of this date.				
03/27/2017	Damage Observed. <5% Physical Damage - in the form of 4" of Baseboard is missing in Main Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.				
02/04/2019	This Material is unchanged as of this date.				
08/12/2019	This Material is unchanged as of this date.				

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/26/2020 This Material is unchanged as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### MAIN OFFICE

SMOOTH WALL MISCELLANEOUS

5,100 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 Gypsum Wallboard System, Walls. Damages noticed. This Material is in FAIR condition as of this date.

05/11/2009 Additional Damages Observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date.

11/28/2011 Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 Additional Damage Observed. <10% Water Damage in the form of 1 SF of Water Damage on Wall under Urinal in Mens Retroom in Dreivers Lounge. Material remains in FAIR condition overall. No other changes as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

08/15/2022 This Material is unchanged as of this date.

02/13/2023 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### MAIN OFFICE

SMOOTH WALL SURFACING	5,100 SF	P: Less Than 5% W: <10% Stains or Flaking
-----------------------	----------	--

#### DAMAGED FRIABLE SURFACING ACM

04/18/2006	Skim Coat for Gypsum Wallboard System, Walls. Various Damages noticed. This Material is in FAIR condition as of this date.
05/11/2009	Additional Damages observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date.
11/28/2011	Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Additional Damage Observed. <10% Water Damage in the form of 1 SF of Water Damage on Wall under Urinal in Mens Restroom in Drivers Lounge. Material remains in FAIR condition overall. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### MAIN OFFICE

SUSPENDED CEILING TILE	2,150 SF	P: Less Than 5% W: <10% Stains or Flaking
------------------------	----------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	2'X4' Suspended Ceiling Tile. Several Tiles Damaged and Water stained. This Material is in FAIR condition as of this date.
11/05/2007	Material Re-Assessed. Damage: <5% Physical Damage - 1 Tile in Telephone Panel Closet and 1 Tile in Mens Restroom; <10% Water Damage - 2 Tiles in Blueprint Office and 4 Tiles in Trainer Office. This Material is in FAIR condition overall as of this date.
04/14/2008	Additional Damage noted: 1/2 Tile is missing in the Supply Storage Room as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
10/13/2008				Additional 3 Tiles missing at Lounge area. Also several Tiles Damaged at Hallway. No other changes as of this date.		
05/11/2009				Damages Re-Assessed. 1 Tile is missing above the Main Entry Door, (next to Receptionist Office). Physical damage is in various locations. Tiles damaged in Telephone Panel Closet has increased to 3 Tiles. Quantity changed from 2,650 SF to 3,150 SF. No change to damage in Hallway. Friability changed from Moderate to High to reflect these changes.		
09/03/2009				Repairs have been made in Main Lobby. Missing Tile has been replaced. Also, 3 Tiles Damaged at Hallway have been repaired. Telephone Panel Closet and Storage Closet are Water Damaged. No other changes as of this date.		
03/08/2010				Material Re-Assessed. Approx. 1,000 SF of 2'x4' Suspended Ceiling Tile is the same as Staff's Lounge. Quantity changed from 3,150 SF to 2,150 SF. Additional Damage in the form of 6 Tiles are cracked in Hallway and Main Office. Also, 2 Tiles are Water Damaged in Office, adjacent to Lounge Room. Material remains in FAIR condition. No other changes as of this date.		
11/28/2011				Additional Damage observed - in the form of Hallway has some Tiles broken. No other changes as of this date.		
10/08/2012				Additional Damage - in the form of 1 hole observed on Hallway Ceiling. Also, 2 additional Water Damaged Tiles observed in Telephone Panel Closet. No other changes as of this date.		
03/03/2014				This Material is unchanged as of this date.		
08/28/2014				Material Re-Assessed. Additional Water Damage Observed. No other changes as of this date.		
03/17/2016				Additional Damage observed and Partial Repairs made. Director's Office has 1 Tile with Water Damage. Missing Tile above Main Entry Door has been Replaced. No other changes as of this date.		
09/09/2016				Additional Damage observed. 2 Tiles with Water Damage in Trainer's Office. No other changes as of this date.		
03/27/2017				Additional Damage Observed. 4 Tiles with Water Damage and Several other have broken edges and are Cracked in the Director's Office. 4 Water Damage Tiles, 7 other Tiles have Cracks, in the Project Manager's Office. 4 Tiles with Cracked and Chipped Tiles in the Executive Assistant Office. No other changes as of this date.		
08/25/2017				Additional Damage Observed. Trainer's Office now has 3 Tiles. No other changes as of this date.		
02/04/2019				This Material is unchanged as of this date.		
08/12/2019				This Material is unchanged as of this date.		
08/26/2020				This Material is unchanged as of this date.		
02/08/2021				This Material is unchanged as of this date.		
08/09/2021				This Material is unchanged as of this date.		
02/16/2022				This Material is unchanged as of this date.		
08/15/2022				This Material is unchanged as of this date.		
02/13/2023				This Material is unchanged as of this date.		



# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC

3,300 SF

P: Less Than 5%

W: <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

04/18/2006	Mastic/Adhesive for Carpets (Approximately 80% Blue and 20% Mix of Red, Brown and Grey Colors). This Material is in FAIR condition as of this date.
05/11/2009	Damage Observed. <5% Physical Damage in the form of the Carpet has been Damaged due to several separations observed in locations of seams. No other changes as of this date.
03/03/2014	This Material is unchanged as of this date.
03/27/2017	Additional Damage Observed. Storage Room by Rear of Building there is Water Damage in the form of Stains and Mold, still damp. 20 LF of Blue Carpet in the Staff Lounge is loose. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	Additonal Damage Observed. 6 SF of Detacehd and Wavy Carpet in Confrence Room. No other changes as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

7,800 SF

P: Less Than 5%

W: No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/13/2008	Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date.
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/08/2021	Additional Damage Observed. 1 Panel with Holes in it and 1 Panle has Scrapes and Cuts in Project Manager's Office. No other changes as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	This Material is unchanged as of this date.					
02/13/2023	This Material is unchanged as of this date.					

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

7,800 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/13/2008	Mastic/Adhesive for Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date.					
09/03/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.					
03/03/2014	This Material is unchanged as of this date.					
08/28/2014	This Material is unchanged as of this date.					
03/18/2015	This Material is unchanged as of this date.					
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.					
02/04/2019	This Material is unchanged as of this date.					
08/12/2019	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	Additional Damage Observed. 1 Panel with Holes in it and 1 Panle has Scrapes and Cuts in Project Manager's Office. No other changes as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					
08/15/2022	This Material is unchanged as of this date.					
02/13/2023	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

7,800 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Pressed wood wall panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date.
10/13/2008	Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date.
09/03/2009	Material remains in <5% Physical Damage. No changes as of this date.
03/03/2014	This Material is unchanged as of this date.
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL MASTIC

7,800 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for Pressed Wood Wall Panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date.
10/13/2008	Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date.
09/03/2009	Material remains in <5% Physical Damage. No changes as of this date.
03/03/2014	This Material is unchanged as of this date.
03/27/2017	Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

#### PLENUM

WALL INSULATION

2,500 SF

**P:** Less Than 10%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Spray-On Foam Insulation. Material is loose and Water Damaged in several locations. This Material is in FAIR condition as of this date.
09/03/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
08/28/2014	This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESSMENT CATEGORY			
COMMENTS			

### WAREHOUSE BUILDING

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

470 LF

**P:** Less Than 50% No Debris

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for 4" Black and brown Baseboards. Material is exposed in Carpenters Shop and Restroom. This Material is in FAIR condition as of this date.
04/18/2006	Approximately 120 LF is exposed in Shop and Main Office. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date.
05/11/2009	Damages Re-Assessed. Physical Damages remains at <50%. This Material is unchanged as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 2 LF of Missing Baseboard with Brown Mastic exposed in Restroom. Material remains in FAIR condition overall. No other changes as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

2,310 SF

**P:** Less Than 50% No Debris

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	12"X12" Multi-Color Vinyl Floor Tile. Broken and missing in various locations. This Material is in FAIR condition as of this date.
04/14/2008	50 SF Removed in the Restroom. Quantity changed from 2,360 SF to 2,310 SF. This Material condition is unchanged as of this date.
05/11/2009	Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Recommendation changed to reflect this change.
04/13/2012	Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date.
10/08/2012	Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

08/28/2014	Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date.					
02/04/2019	This Material is unchanged as of this date.					
08/12/2019	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					

### WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE MASTIC

2,360 SF

**P:** Less Than 50% No Debris

**W:** No Evidence

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Mastic/Adhesive for 12"X12" Multi-Color Vinyl Floor Tile. Material is exposed in broken and missing Tile locations. This Material is in FAIR condition as of this date.					
04/14/2008	50 SF is exposed in the Restroom. This Material condition is unchanged as of this date.					
05/11/2009	Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is Damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Friability changed from Low to Moderate. Recommendation changed to reflect this change. 50 SF that was exposed in Restroom has been repaired. Material has been replaced with Off-White 12"x12".					
04/13/2012	Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date.					
10/08/2012	Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date.					
08/28/2014	Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date.					
02/04/2019	This Material is unchanged as of this date.					
08/12/2019	This Material is unchanged as of this date.					
08/26/2020	This Material is unchanged as of this date.					
02/08/2021	This Material is unchanged as of this date.					
08/09/2021	This Material is unchanged as of this date.					
02/16/2022	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

### WAREHOUSE BUILDING

#### CARPENTERS SHOP, AND RESTROOM

CEILING MASTIC	1,000 SF	<b>P:</b> Less Than 50% No Debris <b>W:</b> <10% Stains or Flaking
----------------	----------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/05/2007	Mastic/Adhesive for 1'x1' Ceiling Tile. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. No other changes as of this date.
05/11/2009	Material condition is FAIR overall. This Material is unchanged as of this date.
09/03/2009	Material Re-Assessed. Physical Damage is <50% and remains in FAIR condition overall as of this date.
10/08/2012	Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date.
08/28/2014	Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. No other changes as of this date.
03/27/2017	Additional Damage Observed. Storage Room has 100 SF of Water Damage and 6 Tiles are Missing. 40 Sf of Water Damage and 25 loose Tiles in the Shop. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.

### WAREHOUSE BUILDING

#### CARPENTERS SHOP, AND RESTROOM

CEILING TILE	1,000 SF	<b>P:</b> Less Than 5% <b>W:</b> >10% Evident
--------------	----------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	1'X1' Nailed-On Ceiling Tile. Material is damaged in the form of holes and cuts. This Material is in FAIR condition as of this date.
04/18/2006	Damage Observed. >10% Water Damaged. Friability changed from Moderate to High. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date.
03/05/2007	Material Description changed from ' 1'x1' Nailed-on Ceiling Tile. ' to '1'x1' Ceiling Tile, (Glued-on). Mastic/Adhesive entry added for this Material. Damage reassessed. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. Friability changed to High. No other changes as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

09/03/2009	Damage Re-Assessed. Physical Damage has changed to <50% due to scratches and gouging observed. Water Damage remains <10% and in POOR condition as of this date.				
10/08/2012	Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date.				
08/28/2014	Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. Friability changed from Low to Moderate. No other changes as of this date.				
02/04/2019	This Material is unchanged as of this date.				
08/12/2019	This Material is unchanged as of this date.				
08/26/2020	This Material is unchanged as of this date.				
02/08/2021	This Material is unchanged as of this date.				
08/09/2021	This Material is unchanged as of this date.				
02/16/2022	This Material is unchanged as of this date.				

### WAREHOUSE BUILDING

#### WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL MISCELLANEOUS

6,620 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.				
03/05/2007	Damage Re-Assessed. Damage Observed. <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date.				
04/14/2008	Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF Damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date.				
09/03/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.				
09/23/2013	Friability changed from Moderate to Low. No other changes as of this date.				
03/27/2017	No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date.				
02/04/2019	This Material is unchanged as of this date.				
08/12/2019	This Material is unchanged as of this date.				
08/26/2020	Additional Damage Observed. <5% Physical Damage in the form of 10 SF of Cracks and Peeling on Ceiling in Woodshop Restroom. Material remains in FAIR condition overall. No other changes as of this date.				
02/08/2021	This Material is unchanged as of this date.				
08/09/2021	This Material is unchanged as of this date.				



# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/16/2022 This Material is unchanged as of this date.

### WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

6,620 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

### DAMAGED FRIABLE SURFACING ACM

04/18/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.

03/05/2007 Damage Re-Assessed. Damage: <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date.

04/14/2008 Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date.

09/03/2009 Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.

09/23/2013 Friability changed from Moderate to Low. No other changes as of this date.

03/03/2014 Friability changed from Low to Moderate. No other changes as of this date.

03/27/2017 No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date.

02/04/2019 This Material is unchanged as of this date.

08/12/2019 This Material is unchanged as of this date.

08/26/2020 Additional Damage Observed. <5% Physical Damage in the form of 10 SF of Cracks and Peeling on Ceiling in Woodshop Restroom. Material remains in FAIR condition overall. No other changes as of this date.

02/08/2021 This Material is unchanged as of this date.

08/09/2021 This Material is unchanged as of this date.

02/16/2022 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W):
---------------	----------	---------------	--------------------------	----------	----------------------	---

### WELDING SHOP BUILDING

#### WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL MISCELLANEOUS

650 SF

**P:** Less Than 50% No Debris

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005	Gypsum Wallboard System Walls and Ceilings. This Material is in GOOD condition as of this date.
04/18/2006	Material Re-Assessed. Damage: <10% Physical Damage - noted in forms of holes and cuts. This Material is in FAIR condition overall as of this date.
05/11/2009	Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Recommendation changed to reflect this change. No other changes as of this date.
02/04/2019	This Material is unchanged as of this date.
08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

### WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

650 SF

**P:** Less Than 50% No Debris

**W:** <10% Stains or Flaking

#### DAMAGED FRIABLE SURFACING ACM

04/18/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. <10% Physical Damages noted in forms of holes and cuts. This Material is in FAIR condition as of this date.
05/11/2009	Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Recommendation changed to reflect this change.
09/23/2013	This Material changed from POOR condition to FAIR condition as of this date. No other changes as of this date.
08/28/2014	This Material is in POOR condition as of this date.
02/04/2019	This Material is unchanged as of this date.

# DAMAGE REPORT FOR


## BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME		QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
LOCATION	MATERIAL TYPE		
RISK ASSESMENT CATEGORY			
COMMENTS			

08/12/2019	This Material is unchanged as of this date.
08/26/2020	This Material is unchanged as of this date.
02/08/2021	This Material is unchanged as of this date.
08/09/2021	This Material is unchanged as of this date.
02/16/2022	This Material is unchanged as of this date.
08/15/2022	This Material is unchanged as of this date.
02/13/2023	This Material is unchanged as of this date.

End Of Report, Total Of 30 Pages

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: **2/13/23**

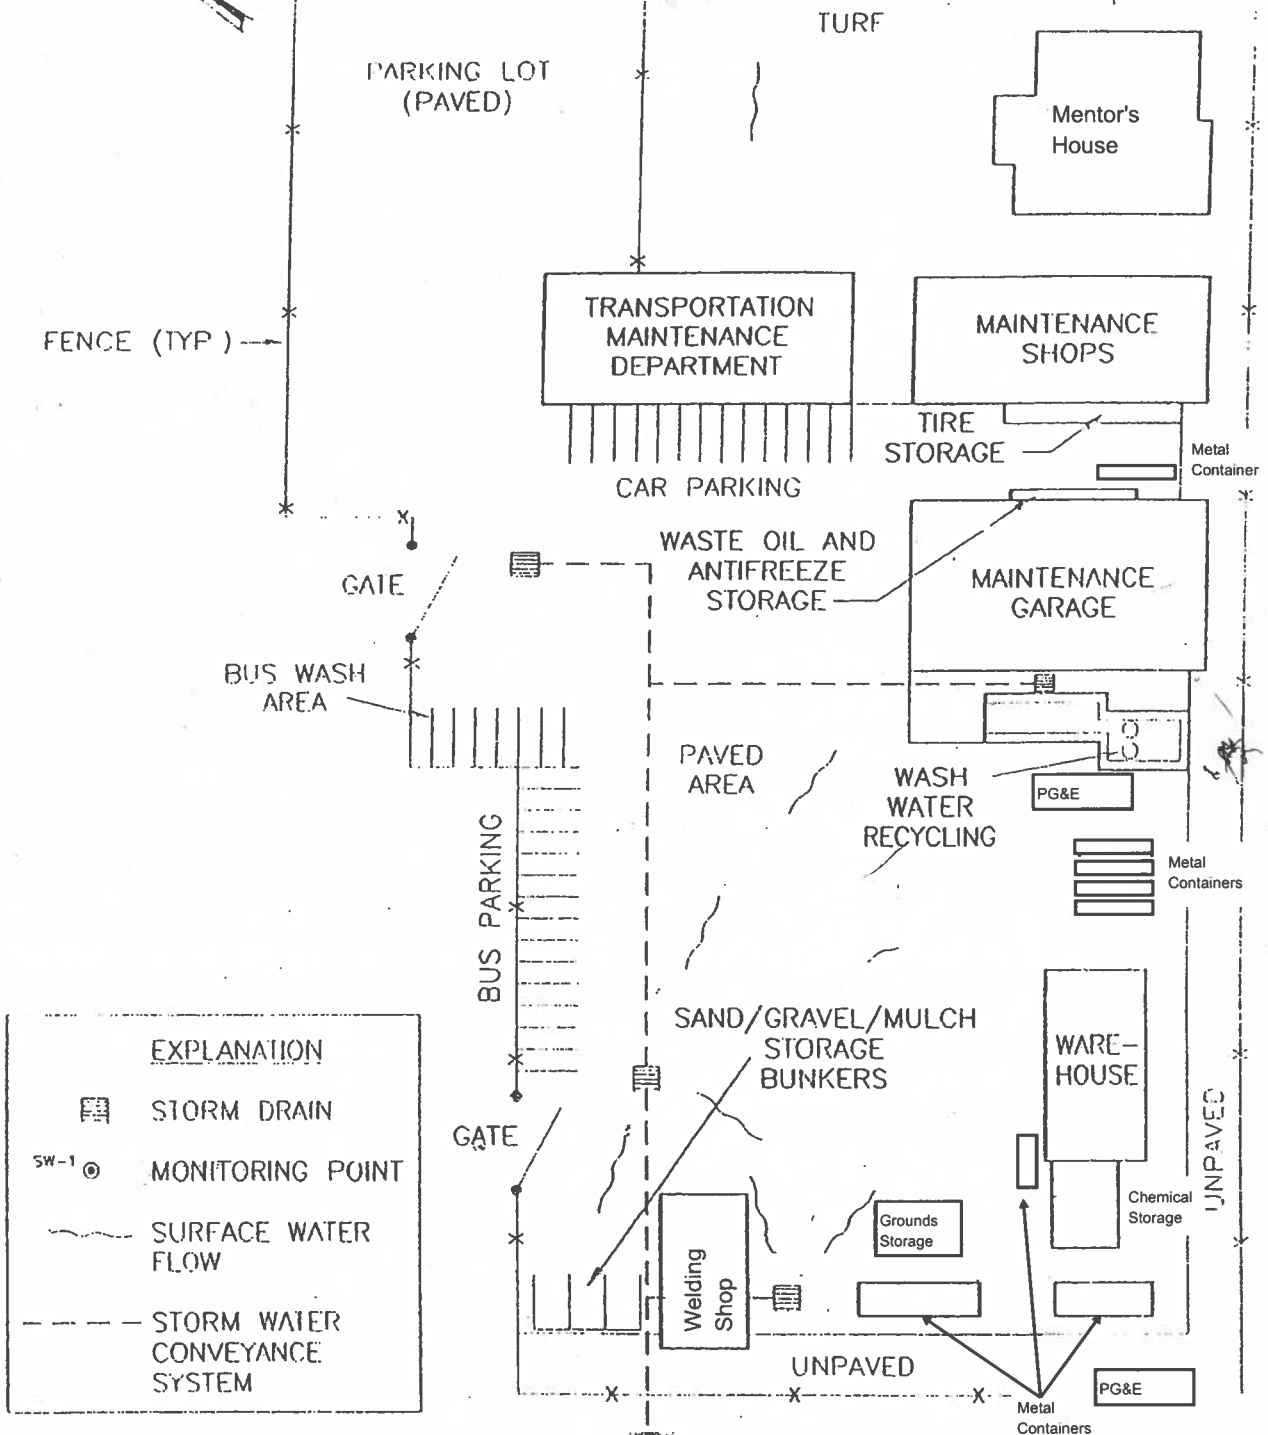

EXPLANATION	
	STORM DRAIN
SW-1	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE




DATE JUN. 1997  
DWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

EA-SANJOSE-CAD. DRAWINGS: 2136011 SITE SWQ. Yr: 1997. Date: 5/25/97. Scale: 1" = 100'. Designer: AU. Operator: AU.

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON:

08-15-2022

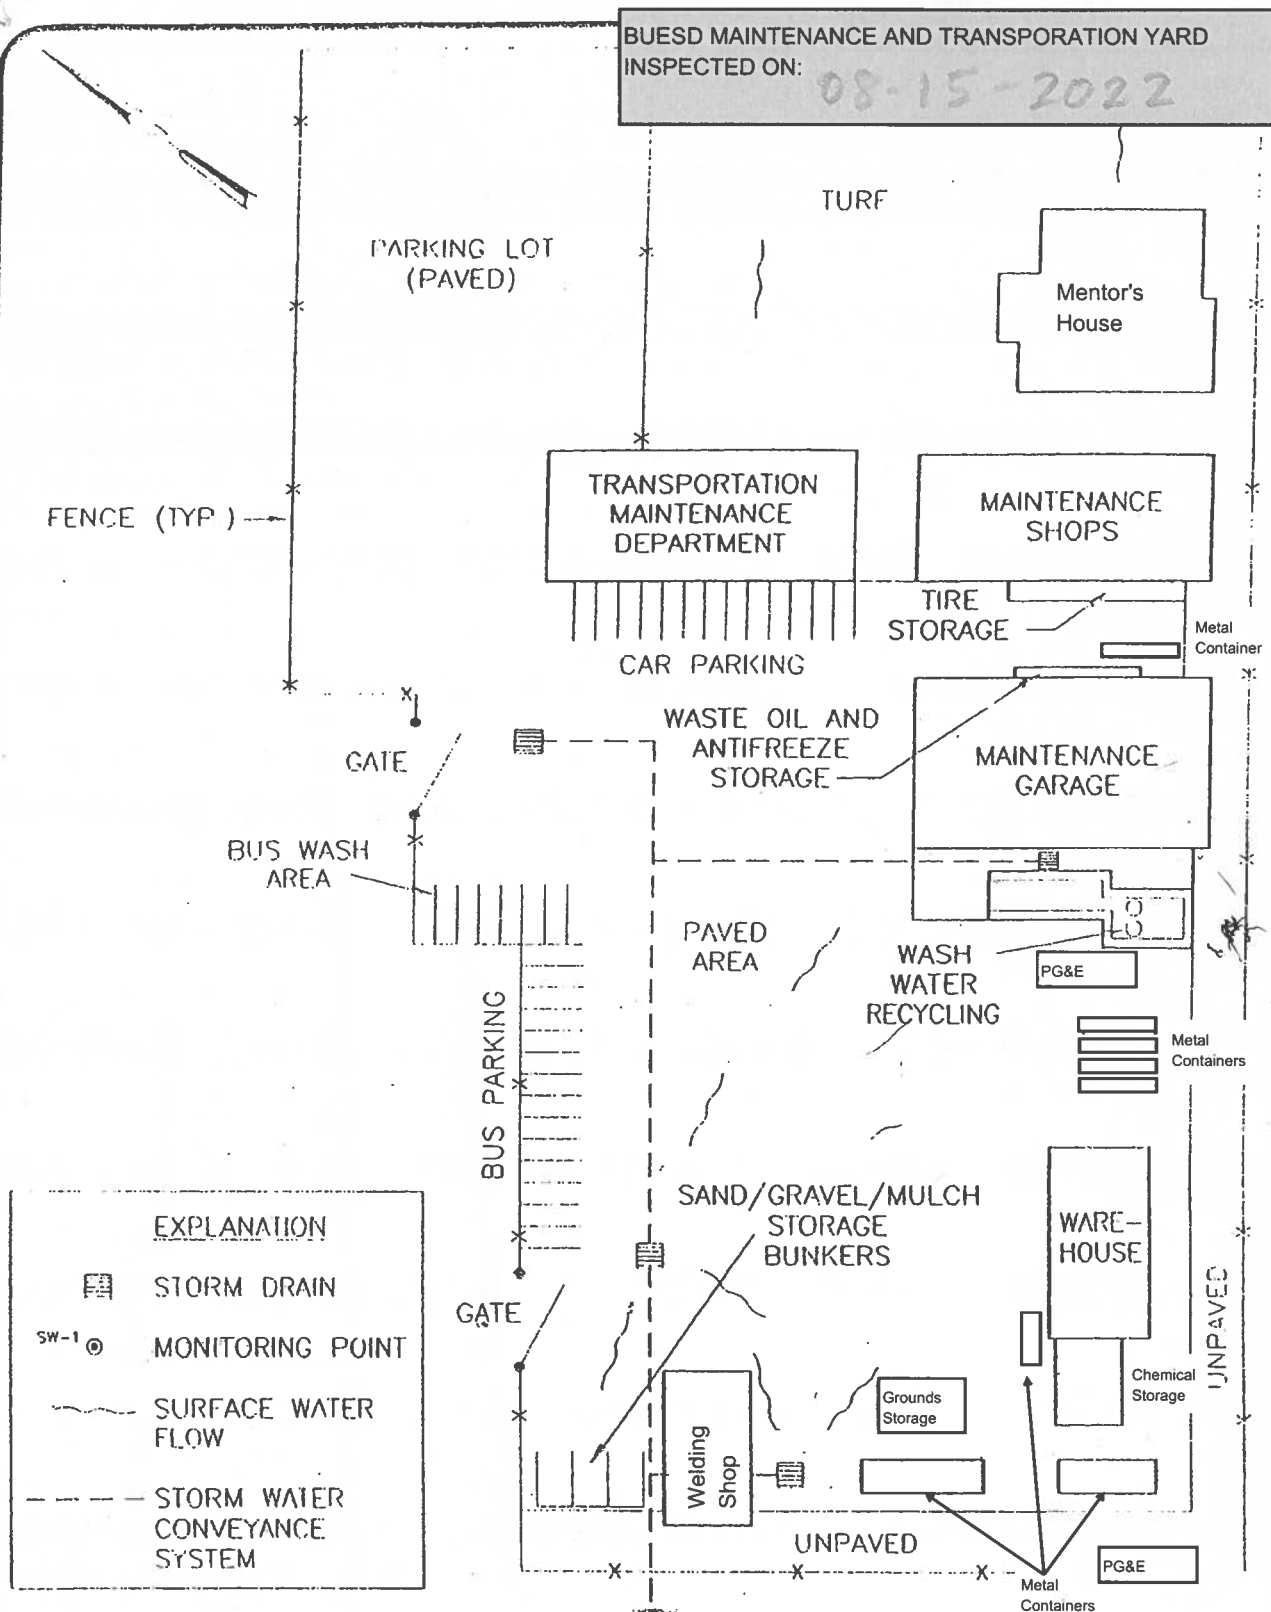

# EXPLANATION

- STORM DRAIN
- MONITORING POINT
- SURFACE WATER FLOW
- STORM WATER CONVEYANCE SYSTEM


NOT TO SCALE






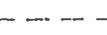
DATE JUN. 1997  
DWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

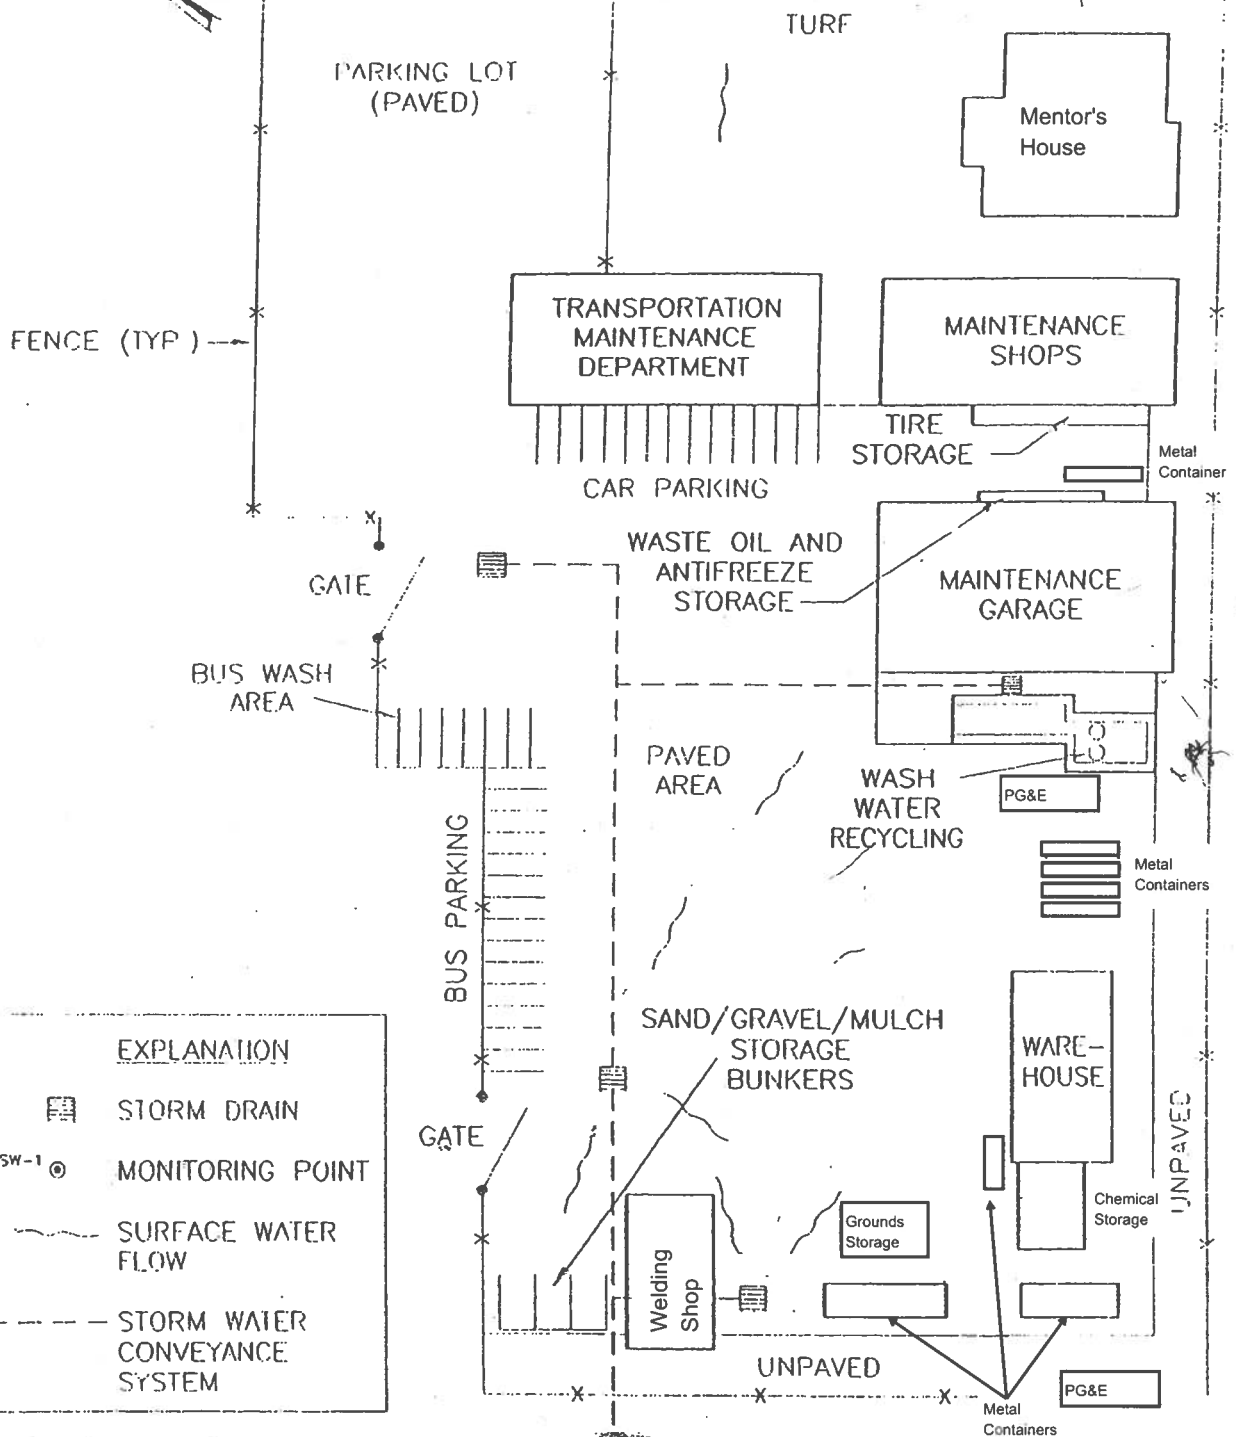BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 02-16-2022



# EXPLANATION

-  STORM DRAIN
-  MONITORING POINT
-  SURFACE WATER FLOW
-  STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE




DATE JUN. 1997  
OWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
**CORPORATION YARD  
SITE PLAN**

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON:

8/9/21

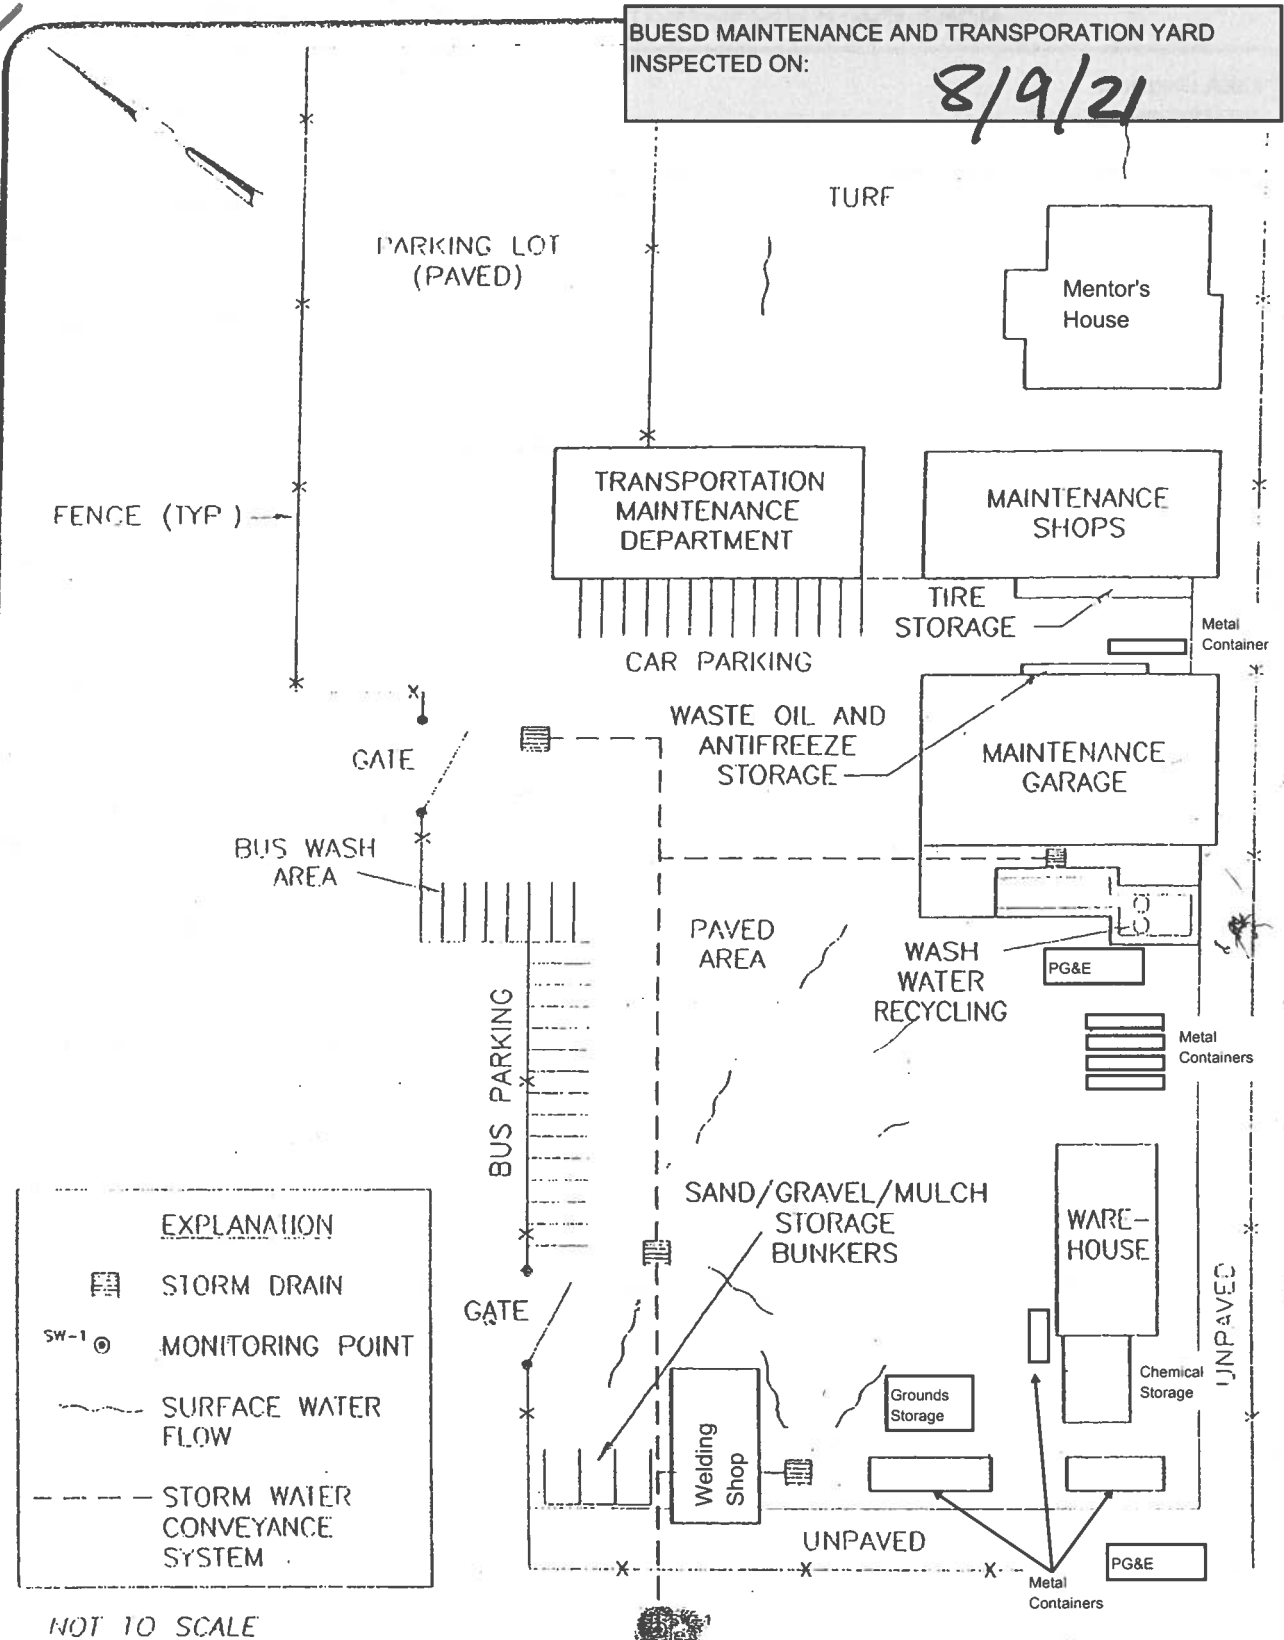

# EXPLANATION

- STORM DRAIN
- MONITORING POINT
- SURFACE WATER FLOW
- STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE



**Emcon**

DATE JUN. 1997

DWN KAJ

APP

REV


PROJECT NO.

2136-001.001

## FIGURE 2

BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 2/8/21

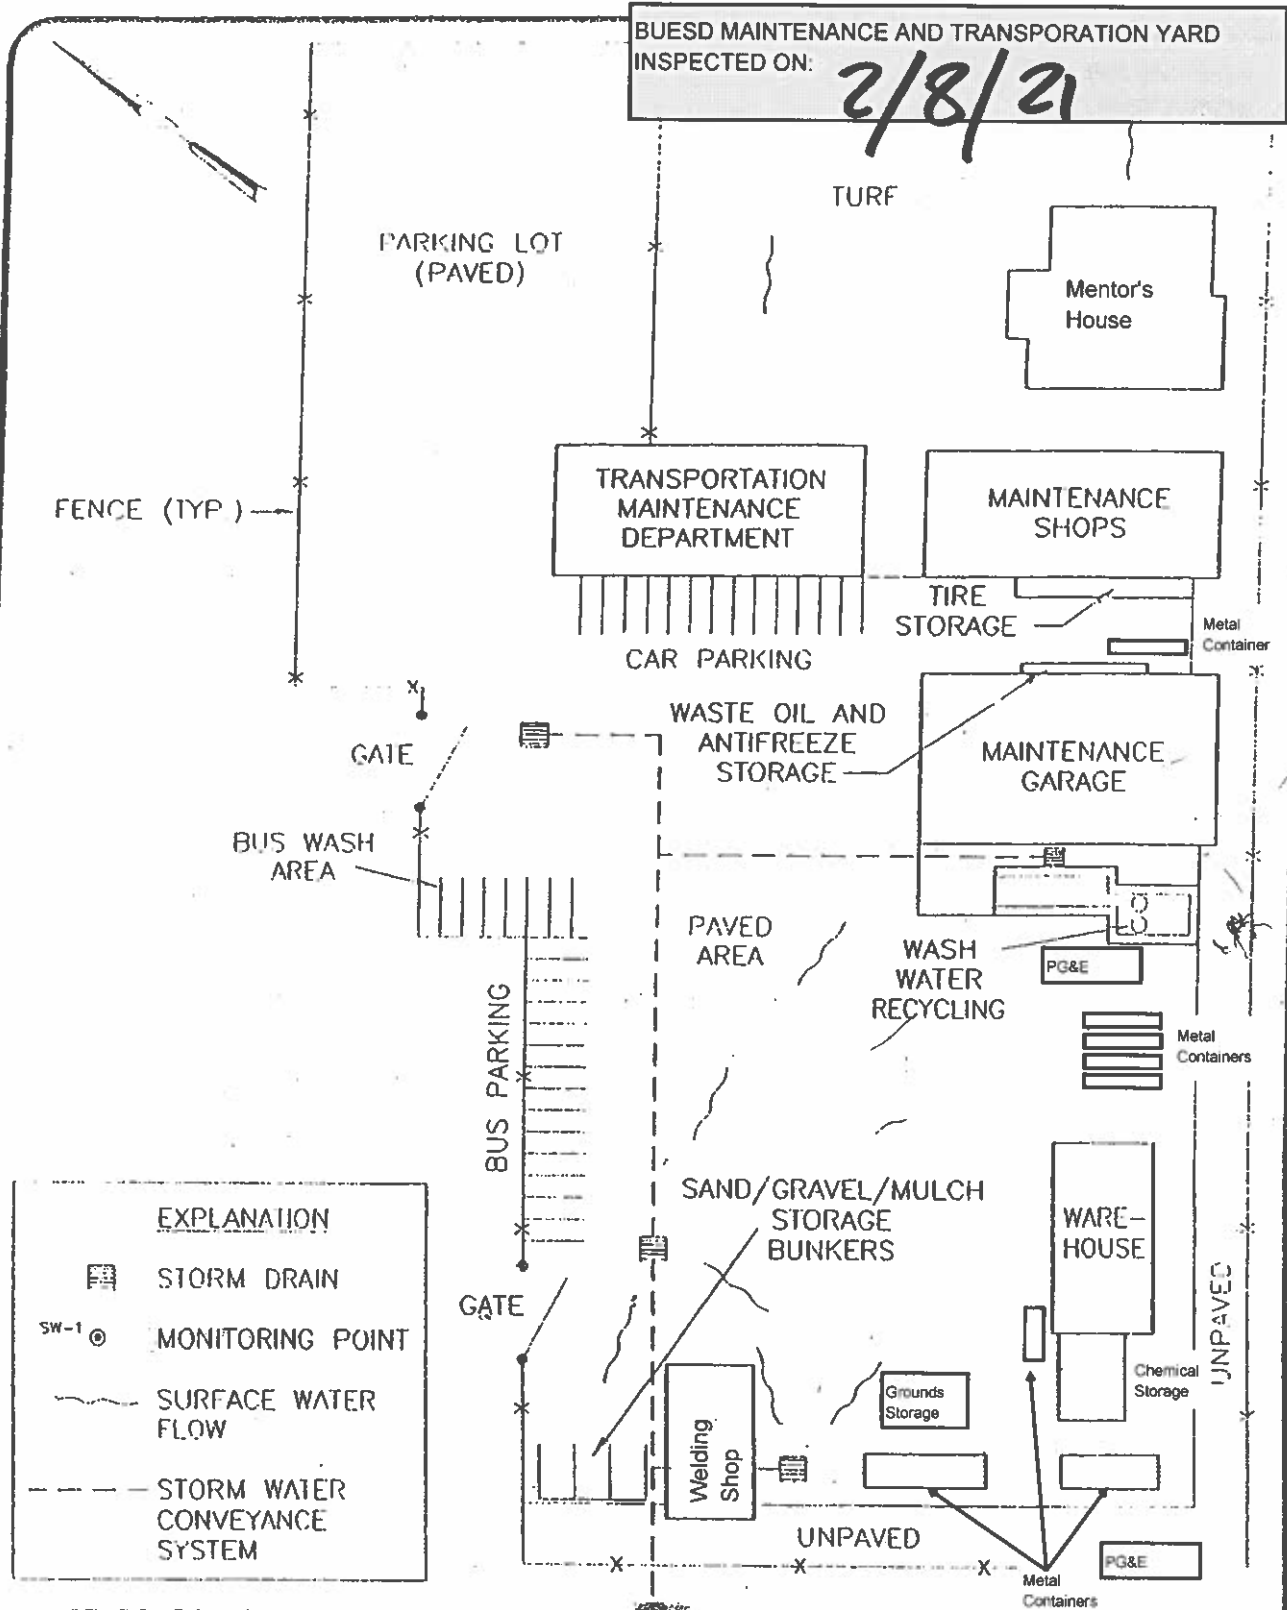

EXPLANATION	
	STORM DRAIN
SW-1	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE



**Emcon**


DATE JUN. 1997  
DWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN



BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON:

8/26/20

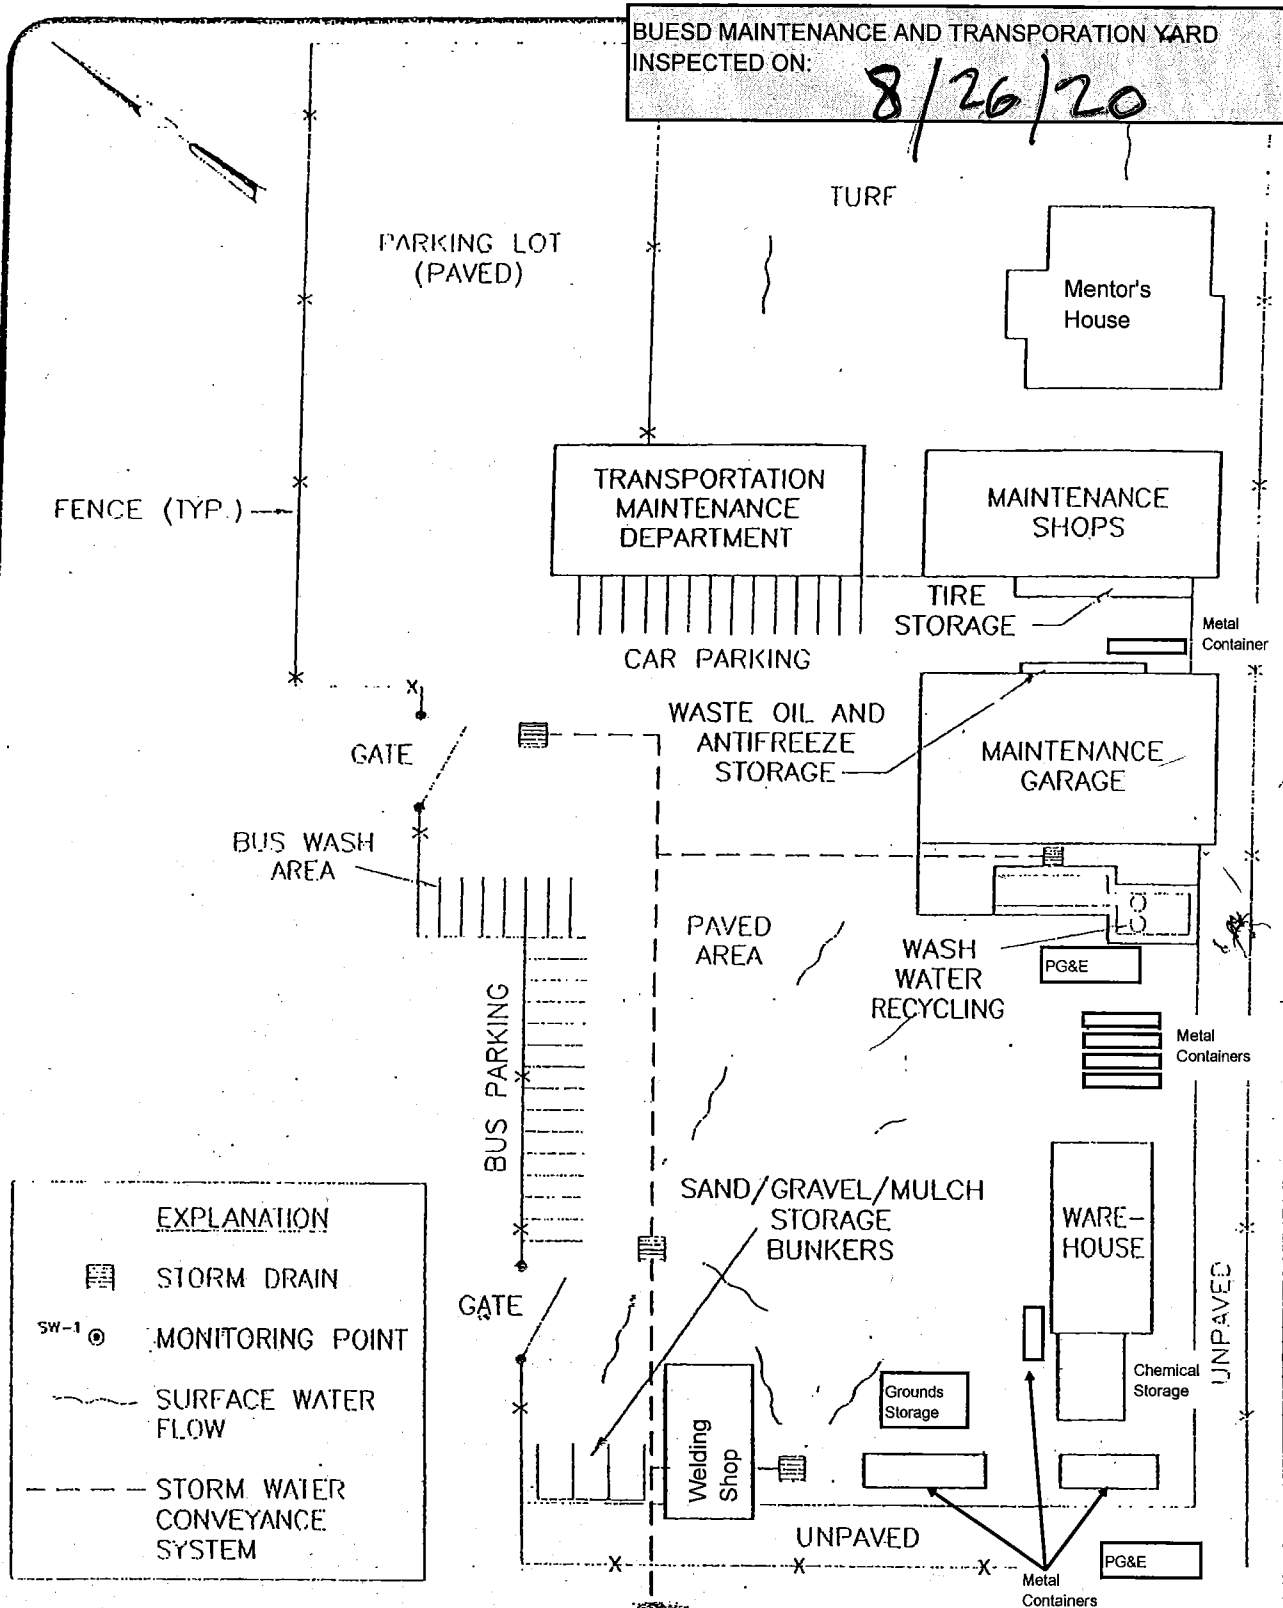

EXPLANATION	
	STORM DRAIN
	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM


NOT TO SCALE



DATE JUN. 1997  
DWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 1-30-2020

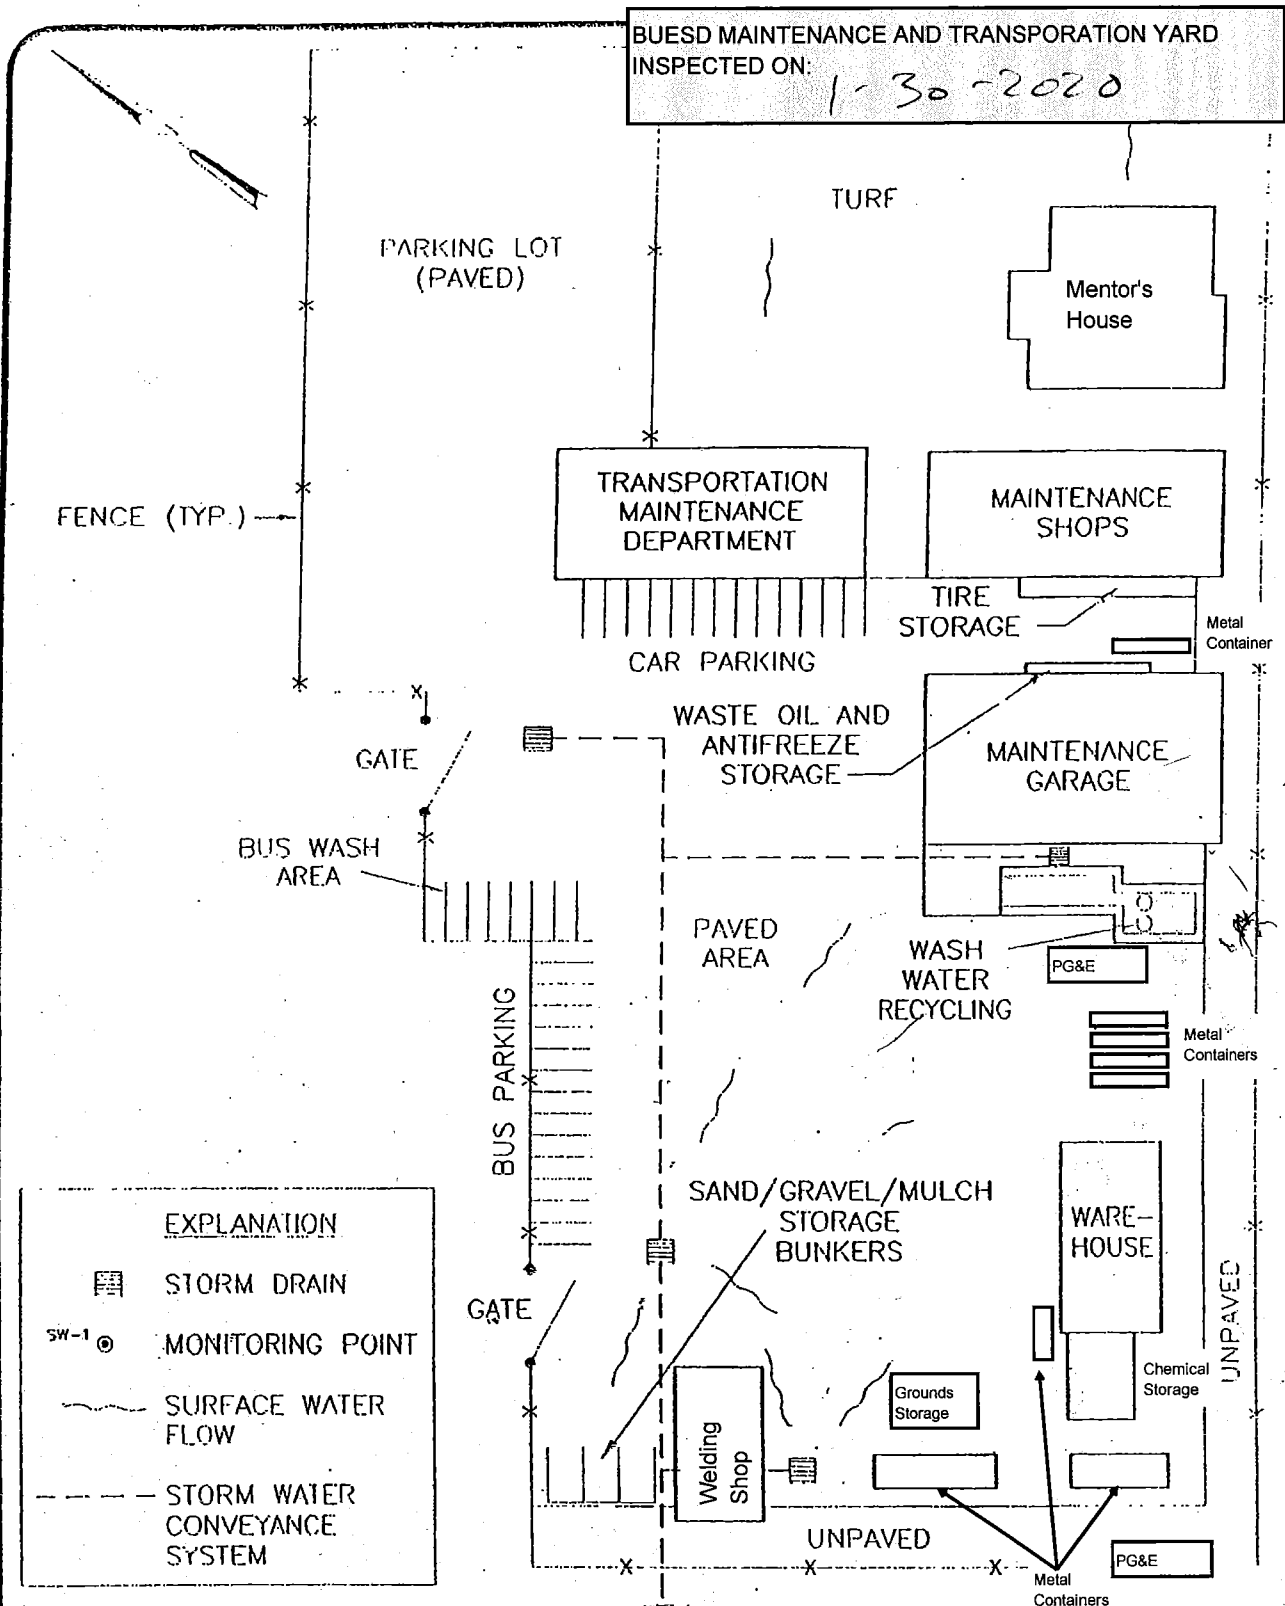

EXPLANATION	
	STORM DRAIN
	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM


NOT TO SCALE



DATE JUN. 1997  
DWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 8/12/19

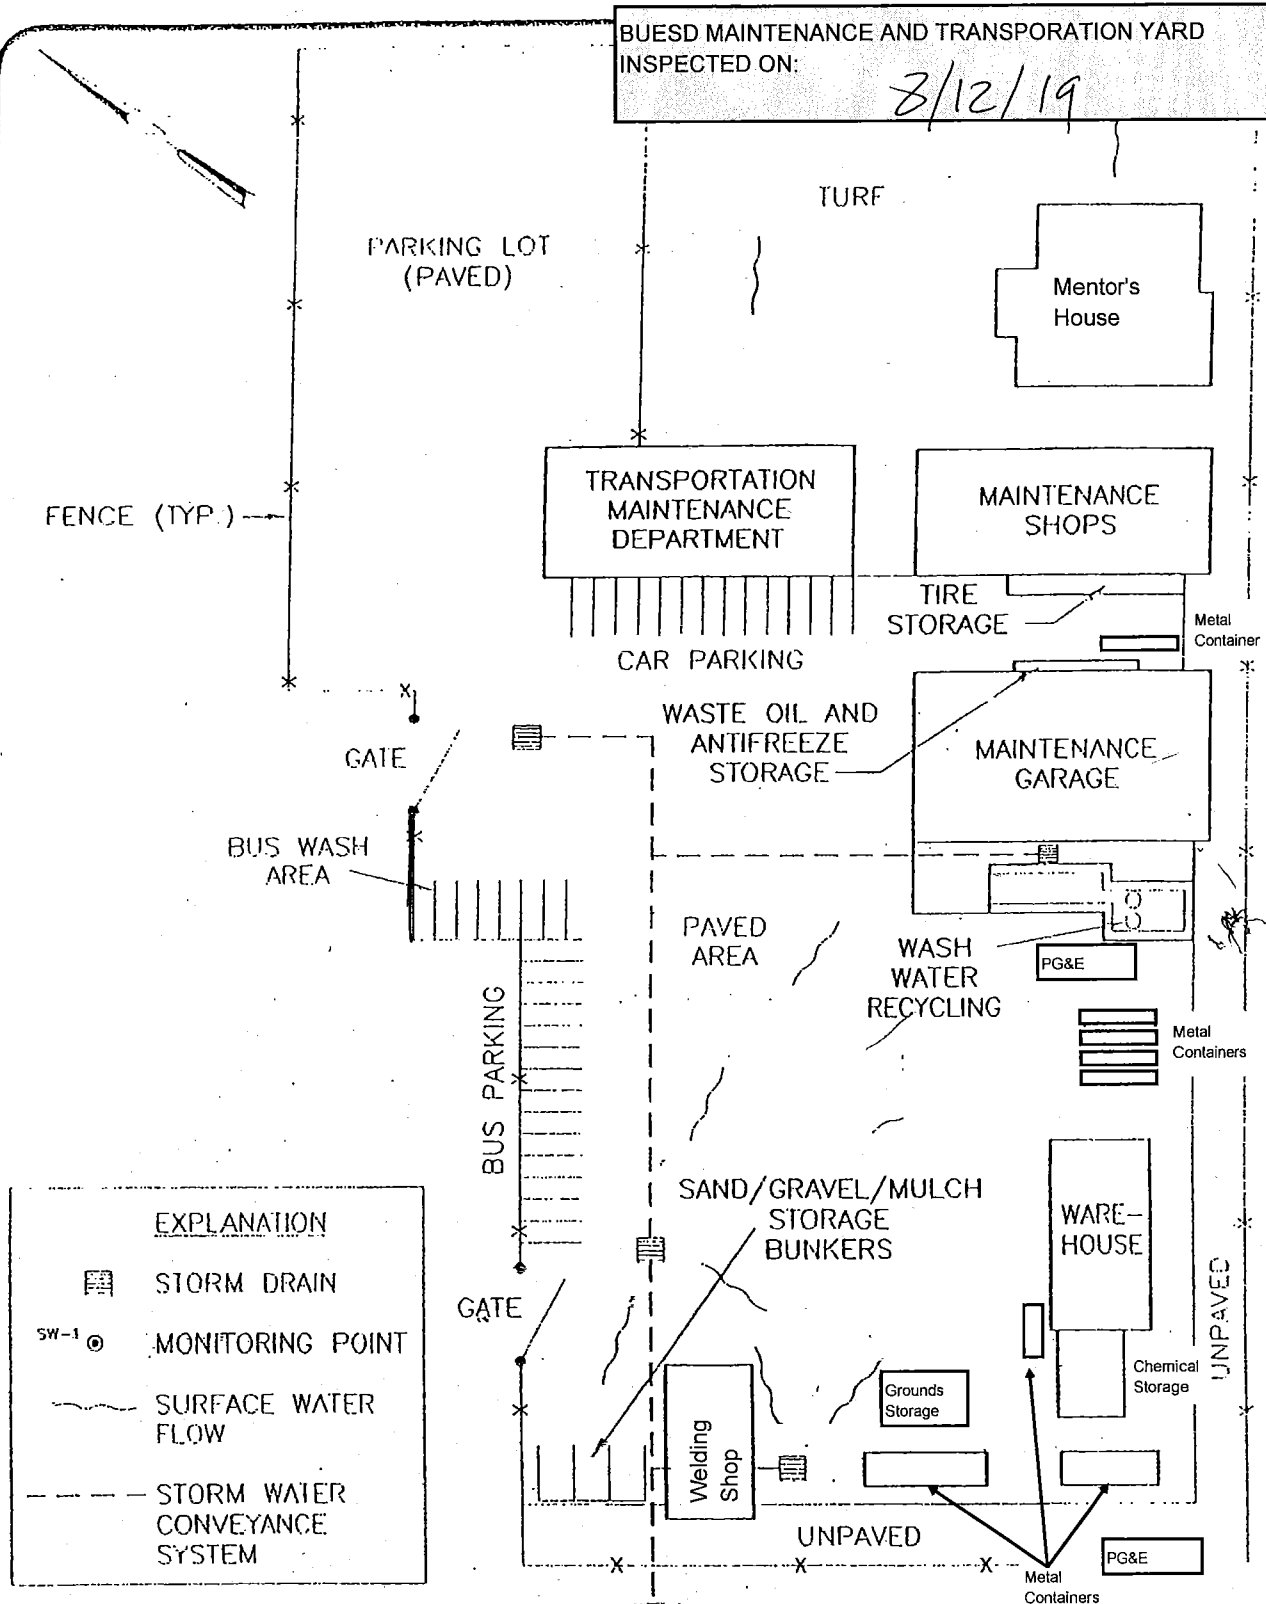

EXPLANATION	
	STORM DRAIN
SW-1	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE




DATE JUN. 1997  
OWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

EA-SANJOSE-CAD DRAWINGS: 2136011 SITE.dwg Xrefs: NONE  
Scale: 1" = 100' Date: 8/25/97 Plot: 8/25/97 Operator: AJ

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 02-04-2019

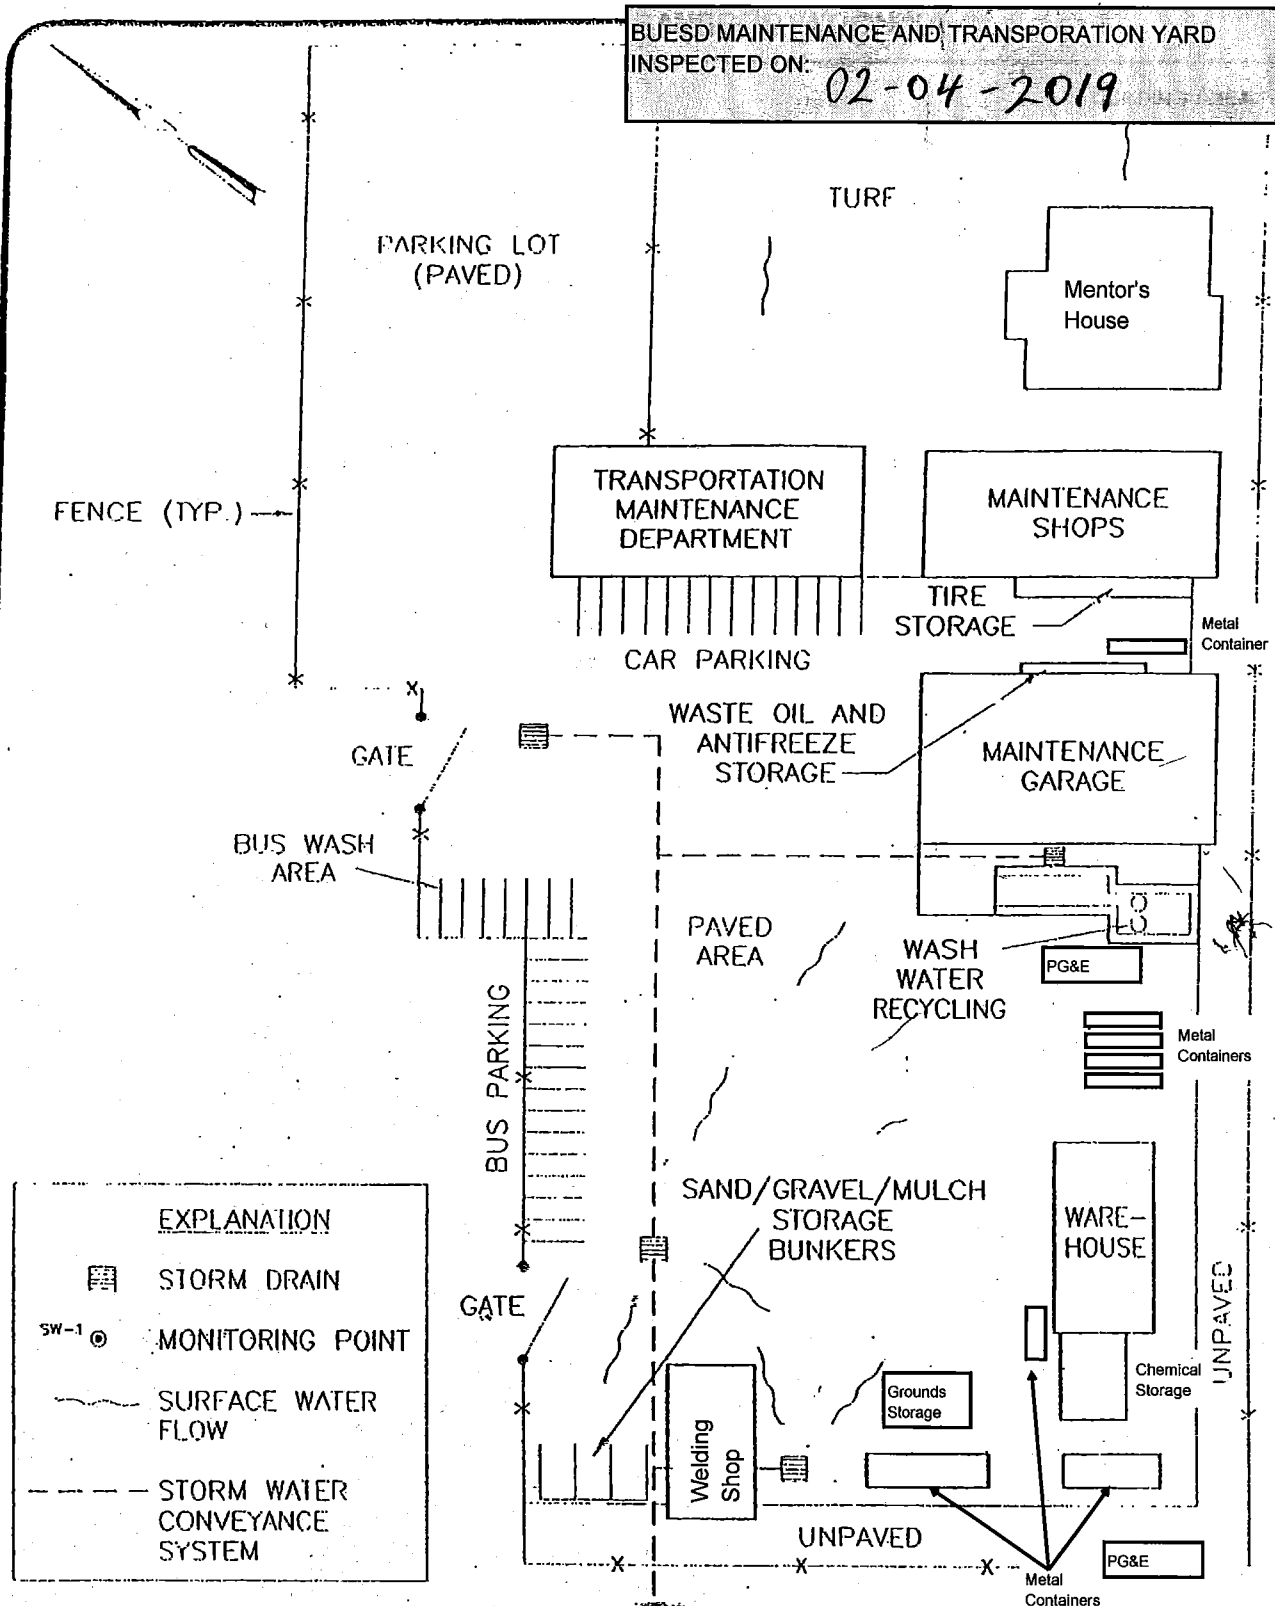

EXPLANATION	
	STORM DRAIN
SW-1	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM


NOT TO SCALE



DATE JUN. 1997  
OWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
**BERRYESSA UNION SCHOOL DISTRICT**  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
**CORPORATION YARD**  
**SITE PLAN**


EA-SANJOSE-CAD. DRAWINGS. 213601-SITE.dwg Xref: <NONE>  
Scale: 1" = 100' Date: 5/25/97 Time: 01:12 AM Operator: AJ

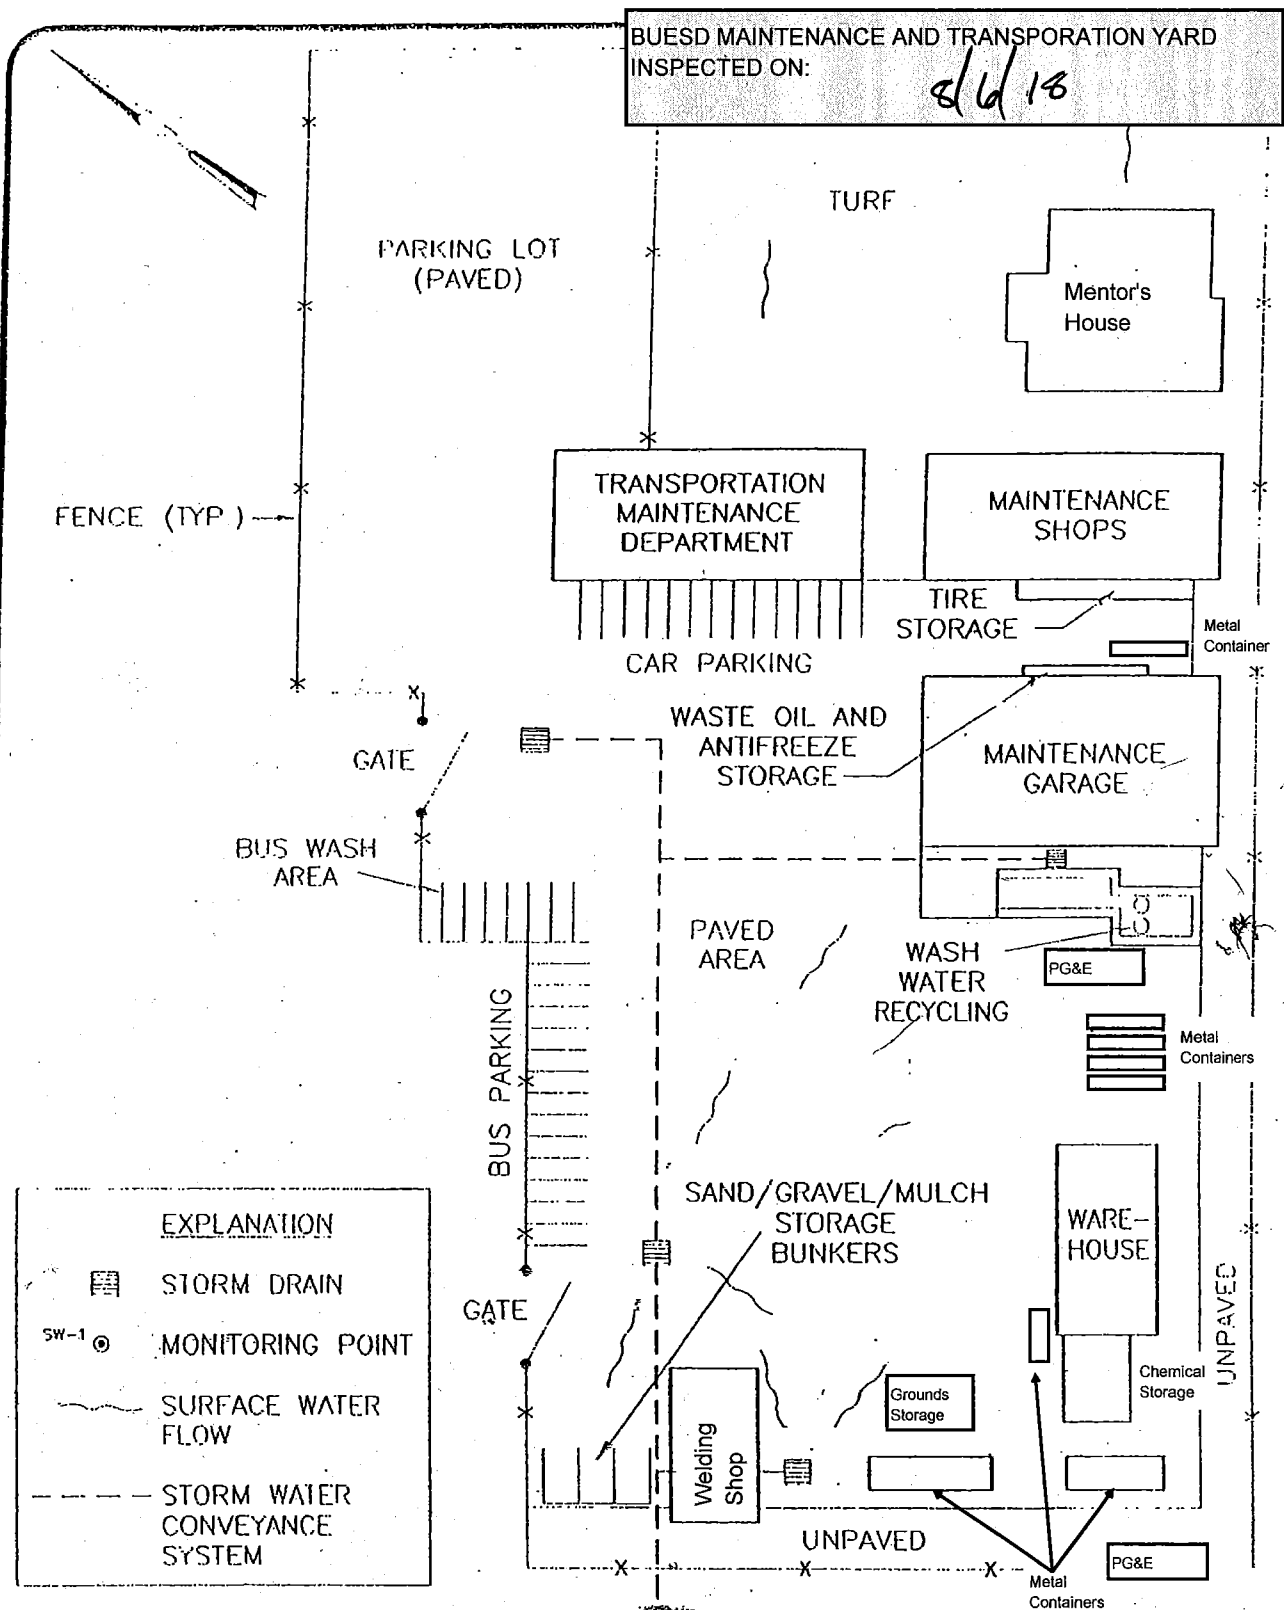

DATE JUN. 1997  
OWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 2/12/18

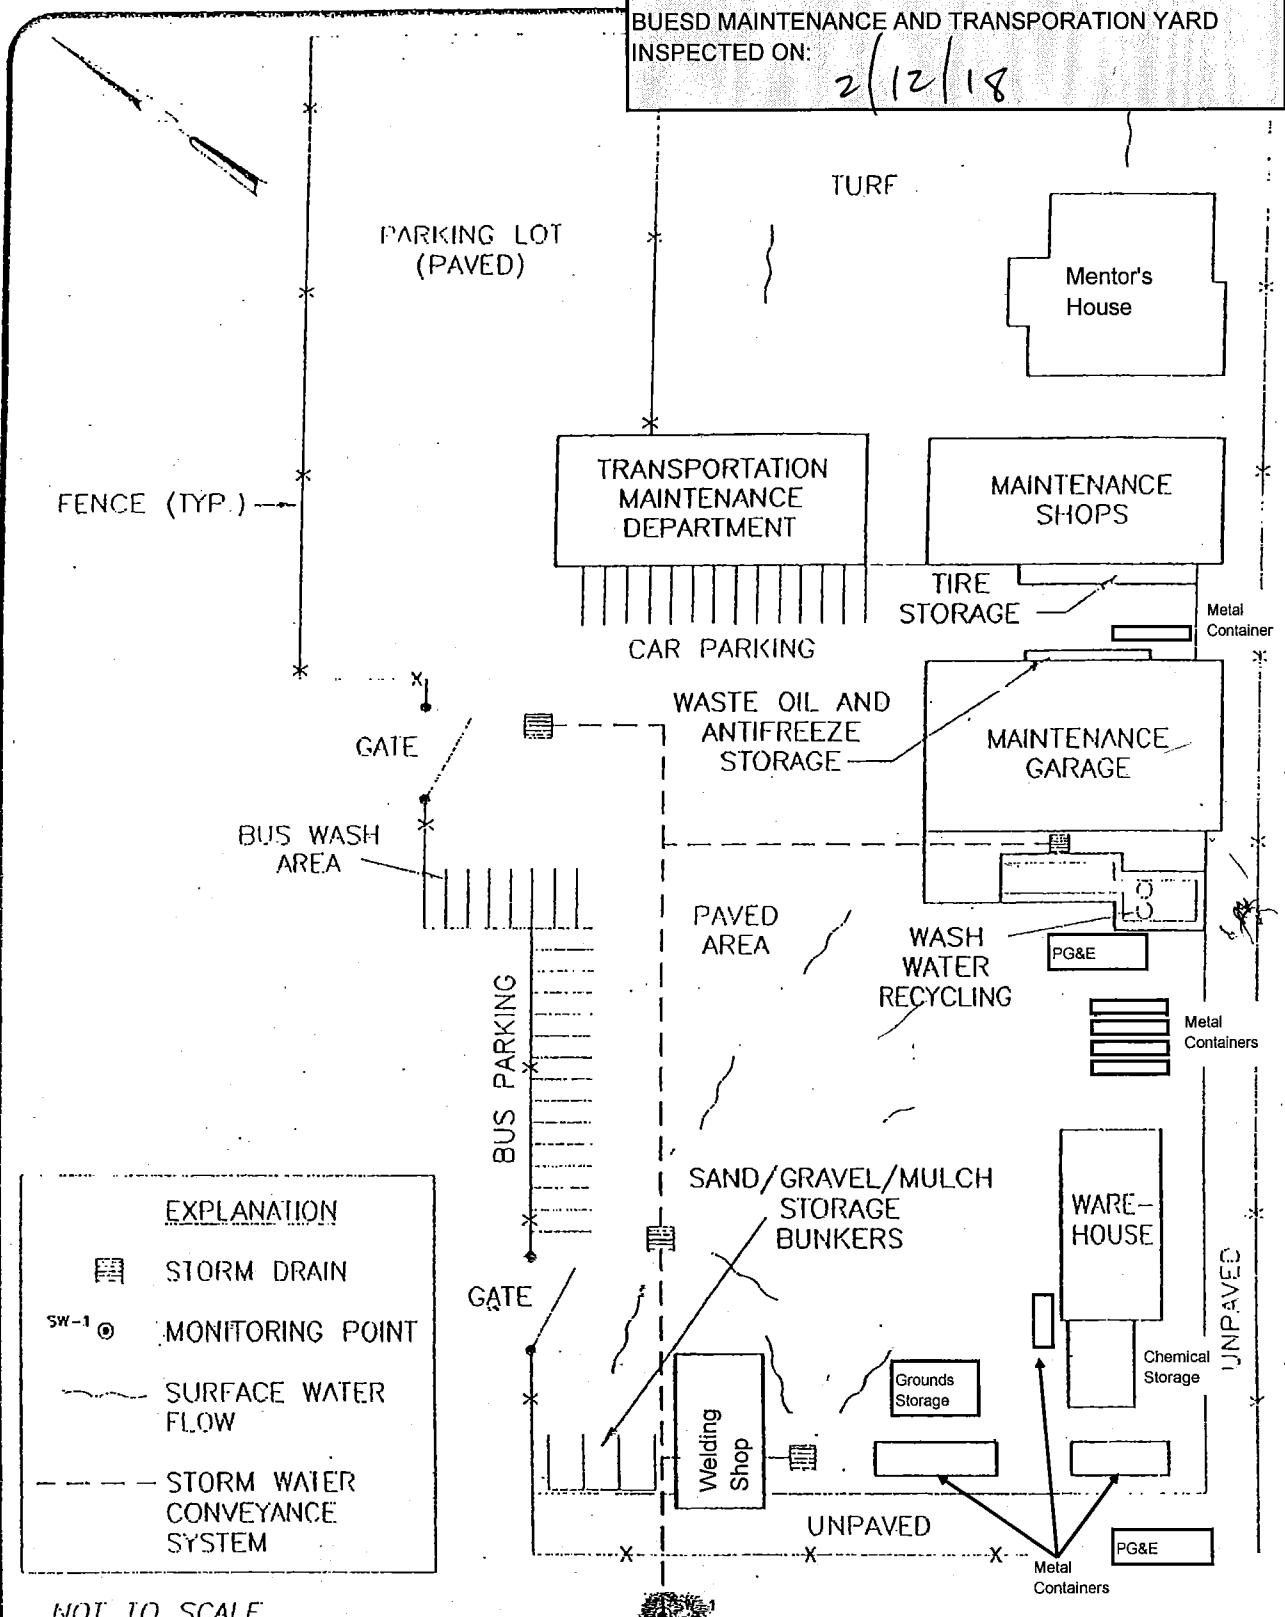


DATE JUN. 1997  
DWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
**BERRYESSA UNION SCHOOL DISTRICT**  
**945 PIEDMONT ROAD**  
**SAN JOSE, CALIFORNIA**  
**CORPORATION YARD**  
**SITE PLAN**

EA-SANJOSE-CAD. DRAWINGS. 2136011 SITE PLAN. Xref: 420962  
Scale: 1" = 100' Unsealed: 1/20 Date: 5/25/97 "met. C:12 AM Operator: AU

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 8/25/17

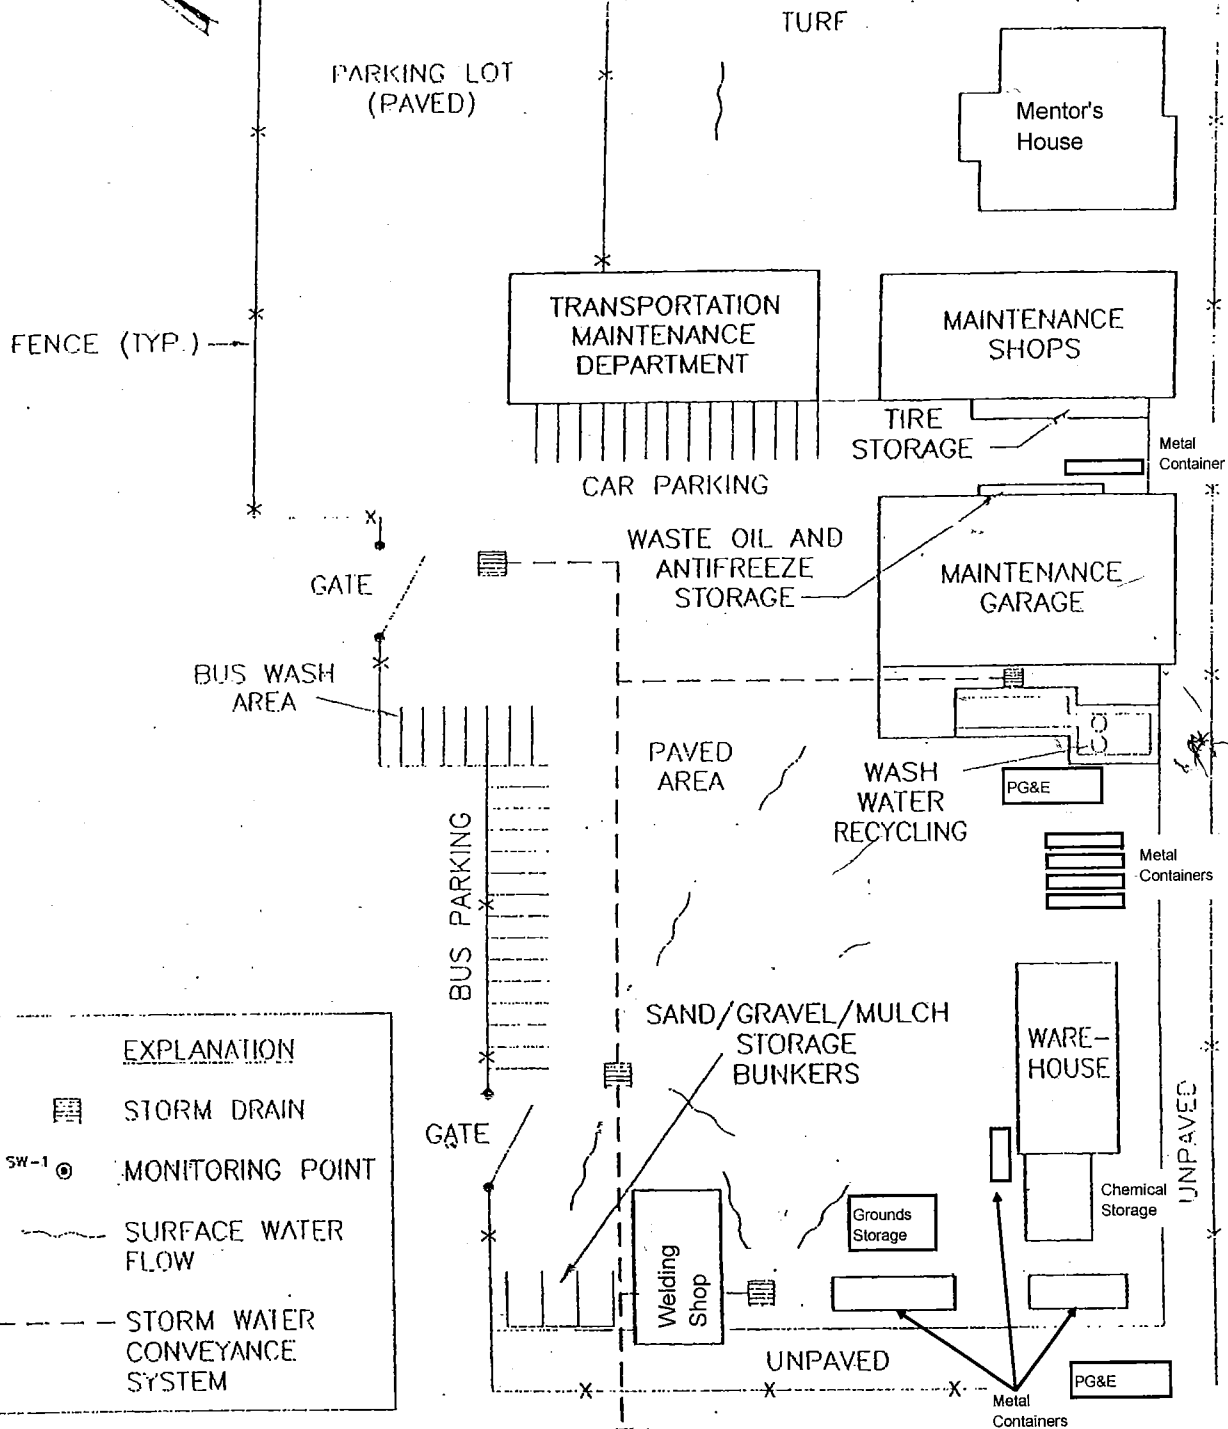

EXPLANATION	
	STORM DRAIN
	MONITORING POINT
	SURFACE WATER FLOW
	STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE




DATE JUN. 1997  
OWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

**FIGURE 2**  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

EA-SANJOSE-CAD. DRAWINGS: 2136011 SITE.dwg Xrefs: <NONE>  
Scale: 1" = 100' Date: 5/25/97 Plot: 0:12 AM Operator: AU

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON:

3/27/17

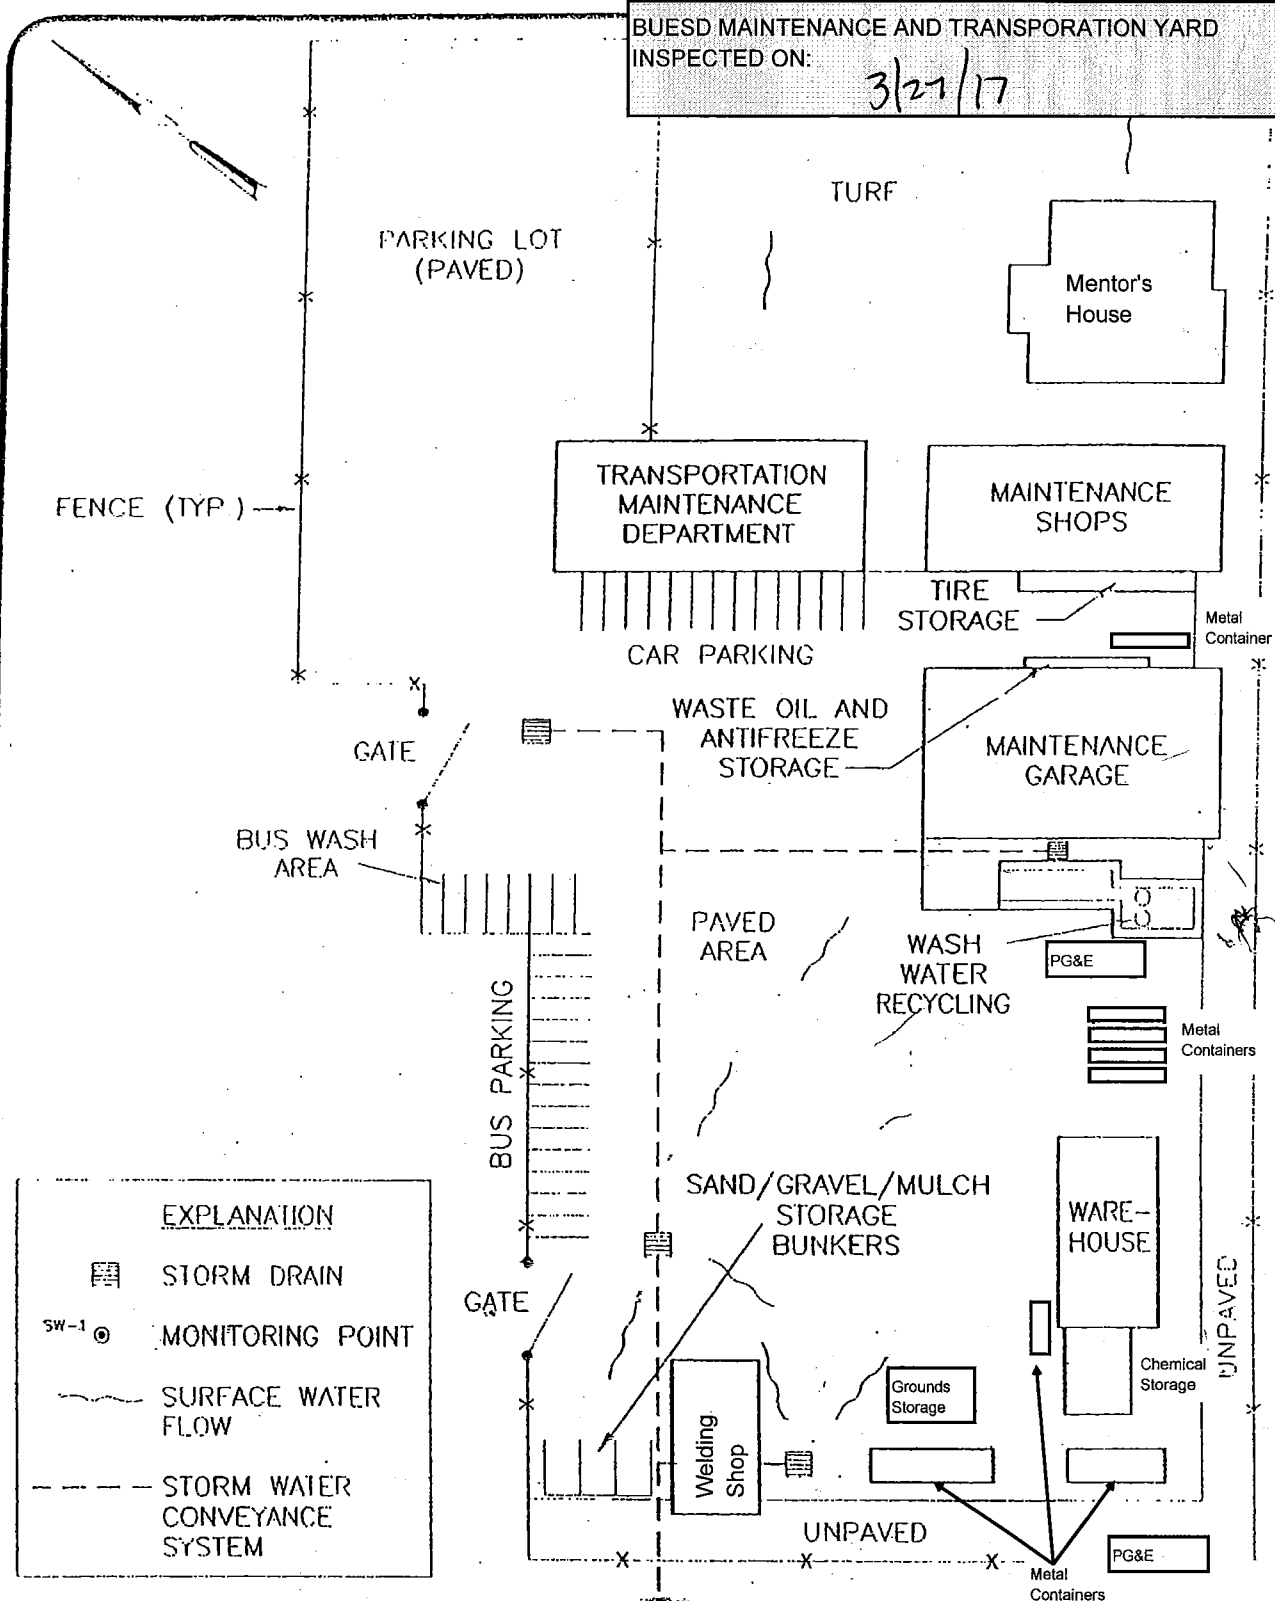

EXPLANATION

- STORM DRAIN
- MONITORING POINT
- SURFACE WATER FLOW
- STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE



**Emcon**

DATE JUN. 1997

DWN KAJ

APP

REV

PROJECT NO.


2136-001.001

**FIGURE 2**

BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN



BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON: 7-9-16

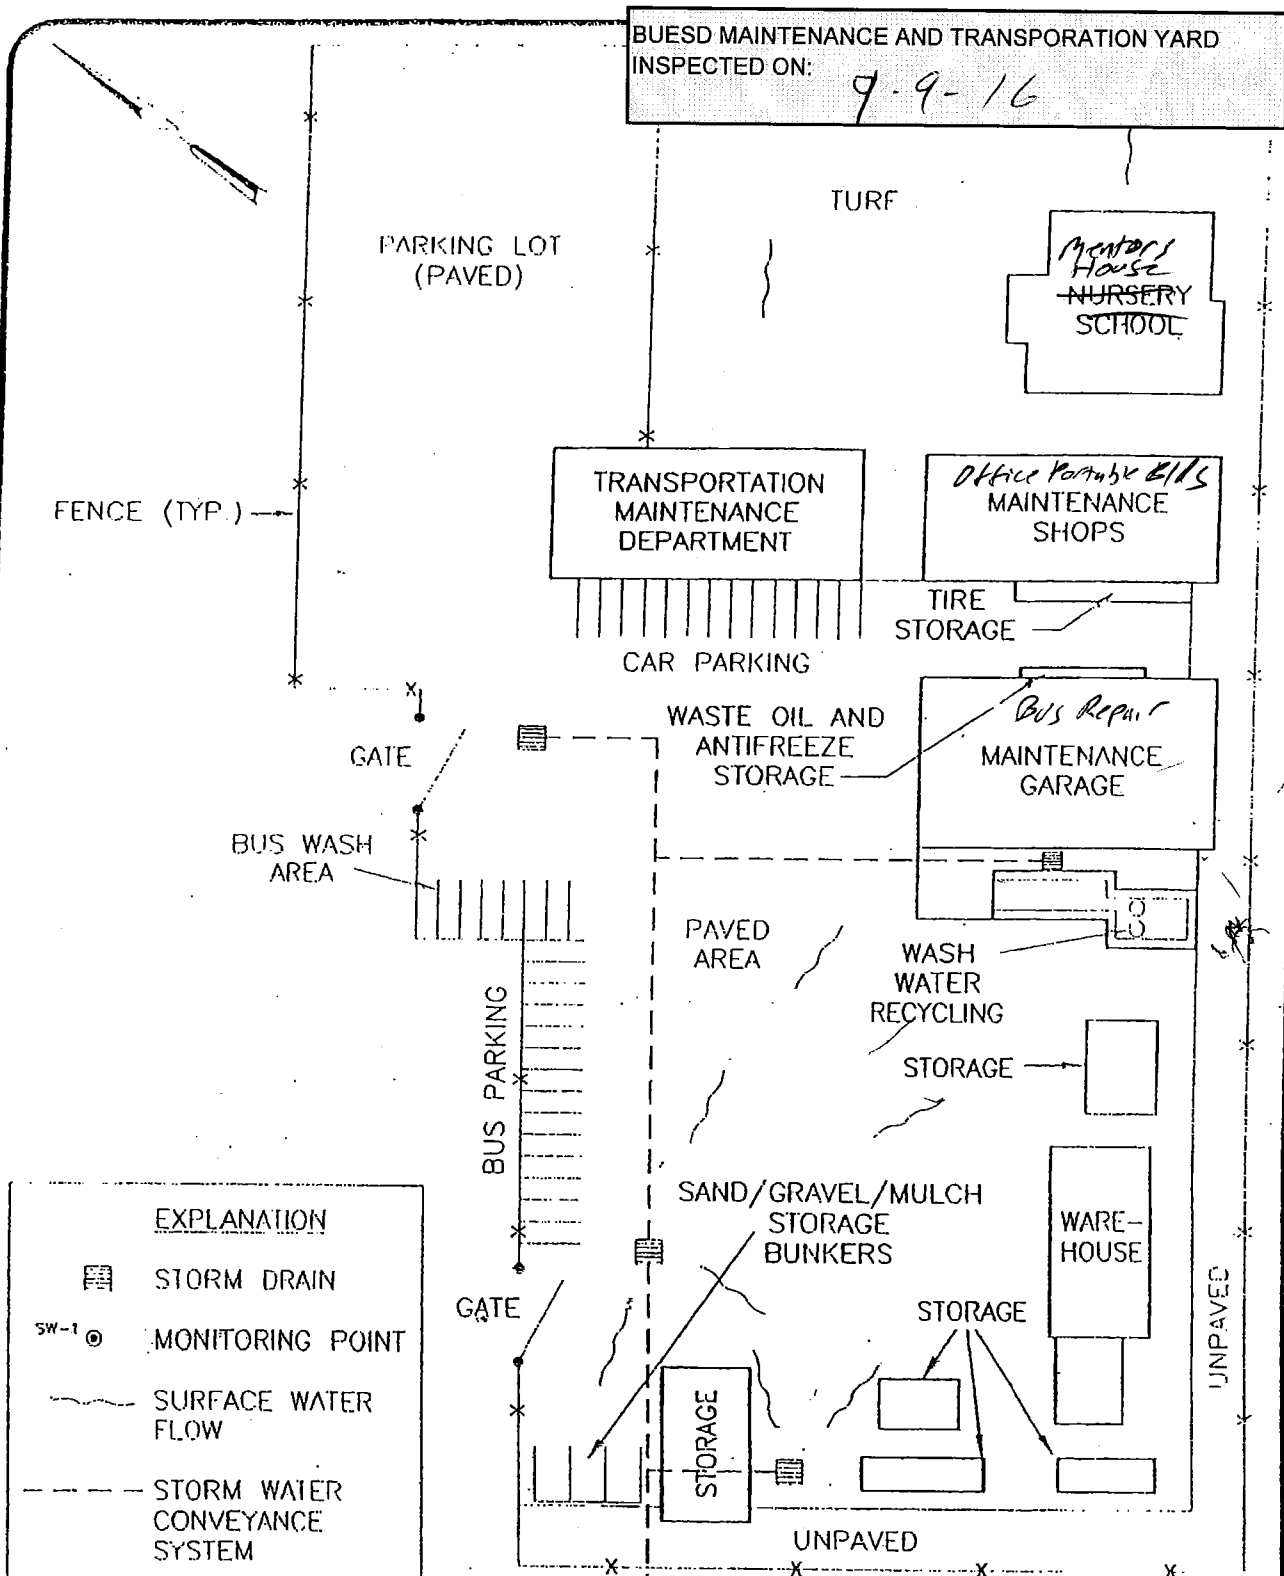

EXPLANATION

- STORM DRAIN
- MONITORING POINT
- SURFACE WATER FLOW
- STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE



**Emcon**

DATE JUN. 1997

DWN KAJ

APP

REV

PROJECT NO.


2136-001.001

FIGURE 2

BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

BUESD MAINTENANCE AND TRANSPORTATION YARD  
INSPECTED ON:

3-17-16 *1990*

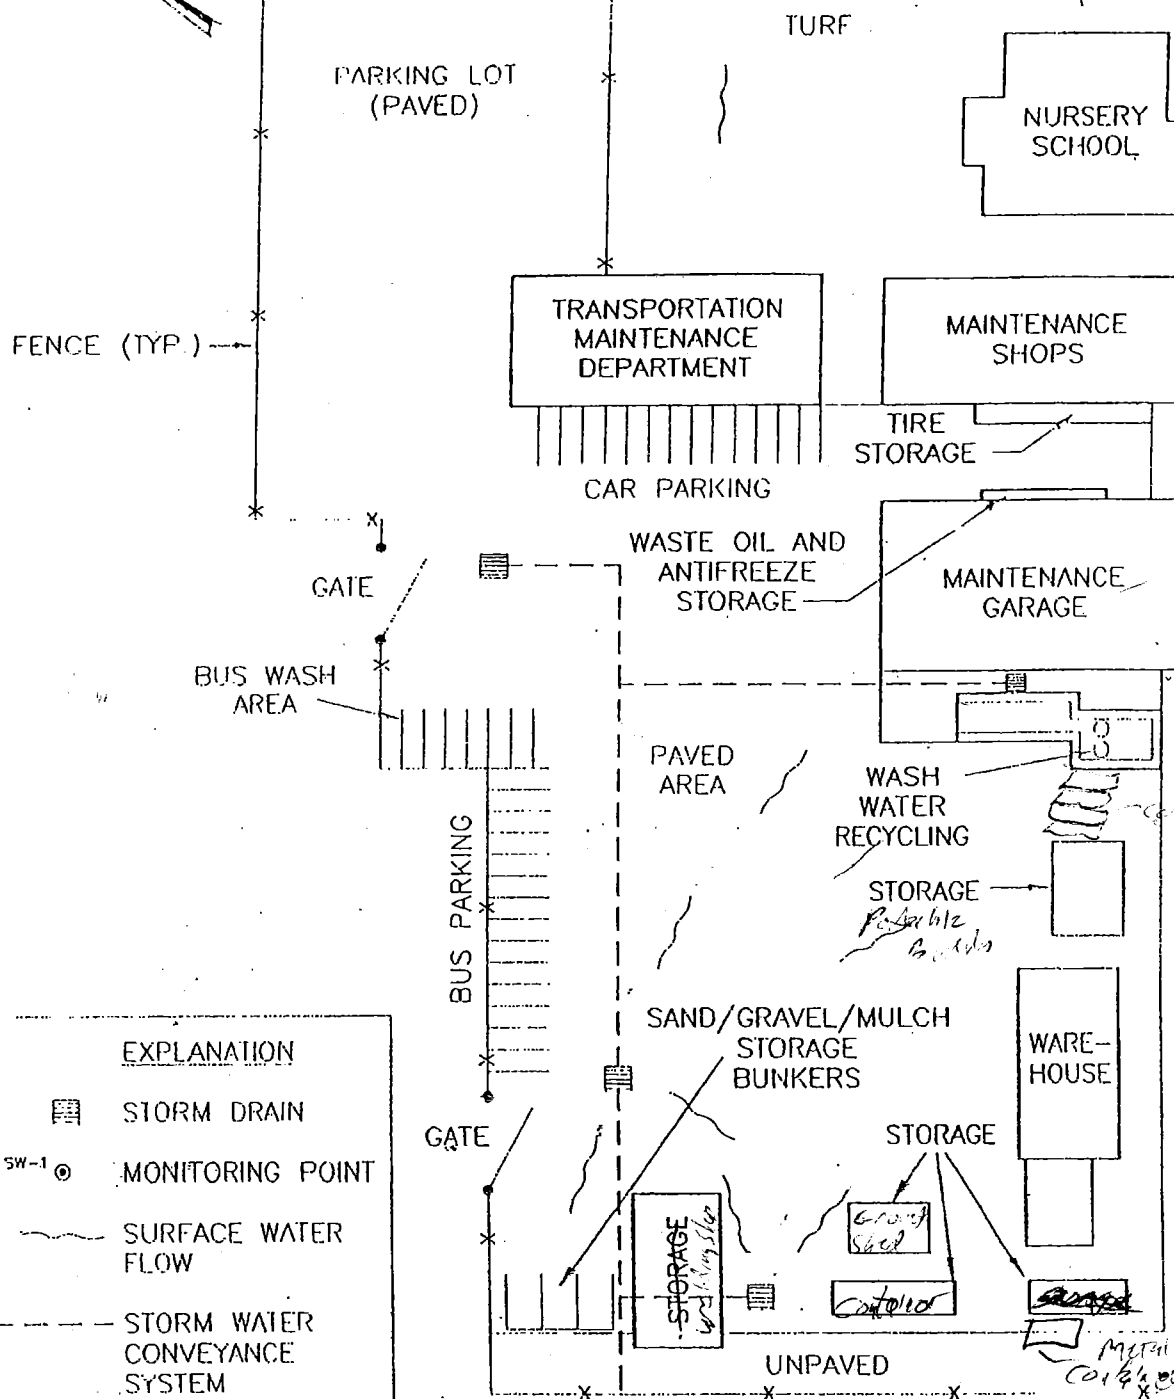

EXPLANATION

- STORM DRAIN
- MONITORING POINT
- SURFACE WATER FLOW
- STORM WATER CONVEYANCE SYSTEM

NOT TO SCALE



DATE JUN. 1997  
OWN KAJ  
APP  
REV  
PROJECT NO.  
2136-001.001

FIGURE 2  
BERRYESSA UNION SCHOOL DISTRICT  
945 PIEDMONT ROAD  
SAN JOSE, CALIFORNIA  
CORPORATION YARD  
SITE PLAN

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 2/15/16

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Welding Shop

Grounds  
Tools  
Mower

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 3/18/15

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 8-28-14

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 3-3-14

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 09-23-2013

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON:

04-01-13

Welding Shop

Grounds  
Tools  
Mower

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132



Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 10-8-12

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

PORTABLE

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON:

04-13-12

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Main Office

Garage

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 11-29-11

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON:

7/30/10

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Grounds  
Tools  
Mower

Welding Shop

Plumbing  
Locksmith

Garage

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 03-08-10

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132


Plumbing  
Locksmith

Main Office

Garage

metal storage

metal garage

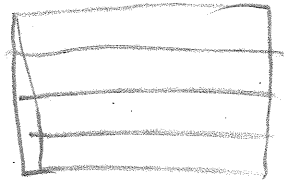

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

metal storage

Towers


Grounds  
Tools  
Mower

Welding Shop

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 09-03-09

BERREYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

metal storage

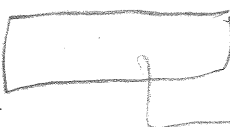

Plumbing  
Locksmith

Garage

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 05-11-09

09-09-8 RBZ

Welding Shop

Grounds  
Tools  
Mower

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

5/11/09  
171181  
1669

Plumbing  
Locksmith

Garage

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 10/13/08

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132



Plumbing  
Locksmith

Garage

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: 04-14-08

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132

Plumbing  
Locksmith

Garage

GT  
porta

Carpenter shop, Warehouse,  
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD  
INSPECTED ON: *NOV. 5, 07*

Grounds  
Tools  
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT  
Maintenance Yard  
945 Piedmont Road  
San Jose, CA 95132