

## **SIX-MONTH SURVEILLANCE AHERA REPORT**

**NORTHWOOD ELEMENTARY SCHOOL  
2760 TRIMBLE ROAD  
SAN JOSE, CA 95132**

**PREPARED FOR:  
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT  
1376 PIEDMONT ROAD  
SAN JOSE, CA 95132**

**INSPECTED ON:  
FEBRUARY 23, 2022**

**HAZMAT DOC PROJECT #22-025**

**PREPARED BY:  
HAZMAT DOC  
3080 OLCOTT STREET • SUITE D135  
SANTA CLARA, CA 95054  
Tel: 408.748.0055**

**BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT  
NORTHWOOD ELEMENTARY SCHOOL**

**INSPECTED ON:  
FEBRUARY 23, 2022**

**INSPECTED BY:**



---

**Leland Kafeyan  
Cal/OSHA Certified Site Surveillance Technician  
Certification Number 06-4110**

**REPORTED BY:**

*Maheen B. Doctor*

---

**Maheen B. Doctor  
Cal/OSHA Certified Asbestos Consultant  
Certification Number 95-1798**

# **CONTENTS**

## **PART - I**

### **LEGEND AND GLOSSARY OF TERMS**

## **PART - II**

### **AHERA REPORT A - LIST OF BUILDINGS**

## **PART - III**

### **AHERA REPORT B - SURVEY REPORT**

## **PART - IV**

### **HOMOGENEOUS MATERIALS REPORT**

## **PART - V**

### **FRIABLE LOCATIONS REPORT**

## **PART - VI**

### **NON-FRIABLE LOCATIONS REPORT**

## **PART - VII**

### **RECOMMENDATIONS REPORT**

## **PART - VIII**

### **SAMPLES REPORT**

## **PART - IX**

### **DAMAGE REPORT**

## **PART - X**

### **SITE MAPS**

## LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

### Asbestos Sample Types

AC	=	ACTINOLITE
AM	=	AMOSITE
AN	=	ANTHOPHYLLITE
CH	=	CHRYBOTILE
CR	=	CROCIDOLITE
TR	=	TREMOLITE
ND	=	NONE DETECTED
NS	=	NO SAMPLE

### Measurements

APPROX.	=	APPROXIMATELY
EA	=	EACH
I	=	INCHES
LF	=	LINEAR FEET
N	=	NUMBER
O.D.	=	OUTSIDE DIAMETER
SF	=	SQUARE FEET
TBD	=	TO BE DETERMINED

# LIST OF BUILDINGS AT

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME BUILDING USED AS ( #FLOORS ) CONSTRUCTION	BUILDING AREA (APPROXIMATE)
<b>ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)</b>	
Offices, Multi-Purpose Room, Music Room, Restrooms, Kitchen, Storage Rooms ( 1 ) Wood, Metal, Plaster, Gypsum Wallboard System	7,800 SF
<b>BUS LOOP</b>	
Covered waiting area ( 1 ) Wood, Metal, and Stucco	100 SF
<b>CLASSROOM P6 (803)</b>	
Classroom ( 1 ) Metal and Wood	960 SF
<b>CLASSROOMS 201-202 BUILDING (BUILDING 200)</b>	
Classrooms, Restrooms, Utility Rooms ( 1 ) Wood, Metal, Plaster, Gypsum Wallboard System	3,200 SF
<b>CLASSROOMS 301-306 BUILDING (BUILDING 300)</b>	
Classrooms, RSP Room, Storage Room, Restrooms ( 1 ) Wood, Metal, Plaster, Gypsum Wallboard System	10,400 SF
<b>CLASSROOMS 400-406 BUILDING (BUILDING 400)</b>	
Classrooms, Library, Storage Room, Restrooms ( 1 ) Wood, Metal, Plaster, Gypsum Wallboard System	10,400 SF
<b>CLASSROOMS 501-506 BUILDING (BUILDING 500)</b>	
Classrooms, Science and Computer Lab ( 1 ) Wood, Metal, Plaster, Gypsum Wallboard System	10,400 SF
<b>CLASSROOMS 801 PORTABLE BUILDING</b>	
Classroom ( 1 ) Wood and Metal	960 SF
<b>DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)</b>	
Classroom ( 1 ) Wood and Metal Portable	2,040 SF
<b>DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)</b>	
Classroom ( 1 ) Wood and Metal Portable	960 SF
<b>DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)</b>	
Classroom ( 1 ) Wood and Metal Portable	960 SF
<b>FAMILY RESOURCE CENTER (BUILDING 700)</b>	
Daycare, Pre-School ( 1 ) Wood, Metal, Preformed Material	1,440 SF
<b>METAL STORAGE CONTAINERS (3 EA)</b>	
Storage ( 1 ) Metal	480 SF

# LIST OF BUILDINGS AT

## NORTHWOOD ELEMENTARY SCHOOL

---

<b>BUILDING NAME</b>	<b>BUILDING AREA</b>
<b>BUILDING USED AS</b>	<b>(APPROXIMATE)</b>
<b>( #FLOORS ) CONSTRUCTION</b>	
<b>MIDDLE QUAD PATIO</b>	
Patio	1,600 SF
( 1 ) Metal, Concrete	
<b>PORTABLE NEXT TO P6</b>	
Classroom	900 SF
( 1 ) Metal and Wood	
<b>WOOD STORAGE SHEDS (2 EA)</b>	
Storage	170 SF
( 1 ) Wood	
<hr/>	
<b>Total Number Of Buildings : <u>16</u></b>	<b>(Approximate) Total Sq Ft. : <u>52,770</u></b>
<hr/>	
<b>End Of Report, Total Of 2 Pages</b>	

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

09/14/2005 BUILDING NOTES:

03/09/2007 Building Name changed from ADMINISTRATION AND MULTI-PURPOSE ROOM to ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100). No other changes as of this date.

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ALL OFFICES, AND HALLWAY TO STAGE

CARPET MASTIC

4,430 SF

09/15/2016 Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>16-213AAA</b>	<b>NEW</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	------------	------------------	---------------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ATTIC / PLENUM

PIPE FITTING INSULATION

(TBD) LF

09/14/2005	Pipe Fitting Insulation. material may exist in inaccessible locations. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC 116 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
08/25/2006	Book Storage Room added to Location. 30 LF added to quantity. Location Name changed from CUSTODIAL ROOM, AND PANTRY ROOM to BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM. Quantity changed from 86 LF to 116 LF to reflect this fact. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 LF Damage and Missing Baseboard in Book Storage Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 546 SF

08/29/2014	Fire Door Core Insulation. (2 EA Double-Doors + 24 EA Single-Doors). This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 24,500 SF

09/14/2005	Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damage: <5% Physical Damage - in exterior Water Heater Room; <10% Water Damage - in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.
------------	---

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/09/2007			
11/09/2007			
04/21/2008			
10/20/2008			
05/14/2009			
09/08/2009			
02/01/2010			
03/07/2014			
08/29/2014			
03/19/2015			
09/18/2015			
01/28/2016			
03/21/2016			
09/15/2016			
04/03/2017			
08/30/2017			
02/16/2018			
08/15/2018			
02/08/2019			
08/16/2019			

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

10-018 NW-69	ND	NONE DETECTED	( ND )
10-018 NW-69	2	CHRYSOTILE	( CH )
10-018 NW-70	ND	NONE DETECTED	( ND )
10-018 NW-73	ND	NONE DETECTED	( ND )
10-018 NW-73	2	CHRYSOTILE	( CH )
10-018 NW-74	ND	NONE DETECTED	( ND )
16-030-A07	ND	NONE DETECTED	( ND )
16-030-A13	ND	NONE DETECTED	( ND )
16-030-A13	ND	NONE DETECTED	( ND )
16-030-A08	5%	CHRYSOTILE	( CH )

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

08/25/2006 Skim Coat for Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damages noted in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.

03/09/2007 Damage: <10% Water Damage - approximately 20 SF in in Kitchen. Condition changed to reflect this fact. No other changes as of this date.

11/09/2007 This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.

10/20/2008 Exterior Water Heater Room has 3/4 of Ceiling is missing. <10% Water Damage. No other changes as of this date.

05/14/2009 Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.

09/08/2009 Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/01/2010	Samples 10-019 NW-68 and NW-72 collected on this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	Additional Damage observed. Pantry by Exhaust has minor cuts and holes. No other change as of this date.		
01/28/2016	Sample 16-030-A09 collected from Storage 121, Paint. Sample 16-030-A12 collected from MP Room by 122 Door, Skim Coat and Mud on Drywall.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

10-018 NW-68	2	CHRYSTILE	( CH )
10-018 NW-72	ND	NONE DETECTED	( ND )
16-030-A09	ND	NONE DETECTED	( ND )
16-030-A12	ND	NONE DETECTED	( ND )

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM

BASEBOARD MASTIC

1,420 LF

09/15/2016	Mastic/Adhesive for 4" and 6" Dark Gray Baseboard. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Damage Observed. <5% Physical Damage - in the form of 2 LF Loose Baseboard in Hallway near Nurse's Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL

17,180 SF

09/14/2005	Stucco Exterior Walls. This Material is in GOOD condition as of this date.
03/09/2007	Material changed from ' Stucco Walls. ' to ' Stucco Exterior Walls. ' No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/18/2015	This Material is unchanged as of this date.		
01/28/2016	Sample 16-030-A10 collected from Storage 121, Exterior Stucco. Sample 16-030-A14 collected from MP Room Exterior by Door 123, Stucco.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A10	2%	CHRYBOTILE	( CH )
16-030-A14	ND	NONE DETECTED	( ND )

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING

17,180 SF

09/14/2005	Stucco Walls. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' Stucco Walls. ' to ' Skim Coat for Stucco Exterior Walls. ' No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE 1,490 SF

10/20/2008	2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03./19/15.)
05/14/2009	Additional Material identified. Location changed from HALLWAY CONFERENCE ROOM, STAFF ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM. Quantity changed from 1,450 SF to 1,490 SF. 1 Tile is water damaged in the Data Equipment Room next to the air vent. Friability changed from Moderate to High. This Material is in FAIR condition as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/08/2009	Damage reassessed. There are now a total of 3 Tiles water damaged in Data Equipment Room next to air vent. Material remains in <10% water damage. No other changes as of this date.		
02/01/2010	Sample 10-019 NW-71 collected on this date.		
09/02/2010	Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM. Additional damage in the form of 1 Tile is missing in Data Equipment Room. Also, 1 Tile is water stained at Nurses' Room. Data Equipment Room has 1 Tile water damaged. No other changes as of this date.		
12/01/2011	Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM to HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY. Additional Damage - in the form of 1 Tile is Water stained in Lobby. Also, 2 Tiles are missing in Data Equipment Room. Material remains in <5% Physical Damage and <10% Water Damage. No other changes as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.		
09/18/2015	Damage Re-Assessed. Repairs made to Lobby and Nurse's Room. Damage Re-Assessed and is currently as follows for the following room: Date Equipment Room has 3 Tiles Physically Damaged and 1 Water Damaged. Additional Damage observed, Staff Room has 3 Tiles Physically Damaged. No other change as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	Additional Damage Observed. Data Room now has 2 Tile with Physical Damage, 1 Tile is Missing and 1 has Water Damage. No other changes as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 2 Ceiling Tiles with Water Stains in the Data Equipment Room. Staff Room has 2 SF of Water Stains on various Ceiling Tiles and 1 Broken Tile. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>08-241AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>10-018 NW-71</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN

#### VINYL SHEETING

572 SF

09/14/2005	Green Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A04 collected from Kitchen 122, Green Vinyl Sheeting.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A04</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

572 SF

09/14/2005	Backing Paper/Adhesive for Green Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.
10/11/2012	Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A05 collected from Kitchen 122, Backing Paper for Green Vinyl Sheeting.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A05	ND	NONE DETECTED	( ND )

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

60 SF

09/14/2005 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.

10/11/2012 Damage: <5% Physical Damage - in the form of 1 Tile is missing, 3 Tiles are broken, and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.

03/07/2014 2 additional Tiles are broken and Mastic/Adhesive is exposed. No other changes as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN PANTRY CLOSET

#### VINYL FLOOR TILE MASTIC

60 SF

09/14/2005	Mastic/Adhesive for 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	6 Tiles are broken and Mastic/Adhesive is exposed. This Material is in FAIR condition. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE 2,530 SF

10/20/2008	2'x2' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. 10 Tiles have Water Stains. This Material is in FAIR condition as of this date. (Original Entry updated 03/19/15.)
09/08/2009	Material remains in <10% Water Damage. Also, <5% Physical Damage in the form of 1 broken Tile. No other changes as of this date.
04/05/2013	Damage Re-Assessed. Only 1 Tile is Water stained. Material remains in FAIR condition. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Damage is currently as follows for the following room: Multipurpose Room has 4 Tiles Water Damaged and 1 Tile Physically Damaged. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Multi-Purpose Room has 8 Tiles with Damage in the form of stains. No other changes as of this date.
04/03/2017	Additional Damage Observed. Multi-Purpose Room now has 12 Tiles with Water Damage. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

<b>08-241AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE

4,200 SF

09/15/2016	12"x12" Light Grey Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

<b>16-213AAA</b>	<b>NEW</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	------------	------------------	---------------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>		<b>LOCATION</b>		<b>MATERIAL TYPE</b>		<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>							

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE MASTIC 4,200 SF

09/15/2016	Mastic/Adhesive for 12"x12" Light Grey Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER 18,680 SF

09/14/2005	4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	Damage Observed. <5% Physical Damage - in the form of Several areas have Scrapes in the Material. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.		
09/01/2020	Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC

18,680 SF

09/14/2005	Mastic/Adhesive for Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	Damage Observed. <5% Physical Damage - in the form of Several areas have Scrapes in the Material. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.		
09/01/2020	Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### PTA ROOM

#### VINYL FLOOR TILE

144 SF

09/14/2005	12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

09/14/2005	Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

640 SF

12/01/2011	Grout/Mortar for 4"x4" Red, Green, and Brown Ceramic Wall Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)		
03/07/2014	Tiles are White, Red, Green, and Brown. Original entry updated. No other changes as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

270 SF

12/01/2011	Grout/Mortar for 8"x8" Green, Red, and Pink Ceramic Floor Tiles This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)
03/07/2014	Material Re-Assessed. Tiles are 8" x 8" and are Green, Red, and Pink. Material Description changed from 'Grout/Mortar for 1"x1" Multicolor Ceramic Floor Tiles' to 'Grout/Mortar for 8"x8" Green, Red, and Pink Ceramic Floor Tiles.' Original entry updated. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

11-202AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

8 SF

10/20/2008 Grey Thermal Undercoating on Sink. (2 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)

09/02/2010 Undercoating is Grey. Original entry updated. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>			
<b>LOCATION</b>			
<b>MATERIAL TYPE</b>			<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>			

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

WOMENS RESTROOM

MORTAR MISCELLANEOUS

120 SF

09/18/2015	Grout/Mortar for 9" Pink Ceramic Tile. This Material is in GOOD condition as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

15-174AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**BUS LOOP**

**BUS LOOP**

09/15/2016 BUILDING NOTES:

09/15/2016 Building Name changed from CARPORT / WAITING AREA to BUS LOOP.

**BUS LOOP**

EXTERIOR WALL

PAPER TYPE INSULATION

800 SF

09/08/2009	Paper Material under Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to Damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### BUS LOOP

EXTERIOR WALL

ROUGH WALL

800 SF

09/08/2009 Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-212AAA	ASSUMED	NO SAMPLE	( NS )

**BUS LOOP**

EXTERIOR WALL

ROUGH WALL SURFACING

800 SF

09/08/2009	Skim Coat for Stucco on Exterior Walls and Overhangs. Damage: <5% Physical Damage due to damaged sections on lower portion of material on various locations. This Material is in FAIR condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOM P6 (803)**

**CLASSROOM P6 (803)**

02/08/2019 BUILDING NOTES:  
 02/08/2019 Building Not currently in use.  
 American Modular System  
 DSA# 01-07065  
 Serial# 05-107-001 A, B, C  
 Date MFG 05-05

**CLASSROOM P6 (803)**

CLASSROOM 6(803)

PERMANENT BUILDING

960 SF

02/08/2019 Classroom P6. Building in GOOD condition as of this date.  
 08/16/2019 This Material is unchanged as of this date.  
 01/31/2020 This Material is unchanged as of this date.  
 09/01/2020 This Material is unchanged as of this date.  
 02/12/2021 This Material is unchanged as of this date.  
 08/13/2021 This Material is unchanged as of this date.  
 02/23/2022 This Material is unchanged as of this date.

19-011AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

03/06/2017 BUILDING NOTES:

03/09/2007 Building Name changed from CLASSROOMS 201 AND 202 to CLASSROOMS 201-202 BUILDING (BUILDING 200).

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

ALL ROOMS AND CLOSETS

BASEBOARD MASTIC

90 SF

09/15/2016 Mastic/Adhesive for 4" and 6" Black Baseboard. New Material installed during Summer of 2016 Flooring project. This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>16-213AAA</b>	<b>NEW</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	------------	------------------	---------------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

CARPET MASTIC

1,500 SF

09/15/2016	Mastic/Adhesive for Gray/Black Carpet. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

SUSPENDED CEILING TILE

2,600 SF

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	3 Tiles are Water Stained in Classroom 202. No other changes as of this date.
09/08/2009	Material remains in <10% Water Damage and in FAIR condition. This Material is unchanged as of this date.
02/01/2010	Sample 10-019 NW-61 collected on this date.
03/11/2010	Additional Damage observed in Classroom 201 has 1 Tile Water Damaged. No other changes as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

COMMENTS

QTY (APPROXIMATE)

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE	
09/02/2010				Additional Damage observed in the form of Classroom 202 now had a total of 6 Tiles Water stained. Also, Classroom 201 has an additional 5 Tiles Water Damaged. No other changes as of this date.
12/01/2011				Damages Re-Assessed. Classroom 201, 4 Tiles have been replaced, and 1 remains Water Damaged. Classroom 202 now has a total of 5 Tiles Water stained - 1 has been repaired. No other changes as of this date.
10/11/2012				Material condition Re-Assessed. 4 Water stained Tiles in Classroom 202 have been repaired. Material remains in FAIR condition. No other changes as of this date.
03/07/2014				This Material is unchanged as of this date.
08/29/2014				This Material is unchanged as of this date.
03/19/2015				Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015				This Material is unchanged as of this date.
03/21/2016				This Material is unchanged as of this date.
09/15/2016				Additional Damage observed. Room 202 now has 2 Tiles with Water stains. No other changes as of this date.
04/03/2017				Additional Damage Observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in Classroom 201. No other changes as of this date.
08/30/2017				Additional Damage Observed. Room 202 has 2 Tiles with Physical Damage in the form of Cracked and Chipped corners. No other changes as of this date.
02/16/2018				Additional Damage Observed. Room 202 now has 5 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201, 4 other Tiles have Water Stains. No other changes as of this date.
08/15/2018				Additional Damage Observed. Room 202 now has 6 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201 4 Tiles Replaced 2 Tiles have Water Stains. No other changes as of this date.
02/08/2019				This Material is unchanged as of this date.
08/16/2019				This Material is unchanged as of this date.
01/31/2020				This Material is unchanged as of this date.
09/01/2020				This Material is unchanged as of this date.
02/12/2021				This Material is unchanged as of this date.
08/13/2021				This Material is unchanged as of this date.
02/23/2022				This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
05-212AAA	ASSUMED	NO SAMPLE	( NS )
10-018 NW-61	ND	NONE DETECTED	( ND )

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER

1,600 SF

08/25/2006	4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
09/26/2013	Friability changed from Low to Non. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC

1,600 SF

08/25/2006	Mastic/Adhesive for 4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS 2,600 SF

09/14/2005	Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
03/09/2007	Material changed from Gypsum Wallboard System. ' to ' GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.
05/14/2009	2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. No other changes as of this date.
09/08/2009	Material remains in <5% physical damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-63 (Joint Tape / Compound), NW-64 (Drywall), NW-66 (Joint Tape / Compound), and NW-67 (Drywall) collected on this date.
09/26/2013	Material Re-Assessed. Friability changed from Moderate to Low. Material changed from GOOD to FAIR condition. No other changes as of this date.
03/07/2014	Friability changed from Low to Moderate. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. Exterior Storage Rooms have minor holes and cuts. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

10-018 NW-63	ND	NONE DETECTED	( ND )
10-018 NW-63	ND	NONE DETECTED	( ND )
10-018 NW-64	ND	NONE DETECTED	( ND )
10-018 NW-66	ND	NONE DETECTED	( ND )
10-018 NW-66	2	CHRYSTOLE	( CH )
10-018 NW-67	ND	NONE DETECTED	( ND )

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

2,600 SF

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.		
03/09/2007	Material Description changed from ' Skim Coat for Gypsum Wallboard System. ' to ' Skim Coat for GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.		
05/14/2009	2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Friability changed from Low to Moderate. No other changes as of this date.		
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.		
02/01/2010	Samples 10-019 NW-62 and NW-65 collected on this date.		
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	Additional Damage observed, Exterior Storage Rooms have minor holes and cuts. No other change as of this date.		

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>10-018 NW-62</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>
			<b>( CH )</b>

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE

1,500 SF

09/15/2016	12"x12" Light Grey Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>16-203AAA</b>	<b>NEW</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	------------	------------------	---------------

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE MASTIC

1,500 SF

09/15/2016 Mastic/Adhesive for 12"x12" Light Grey Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>16-203AAA</b>	<b>NEW</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	------------	------------------	---------------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201-202

SINK UNDERCOATING

8 SF

10/20/2008	Grey Thermal Undercoating on Sink. (2 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)		
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)		
09/02/2010	Undercoating is Grey. Original entry updated. No other changes as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC

80 LF

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

210 SF

08/29/2014	Fire Door Core Insulation. (1 EA Double-Doors + 9 EA Single-Doors). This Material is in GOOD condition as of this date.				
03/19/2015	This Material is unchanged as of this date.				
09/18/2015	This Material is unchanged as of this date.				
03/21/2016	This Material is unchanged as of this date.				
09/15/2016	This Material is unchanged as of this date.				
04/03/2017	This Material is unchanged as of this date.				
08/30/2017	This Material is unchanged as of this date.				
02/16/2018	This Material is unchanged as of this date.				
08/15/2018	This Material is unchanged as of this date.				
02/08/2019	This Material is unchanged as of this date.				
08/16/2019	This Material is unchanged as of this date.				
01/31/2020	This Material is unchanged as of this date.				
09/01/2020	This Material is unchanged as of this date.				
02/12/2021	This Material is unchanged as of this date.				
08/13/2021	This Material is unchanged as of this date.				
02/23/2022	This Material is unchanged as of this date.				

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

EXTERIOR WALLS

ROUGH WALL

3,200 SF

09/14/2005	Stucco Walls. This Material is in GOOD condition as of this date.				
03/09/2007	Material Description changed from ' STUCCO WALLS. ' to ' Stucco Exterior Walls. ' No other changes as of this date.				

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
01/28/2016	Sample 16-030-A18 collected from Exterior Wall by Drinking Fountain, Stucco.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A18</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

#### EXTERIOR WALLS

##### ROUGH WALL SURFACING

3,200 SF

09/14/2005	Skim Coat for Stucco on Walls. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' Skim Coat STUCCO WALLS. ' to ' Skim Coat for Stucco Exterior Walls. ' This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

**EXTERIOR WINDOWS**

**CAULKING**

200 LF

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing degradation of heat and moisture factors and missing portion of material in various locations. This Material is in FAIR condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>09-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

#### RESTROOMS

#### MORTAR MISCELLANEOUS

200 SF

05/14/2009	Grout/Mortar for 8"x8" Green Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)
09/02/2010	Material Description changed from ' Grout/Mortar for 4"x4" Ceramic Wall Tiles. ' to ' Grout/Mortar for 8"x8" Green Ceramic Floor Tiles. ' Quantity changed from 180 SF to 200 SF. Original entry updated. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/18/2015			
01/28/2016			
03/21/2016			
09/15/2016			
04/03/2017			
08/30/2017			
02/16/2018			
08/15/2018			
02/08/2019			
08/16/2019			
01/31/2020			
09/01/2020			
02/12/2021			
08/13/2021			
02/23/2022			

09-098AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A22	ND	NONE DETECTED	( ND )

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

MORTAR MISCELLANEOUS

560 SF

10/20/2008	Grout/Mortar for 4"x4" Multi-Colored Ceramic Wall Tiles. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
05/14/2009	This Material is unchanged as of this date. (Apparent New Material identified by the AHERA accredited Inspector.)
12/01/2011	Location Description changed from RESTROOMS to RESTROOMS, AND ENTRY WAY TO CLASSROOMS. Quantity changed from 180 SF to 252 SF. No other changes as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/07/2014	Loaction changed from RESTROOMS, AND ENTRY WAY TO CLASSROOMS to RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM. Quantity changed from 252 SF to 560 SF. No other changes as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	Material Description changed from 4"x4" Multi-Colored Ceramic Wall Tiles to Grout/Mortar for 4"x4" Multi-Colored Ceramic Wall Tiles. Original Entry updated. Material type changed from Wall Tile to Mortar Miscellaneous. No other changes as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>08-241AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

#### STUDENT RESTROOMS

#### MORTAR MISCELLANEOUS

300 SF

09/18/2015	Grout/Mortar for 9" Pink Ceramic Tile. This Material is in GOOD condition as of this date.
03/21/2016	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>15-174AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

09/14/2005	BUILDING NOTES:
03/09/2007	Building Name changed from CLASSROOMS 301-306 to CLASSROOMS 301-306 BUILDING (BUILDING 300).
09/15/2016	Major Remodel during the Summer of 2016 per information received from the BUESD. REP Classrooms changed to Flexible Instructional Space (F.I.S.)

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

#### ALL CLASSROOMS AND F.I.S. ROOM

#### VINYL WALL COVER

29,000 SF

09/14/2005	4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A36 collected from Room 303 Demising Wall, Vinyl Cover on Sheetrock Wall.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Location Description changed and some Material Removed during the Summer 2016 Renovation Project. Location Description changed from ALL CLASSROOMS AND RSP ROOM to ALL CLASSROOMS AND F.I.S. ROOM. Wall Removed in Classrooms 307 and 308. Material only in Classrooms 301-306. Material Quantity changed from 30,500 SF to 29,000 SF. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>		<b>LOCATION</b>		<b>MATERIAL TYPE</b>		<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>							

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A36</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC

29,000 SF

09/14/2005	Mastic/Adhesive for 4'x8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Location Description changed and some Material Removed during the Summer 2016 Renovation Project. Location Description changed from ALL CLASSROOMS AND RSP ROOM to ALL CLASSROOMS AND F.I.S. ROOM. Wall Removed in Classrooms 307 and 308. Material only in Classrooms 301-306. Material Quantity changed from 30,500 SF to 29,000 SF. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

10/20/2008	Grout/Mortar for 4"x4" Multi-Colored Wall Tiles. This Material is in GOOD condition as of this date.
03/07/2014	Quantity changed from 720 SF to 350 SF. Tiles are White, Green, and Brown. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>		<b>LOCATION</b>		<b>MATERIAL TYPE</b>		<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>							

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

SUSPENDED CEILING TILE 9,400 SF

- 09/14/2005 2'x4' Suspended Ceiling Tile . Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
- 10/20/2008 Classroom 305 has 3 Tiles Water Stained. RSP Room still has water stains. No other changes as of this date.
- 05/14/2009 Additional Damage observed. 2 Tiles are Water Damaged in the Storage Room of Classrooms 303 and 304 as of this date.
- 09/08/2009 Damage Re-Assessed. Additional Damage observed in the form of 2 Tiles are water stained in Classroom 307, and RSP Room has 2 Tiles Water stained. Damage remains in <10% Water Damage. No other changes as of this date.
- 02/01/2010 Samples 10-019 NW-75 collected on this date.
- 03/11/2010 Additional Damage observed in the form of Classroom 303 has 2 Tiles Water Damaged. Friability changed from Moderate to High to reflect this change.
- 09/02/2010 Additional Damage in the form of Classroom 302 has 1 Tile broken and 1 Tile Water stained. Classroom 305 has 2 additional Tiles Water stained. Damages repaired in Storage Room of Classrooms 303 and 304. No other changes as of this date.
- 12/01/2011 Additional Damage - in the form of Classroom 302 has 1 additional Tile water damaged. No other changes as of this date.
- 04/05/2013 Material Condition Re-Assessed. Damaged Tiles have been Removed and Replaced with new Tiles in Classrooms 302, 303 and 304. Room 305 still remains Damaged with 2 Water Damaged Tiles. Material remains in FAIR condition. Friability changed from High to Moderate. No other changes as of this date.
- 03/07/2014 Friability changed from Moderate to High. No other changes as of this date.
- 08/29/2014 This Material is unchanged as of this date.
- 03/19/2015 Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.
- 09/18/2015 Damage Re-Assessed. Repairs made to Room 305 and RSP Room. Classroom 307 has 1 Tile Physically Damaged. Additional Damages observed, Storage Room between Rooms 303 and 304 has 1 Tile Physically Damaged and Storage Room between Rooms 301 and 302 has 2 Tiles Physically Damaged. No other changes as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/28/2016		Sample 16-030-A26 collected from Workroom 304, 2'x4' Suspended Ceiling Tile.	
03/21/2016		This Material is unchanged as of this date.	
09/15/2016		Location Description changed. Location Description changed from RSP ROOM, CLASSROOMS 301-306 AND FOUR STORAGE ROOMS to CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS. No other changes as of this date.	
04/03/2017		Additional Damage Observed. 2 Tiles have Water Damage in Classroom 304. No other changes as of this date.	
08/30/2017		This Material is unchanged as of this date.	
02/16/2018		Additional Damage Observed. 2 Broken Tiles in Classroom 306. Partial Repairs made to Tiles in Classroom 304. Remains in FAIR condition. No other changes as of this date.	
08/15/2018		This Material is unchanged as of this date.	
02/08/2019		This Material is unchanged as of this date.	
08/16/2019		This Material is unchanged as of this date.	
01/31/2020		This Material is unchanged as of this date.	
09/01/2020		Additional Damage Observed. 3 Tiles Broken in Work Room Between Classrooms 303 and 304. 5 Cracked Tiles in Classroom 305. 4 Tiles with Water Stains in Classroom 306. No other changes as of this date.	
02/12/2021		Additional Damage Observed. <5% Physical Damage in th form of 1 Tile with Water Stains and 1 Tile with Cracks in Work Room of Classrooms 305 and 306. Material remains in FAIR condition overall. No other changes as of this date.	
08/13/2021		This Material is unchanged as of this date.	
02/23/2022		This Material is unchanged as of this date.	

05-212AAA	ASSUMED	NO SAMPLE	( NS )
10-018 NW-75	ND	NONE DETECTED	( ND )
16-030-A26	ND	NONE DETECTED	( ND )

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS

BASEBOARD MASTIC

1,400 LF

09/15/2016	Mastic/Adhesive for 4" and 6" Light Gray and Dark Gray Baseboard. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

<b>16-203AAA</b>	<b>NEW</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	------------	------------------	---------------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, HALLWAY, AND F.I.S.

CARPET MASTIC

7,684 SF

09/15/2016	Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>						
<b>LOCATION</b>						
<b>MATERIAL TYPE</b>						<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>						

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS 700 SF

09/02/2010 Grout/Mortar for 8"x8" Green Ceramic Wall Tiles. This Material is in GOOD condition as of this date.

12/01/2011 Location Description changed from CLASSROOMS 301-306, AND RESTROOMS (2) to CLASSROOMS 301-308, AND RESTROOMS (2). Wall Tiles are Green, Red and Pink. No other changes as of this date.

03/07/2014 These are 8"x8" Green Ceramic Floor Tiles. No other changes as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

01/28/2016 Sample 16-030-A25 collected from Room 310, Grout for 8"x8" Ceramic Floor Tile.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A25	ND	NONE DETECTED	( ND )

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

70 SF

08/29/2014 Exterior A/C Cementitious Window Panel. Replacement on Lower and Upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

672 SF

08/29/2014	Fire Door Core Insulation. (2 EA Double-Doors + 30 EA Single-Doors). This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

37,800 SF

09/14/2005	Gypsum Wallboard system, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
02/01/2010	Samples 10-019 NW-77 (Joint Tape / Compound), and NW-78 (Drywall) collected on this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**COMMENTS**

**QTY (APPROXIMATE)**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.		
01/28/2016	Sample 16-030-A31 collected from Workroom 304, Wallboard. Sample 16-030-A32 collected from Workroom 304, Joint Compound. Sample 16-030-A35 collected from Room 303, Demising Wall, Sheetrock Wall.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

05-212AAA	ASSUMED	NO SAMPLE	( NS )
10-018 NW-77	ND	NONE DETECTED	( ND )
10-018 NW-77	ND	NONE DETECTED	( ND )
10-018 NW-78	ND	NONE DETECTED	( ND )
16-030-A31	ND	NONE DETECTED	( ND )

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-030-A32	ND	NONE DETECTED	( ND )
16-030-A35	ND	NONE DETECTED	( ND )

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING 37,800 SF

- 08/25/2006 Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
- 02/01/2010 Sample 10-019 NW-76 collected on this date.
- 12/01/2011 Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
- 03/07/2014 This Material is unchanged as of this date.
- 08/29/2014 This Material is unchanged as of this date.
- 03/19/2015 This Material is unchanged as of this date.
- 09/18/2015 Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.
- 03/21/2016 This Material is unchanged as of this date.
- 09/15/2016 Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.
- 04/03/2017 This Material is unchanged as of this date.
- 08/30/2017 This Material is unchanged as of this date.
- 02/16/2018 This Material is unchanged as of this date.
- 08/15/2018 This Material is unchanged as of this date.
- 02/08/2019 This Material is unchanged as of this date.
- 08/16/2019 This Material is unchanged as of this date.
- 01/31/2020 This Material is unchanged as of this date.
- 09/01/2020 This Material is unchanged as of this date.
- 02/12/2021 This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	( NS )
10-018 NW-76	ND	NONE DETECTED	( ND )

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

#### EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005 Stucco Exterior Walls and Restroom Overhangs. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG ON RESTROOMS.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

01/28/2016 Sample 16-030-A33 collected from Exterior by Drinking Fountain, Stucco Wall.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A33	ND	NONE DETECTED	( ND )

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005	Skim Coat for Stucco on Exterior Walls and Restroom Overhangs. This Material is in GOOD condition as of this date.
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG ON RESTROOMS.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

#### EXTERIOR WINDOWS AND DOORS

##### CAULKING

900 LF

- 09/08/2009 Caulking on Exterior Windows and Doors. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
- 03/07/2014 This Material is unchanged as of this date.
- 08/29/2014 This Material is unchanged as of this date.
- 03/19/2015 This Material is unchanged as of this date.
- 09/18/2015 This Material is unchanged as of this date.
- 01/28/2016 Sample 16-030-A34 collected from Exterior Door by 304, Interior side, Door Frame Caulking.
- 03/21/2016 This Material is unchanged as of this date.
- 09/15/2016 This Material is unchanged as of this date.
- 04/03/2017 This Material is unchanged as of this date.
- 08/30/2017 This Material is unchanged as of this date.
- 02/16/2018 This Material is unchanged as of this date.
- 08/15/2018 This Material is unchanged as of this date.
- 02/08/2019 This Material is unchanged as of this date.
- 08/16/2019 This Material is unchanged as of this date.
- 01/31/2020 This Material is unchanged as of this date.
- 09/01/2020 This Material is unchanged as of this date.
- 02/12/2021 This Material is unchanged as of this date.
- 08/13/2021 This Material is unchanged as of this date.
- 02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09-212AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A34	ND	NONE DETECTED	( ND )

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE

756 SF

09/15/2016	12"x12" Light Gray (676 SF) and Blue (80 SF) Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE MASTIC

756 SF

09/15/2016	Mastic/Adhesive for 12"x12" Light Gray (676 SF) and Blue (80 SF) Vinyl Floor Tiles. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

28 SF

10/20/2008	Grey Thermal Undercoating on Sink. (7 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)
09/02/2010	Undercoating is Grey. Original entry updated. No other changes as of this date.
12/01/2011	Location Description changed from CLASSROOMS 301-306 to TEACHERS' WORK ROOM, AND CLASSROOMS 301-308. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A30 collected from Workroom 304, Gray Thermal Undercoating on Sink.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>08-241AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A30</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE

1,560 SF

09/14/2005	12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.
09/02/2010	Location Description changed from ALL CLASSROOMS, RSP ROOM AND STORAGE ROOMS to TEACHER WORK ROOM, STORAGE, AND RESTROOM. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A27 collected from Workroom 304, Green 12"x12" Vinyl Floor Tile.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A27	ND	NONE DETECTED	( ND )

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE MASTIC

1,560 SF

09/14/2005	Mastic/Adhesive for 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.
12/01/2011	Location Description changed from ALL CLASSROOMS, RSP ROOM AND STORAGE ROOMS to TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A28 collected from Workroom 304, Yellow Mastic for Green 12"x12" Vinyl Floor Tile.
03/21/2016	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A28</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

WATER HEATER ROOM (NEXT TO RESTROOMS)

BASEBOARD MASTIC

15 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

03/06/2017	BUILDING NOTES:		
03/09/2007	Building Name changed from CLASSROOMS 401-406 to CLASSROOMS 401-406 BUILDING (BUILDING 400). No other changes as of this date.		
10/20/2008	Building Name changed from CLASSROOMS 401-406 BUILDING (BUILDING 400) to CLASSROOMS 400-406 BUILDING (BUILDING 400).		

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ALL CLASSROOMS

CARPET MASTIC

7,600 SF

09/15/2016	Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS, AND LIBRARY

SUSPENDED CEILING TILE 8,400 SF

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 402 has 4 Tiles Water Stained. Classroom 403 has 2 Tiles Water Stained. Classroom 406 has 2 Tiles Water Stained. No other changes as of this date.
05/14/2009	Tiles have been Repaired in Classroom 403. No other changes as of this date.
09/08/2009	Repairs have been made in Classroom 402 and Tiles have been replaced. Material remains in <10% Water Damage and in FAIR condition. No other changes as of this date.
02/01/2010	Sample 10-019 NW-57 collected on this date.
03/11/2010	Material Re-Assessed. Water Damage is located in Classrooms 403 and 406. No other changes as of this date.
09/02/2010	Additional Damage in the form of Library has 4 Tiles Water stained. 1 Tile has been replaced in Classroom 402. Classroom 404 has 1 Tile Water Damaged. 2 Tiles are still Water Damaged in Classroom 406. No other changes as of this date.
12/01/2011	Additional Damage - in the form of Library has 3 more Tiles Water Damaged, Classroom 408 has 2 Tiles Water Damaged, and Classroom 403 has 1 Tile Water Damaged. No other changes as of this date.
04/05/2013	Material condition Re-Assessed. Damaged Tiles have been repaired in Library. Material remains in FAIR condition overall. No other changes as of this date.
09/26/2013	This Material is unchanged as of this date.
03/07/2014	1 Tile is Water Damaged in the Library. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Damages are currently as follows: Classroom 406 has 3 Tiles Water Damaged and Library has 2 Tiles Physically Damaged. Previous Damage noted in Classroom 408 is incorrectly entered and is non-existent. Additional Damages observed; Storage Closet between Rooms 401 and 402 has 1 Tile Physically Damaged and Classroom 401 has 3 Water Damaged Tiles. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Damages clarified. Damages are as follows: 401 has 1 Tile with Water Damage, 402 has 4 Tiles with Water Damage, Workroom for 403 and 404 has 3 Tiles with Water Damage, 404 has 1 Tile with Water Damage, 405 has 3 Tiles with Water Damage, Workroom for 406 has 2 Tiles with Water Damage, and 406 has 4 Tile with Water Damage. No other changes as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
04/03/2017	Additional Damage Observed. 2 Tiles with Water Damage in Classroom 404. No other changes as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	Additional Damage Observed. Classroom 402 now has 6 Tiles with Water Damage on them. No other changes as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>10-018 NW-57</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### ALL ROOMS

#### BASEBOARD MASTIC

1,400 LF

09/15/2016	Mastic/Adhesive for 4" and 6" Dark Gray Baseboard. Installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**COMMENTS**

**QTY (APPROXIMATE)**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

BOYS AND GIRLS RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

350 SF

03/07/2014	Grout/Mortar for 4"x4" White, Green, and Brown Ceramic Wall Tiles. This Material is in GOOD condition as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

14-051AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

CLASSROOMS, AND LIBRARY

VINYL WALL COVER

29,880 SF

09/14/2005	4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A39 collected from Library (403), Vinyl Cover on Pressed Wood Wall Panel.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	Material Re-assessed. Damage in Classroom 401 is not Observed, possibly covered up. Remains in FAIR condition. No other changes as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

16-030-A39	ND	NONE DETECTED	( ND )
------------	----	---------------	--------

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
10-030-433	ND	NONE DETECTED	( NS )

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

09/14/2005	MASTIC/Adhesive FOR VINYL COVERING ON 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

50 SF

08/29/2014	Exterior A/C Cementitious Window Panel. Replacement on Lower and Upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

14-18AAA	ASSUMED	NO SAMPLE	( NS )
----------	---------	-----------	--------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

399 SF

08/29/2014	Fire Door Core Insulation. (3 EA Double-Doors + 16 EA Single-Doors). This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>14-198AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 38,100 SF

09/14/2005	GYPSON WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Material Description changed from ' GYPSON WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.
04/21/2008	50 SF is Damaged above the Double Entry Doors and 2 SF of debris on Floor. Missing Material with broken edges in the center of the ceiling as of this date.
09/08/2009	Previously mentioned 50 SF of Damage is located in PE Storage Room. No other changes as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/01/2010		Samples 10-019 NW-59 (Joint Tape / Compound), and NW-60 (Drywall) collected on this date.	
09/26/2013		This Material is unchanged as of this date.	
03/07/2014		This Material is unchanged as of this date.	
08/29/2014		This Material is unchanged as of this date.	
03/19/2015		This Material is unchanged as of this date.	
09/18/2015		Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other changes as of this date.	
03/21/2016		This Material is unchanged as of this date.	
09/15/2016		This Material is unchanged as of this date.	
04/03/2017		This Material is unchanged as of this date.	
08/30/2017		This Material is unchanged as of this date.	
02/16/2018		This Material is unchanged as of this date.	
08/15/2018		This Material is unchanged as of this date.	
02/08/2019		This Material is unchanged as of this date.	
08/16/2019		This Material is unchanged as of this date.	
01/31/2020		This Material is unchanged as of this date.	
09/01/2020		Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.	
02/12/2021		This Material is unchanged as of this date.	
08/13/2021		This Material is unchanged as of this date.	
02/23/2022		This Material is unchanged as of this date.	

05-212AAA	ASSUMED	NO SAMPLE	( NS )
10-018 NW-59	ND	NONE DETECTED	( ND )
10-018 NW-59	ND	NONE DETECTED	( ND )
10-018 NW-60	ND	NONE DETECTED	( ND )

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

ENTIRE BUILDING

SMOOTH WALL SURFACING

38,100 SF

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist under 4'X8' Vinyl Covered Wall Pnaels. Damage: <5% Physical Damage - in PE storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.
09/26/2013	This Material is unchanged as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other change as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

06-223AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

##### ROUGH WALL

7,200 SF

- 09/14/2005 Stucco Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.
- 03/09/2007 Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG OF RESTROOMS. Material Description changed from ' STUCCO oN EXTERIOR WALLS aND RESTROOMS OVERHANG. ' to ' Stucco Exterior Walls and Overhang. ' No other changes as of this date.
- 05/14/2009 This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.
- 09/08/2009 Material remains in <5% Physical Damage. This Material is unchanged as of this date.
- 09/26/2013 Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.
- 03/07/2014 This Material is unchanged as of this date.
- 08/29/2014 This Material is unchanged as of this date.
- 03/19/2015 This Material is unchanged as of this date.
- 09/18/2015 This Material is unchanged as of this date.
- 03/21/2016 This Material is unchanged as of this date.
- 09/15/2016 This Material is unchanged as of this date.
- 04/03/2017 This Material is unchanged as of this date.
- 08/30/2017 This Material is unchanged as of this date.
- 02/16/2018 This Material is unchanged as of this date.
- 08/15/2018 This Material is unchanged as of this date.
- 02/08/2019 This Material is unchanged as of this date.
- 08/16/2019 This Material is unchanged as of this date.
- 01/31/2020 This Material is unchanged as of this date.
- 09/01/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

##### ROUGH WALL SURFACING

7,200 SF

09/14/2005	Skim Coat for Stucco on Exterior Walls and Restrooms Overhang. This Material is in GOOD condition as of this date.
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG OF RESTROOMS. Material Description changed from ' Skim Coat for STUCCO oN EXTERIOR WALLS aND RESTROOMS OVERHANG. ' to ' Skim Coat for Stucco Exterior Walls and Overhang. ' No other changes as of this date.
05/14/2009	This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### EXTERIOR WINDOWS

##### CAULKING

900 LF

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>09-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

700 SF

09/02/2010	Grout/Mortar for 8"x8" Green, Pink and Red Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)
03/07/2014	Tiles are Floor Tiles. Original entry updated. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A37 collected from Library (403), Grout for 8"x8" Ceramic Floor Tile.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

10-174AAA	ASSUMED	NO SAMPLE	( NS )
16-030-A37	ND	NONE DETECTED	( ND )

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

10/20/2008 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 Damage observed. Damage: <5% Physical Damage - in the form of loose Baseboard in 2 locations exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### LIBRARY STORAGE

#### VINYL FLOOR TILE

144 SF

10/20/2008	9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
09/02/2010	Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.
04/05/2013	Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
09/26/2013	This Material is unchanged as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.
04/03/2017	Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.
08/30/2017	Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

10/20/2008 Mastic/Adhesive for 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.

09/02/2010 Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.

04/05/2013 Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other change as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.

04/03/2017 Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.

08/30/2017 Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>08-241AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

24 SF

10/20/2008 Grey Thermal Undercoating on Sink. (6 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)

09/02/2010 Undercoating is Grey. Original entry updated. No other changes of this date.

12/01/2011 Location Description changed from CLASSROOM 400-406 AND LIBRARY to TEACHERS' WORK ROOM, AND LIBRARY. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE 2,200 SF

09/14/2005	12"X12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.
12/01/2011	Location Description changed from ALL CLASSROOMS SINK AREAS, AND TWO STORAGE ROOMS to TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE MASTIC

2,200 SF

09/14/2005	Mastic/Adhesive for 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this status. No other changes as of this date.
09/02/2010	Location Description changed from ALL CLASSROOMS SINK AREAS, AND TWO STORAGE ROOMS to ALL CLASSROOMS SINK AREAS, TWO STORAGE ROOMS, AND RESTROOM. No other changes as of this date.
12/01/2011	Location Description changed from ALL CLASSROOMS SINK AREAS, AND TWO STORAGE ROOMS to TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

40 LF

09/14/2005	Mastic/Adhesive fir 4" Brown Baseboard. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
05-212AAA	ASSUMED	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

03/06/2017 BUILDING NOTES:

03/09/2007 Building Name changed from CLASSROOMS 501-506 to CLASSROOMS 501-506 BUILDING (BUILDING 500). No other changes as of this date.

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS

BASEBOARD MASTIC

1,400 LF

09/15/2016 Mastic/Adhesive for 4" and 6" Dark Gray Baseboard. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

BOYS AND GIRLS RESTROOM

MORTAR MISCELLANEOUS

120 SF

04/03/2017 Grout/Mortar for 4"x6" Black Base Ceramic Wall Tiles. Damage Observed. <5% Physical Damage - in the form of 1 Tile is Missing, Mastic Exposed in Boy's Restroom. 1 Tile is Loose and 1 Tile is Cracked in Girl's Restroom. Material condition is FAIR. Friability is Low. No other changes as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>17-059AAA</b>	<b>ND</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

**BOYS AND GIRLS RESTROOMS**

**MORTAR MISCELLANEOUS** 600 SF

10/20/2008	Grout/Mortar for 4"x4" White Wall Tiles. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 Tile Missing Masitic Exposed in Boys Restroom. 1 Tile is Loose from the grout and 1 Tile is cracked in Girls Restroom. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/30/2017	Additional Damage Observed. In Girls Restroom 2 Tiles detached and lying on the floor Mastic Exposed.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

416 SF

10/20/2008 Grout/Mortar for 2"x2" Light Brown Floor Tiles. This Material is in GOOD condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>08-241AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)

MORTAR MISCELLANEOUS

800 SF

09/02/2010 Grout/Mortar for 8"x8" Green, Pink and Red Ceramic Floor Tiles. This Material is in GOOD condition as of this date. (Original Entry updated on 03/07/14.)

03/07/2014 Tiles are Floor Tiles. Original entry updated. No other changes as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

01/28/2016 Sample 16-030-A43 collected from Room 517, Mortar for Red 8"x8" Ceramic Floor Tile.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>10-174AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
16-030-A43	ND	NONE DETECTED	( ND )

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506

SINK UNDERCOATING

20 SF

- 10/20/2008 Grey Thermal Undercoating on Sink. (5 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 09/02/10.)
- 09/02/2010 Undercoating is Grey. Original entry updated. No other changes as of this date.
- 03/07/2014 This Material is unchanged as of this date.
- 08/29/2014 This Material is unchanged as of this date.
- 03/19/2015 This Material is unchanged as of this date.
- 09/18/2015 This Material is unchanged as of this date.
- 03/21/2016 This Material is unchanged as of this date.
- 09/15/2016 This Material is unchanged as of this date.
- 04/03/2017 This Material is unchanged as of this date.
- 08/30/2017 This Material is unchanged as of this date.
- 02/16/2018 This Material is unchanged as of this date.
- 08/15/2018 This Material is unchanged as of this date.
- 02/08/2019 This Material is unchanged as of this date.
- 08/16/2019 This Material is unchanged as of this date.
- 01/31/2020 This Material is unchanged as of this date.
- 09/01/2020 This Material is unchanged as of this date.
- 02/21/2021 This Material is unchanged as of this date.
- 02/23/2022 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER

30,000 SF

09/14/2005	4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

30,000 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

CARPET MASTIC

8,500 SF

09/15/2016	Mastic/Adhesive for Light Gray, Dark Gray, and Black Carpet. New Material installed during the Summer 2016 Flooring project. This Material is in GOOD condition as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

16-213AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

SUSPENDED CEILING TILE

9,400 SF

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
09/14/2005	This Material is unchanged as of this date.
02/01/2010	Sample 10-019 NW-53 collected on this date.
03/11/2010	Damage: <10% Water Damage - in the form of 1 Tile has Water stains in Classroom 502. Material remains in GOOD condition overall as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/02/2010		Damages reassessed and Material is now in <10% Physical Damage. Additional damage observed in the following locations: Classroom 501, 1 Tile water damaged; Storage Room of Classroom 501 and 502, 1 Tile water damaged; Classroom 503, 1 Tile water damaged; Storage Room of Classroom 503 and 504, 1 Tile Water Damaged; Classroom 504, 3 Tiles Water Damaged; Classroom 506, 1 Tile Water Damaged; Between 505/506, 1 Tile Water Damaged and 1 Tile is broken; Classroom 507, 2 Tiles Water Damaged; and, Classroom 508, 3 Tiles broken, and 1 Tile water stained. No other changes as of this date.	
12/01/2011		Additional Damage observed - in the form of Classroom 502 and 507 each have 1 broken Tile. Classroom 508 has an additional Tile Water stained. Also, Storage Room of Classroom 501 and 502 has 1 additional Tile Water Damaged. No other changes as of this date.	
09/26/2013		Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.	
03/07/2014		This Material is unchanged as of this date.	
08/29/2014		This Material is unchanged as of this date.	
03/19/2015		Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.	
09/18/2015		Damage Re-Assessed. Repairs made to following rooms: Classroom 501, Classroom 502 and Classroom 508. Damages are currently as follows for the following rooms: Storage Room between Classrooms 501 and 502 has 2 Tiles Physically Damaged, Classroom 503 has 2 Water Damaged Tiles and 1 Tile Physically Damaged, Storage Room between Classrooms 503 and 504 has 3 Water Damaged Tiles, Classroom 504 has 2 Water Damaged Tiles, Classroom 506 has 2 Water Damaged Tiles, Storage Room between Classrooms 505 and 506 has 1 Physically Damaged Tile and Classroom 507 has 1 Water Damaged Tile and 1 Physically Damaged Tile. Additional Damage observed, Classroom 505 has 3 Tiles Physically Damaged. No other changes as of this date.	
03/21/2016		This Material is unchanged as of this date.	
09/15/2016		Additional Damage observed. Damage is as follows: Room 501 has 2 Tiles with Water Damage and 1 broken Tile; Workroom for 503 and 504 has 1 Tile with Water Damage; Room 506 has 2 Tiles with Water Damage; and Room 508 has 2 Tiles with Water Damage. No other changes as of this date.	
04/03/2017		Additional Damage Observed. 4 Tiles have Water Damage and 1 Tile is Broken in Classroom 501. No other changes as of this date.	
08/30/2017		This Material is unchanged as of this date.	
02/16/2018		Material Re-assessed. Some Water Damage has been Painted Over. Remains in FAIR condition. No other changes as of this date.	
08/15/2018		This Material is unchanged as of this date.	
02/08/2019		This Material is unchanged as of this date.	



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 3 Ceiling Tiles with Water Stains in Classroom 506. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 Tiles with Water Stains and 1 Tile with 2 LF Crack in Workroom next to RSP Room. No other changes as of this date.		
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1 Tile with a Cracked Corner in Classroom 502. Material remains in FAIR condition overall. No other changes as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>10-018 NW-53</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

VINYL FLOOR TILE

1,540 SF

09/14/2005	12"X12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material reassessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this fact. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A44 collected from Room 507, 12"x12" Green Vinyl Floor Tile.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A44</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

VINYL FLOOR TILE MASTIC

1,540 SF

09/14/2005	Mastic/Adhesive for 12"x12" Green Vinyl Floor Tile. This Material is in GOOD condition as of this date.
08/25/2006	Material reassessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect to this fact. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
01/28/2016	Sample 16-030-A45 collected from Room 507, Mastic for 12"x12" Green Vinyl Floor Tile.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
<b>16-030-A45</b>	<b>ND</b>	<b>NONE DETECTED</b>	<b>( ND )</b>

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

50 SF

08/29/2014	Exterior A/C Cementitious Window Panel. Replacement on lower and upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 1 broken Panel in Room 503. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	Material Re-assessed. Partial Repairs made to Broken Panel in Classroom 503. Panel is Partially Covered with Plywood. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

651 SF

08/29/2014 Fire Door Core Insulation. (2 EA Double-Doors + 29 EA Single-Doors). This Material is in GOOD condition as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS 38,500 SF

09/14/2005	GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.
02/01/2010	Samples 10-019 NW-55 (Joint Tape / Compound), and NW-56 (Drywall) collected on this date.
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of Water Damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
09/26/2013	This Material is unchanged as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
10-018 NW-55	ND	NONE DETECTED	( ND )
10-018 NW-55	ND	NONE DETECTED	( ND )
10-018 NW-56	ND	NONE DETECTED	( ND )

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING

38,500 SF

08/25/2006 Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist Under 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.

03/09/2007 Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.

04/12/2012 Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of water damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.

09/26/2013 Friability changed from Moderate to Low. No other changes as of this date.

03/07/2014 Friability changed from Low to Moderate. No other changes as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.

09/01/2016 This Material is unchanged as of this date.

09/15/2016 Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**COMMENTS**

**QTY (APPROXIMATE)**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

06-223AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

09/14/2005	SKIM COAT FOR STUCCO ON EXTERIOR WALLS AND RESTROOMS OVERHANG. This Material is in GOOD condition as of this date.		
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS. Material changed from ' Stucco on Exterior Walls and Restrooms Overhang. ' to		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
03/06/2017	' Stucco Exterior Walls and Overhangs. ' No other changes as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL

7,200 SF

09/14/2005	Stucco Exterior Walls and Overhangs. This Material is in GOOD condition as of this date.
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS. Material changed from ' Stucco on Exterior Walls and Restrooms Overhang. ' to ' Stucco Exterior Walls and Overhangs. ' No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/21/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### EXTERIOR WINDOWS

##### CAULKING

900 LF

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing and damaged sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/21/2021 Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on Window of Classroom 503. Material remains in FAIR condition overall. No other changes as of this date.

02/23/2022 This Material is unchanged as of this date.

09-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### GIRLS' RESTROOMS

##### MORTAR MISCELLANEOUS

600 SF

10/20/2008 Grout/Mortar for 4"x4" White Wall Tiles. This Material is in GOOD condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/21/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

08-241AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

WATER HEATER CLOSET AND STORAGE

BASEBOARD MASTIC

50 LF

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
10/20/2008	Location Description changed from WATER HEATER CLOSET to WATER HEATER CLOSET AND STORAGE. Material Quantity changed from 25 LF to 50 LF to reflect this fact. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**CLASSROOMS 801 PORTABLE BUILDING**

**CLASSROOMS 801 PORTABLE BUILDING**

10/20/2008 BUILDING INFORMATION:

10/20/2008 Manufacturer's Tag Info:  
By American Modular System; Date 07/08; DSA #01-109890; Serial #'s 08-419-004A, 08-419-004B.  
This entry for informational and tracking purposes.

**CLASSROOMS 801 PORTABLE BUILDING**

CLASSROOM 801  
PORTABLE BUILDING 960 SF

10/20/2008 New 2008 Construction Relocatable Building per Manufacturer's Tag information.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

**SURVEY REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021    This Material is unchanged as of this date.

02/23/2022    This Material is unchanged as of this date.

08-241AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

- 09/14/2005 BUILDING NOTES:
  
- 09/14/2005 No Manufacturer's Tag Info. This entry for informational and tracking purposes.
  
- 03/09/2007 Building Name changed from PORTABLE DAYCARE - CDC to DAYCARE PORTABLE BUILDING - CDC (BUILDING 600).

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS

BASEBOARD MASTIC

350 LF

- 09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
  
- 03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
  
- 03/07/2014 This Material is unchanged as of this date.
  
- 08/29/2014 This Material is unchanged as of this date.
  
- 03/19/2015 This Material is unchanged as of this date.
  
- 09/18/2015 This Material is unchanged as of this date.
  
- 03/21/2016 This Material is unchanged as of this date.
  
- 09/15/2016 This Material is unchanged as of this date.
  
- 04/03/2017 This Material is unchanged as of this date.
  
- 08/30/2017 This Material is unchanged as of this date.
  
- 02/16/2018 This Material is unchanged as of this date.
  
- 08/15/2018 This Material is unchanged as of this date.
  
- 02/08/2019 This Material is unchanged as of this date.
  
- 08/16/2019 This Material is unchanged as of this date.
  
- 01/31/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

COLLAPSIBLE PARTITION WALL 130 SF

09/14/2005 MOVABLE ACCORDION WALL. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

09/26/2013 Friability changed from Low to Non. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS

SMOOTH WALL MISCELLANEOUS

2,120 SF

03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

09/14/2007 GYPSUM WALLBOARD SYSTEM. This Material is in GOOD condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>			
<b>LOCATION</b>			
<b>MATERIAL TYPE</b>			<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>			

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022    This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

SUSPENDED CEILING TILE 2,040 SF

- 09/14/2005    2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. Tiles are White with a smooth texture on fiberglass panel. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
- 03/09/2007    Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
- 11/09/2007    Material re-assessed. Damage: <5% Physical Damage - due to 14 Tiles with minor holes and cuts. Friability changed from Low to Moderate. Material condition change from GOOD to FAIR overall.
- 12/01/2011    Additional Damage - in the form of several Tiles are Damaged. No other changes as of this date.
- 03/07/2014    This Material is unchanged as of this date.
- 08/29/2014    This Material is unchanged as of this date.
- 03/19/2015    Tiles are White with a smooth texture on fiberglass panel. Original Entry updated. This Material is unchanged as of this date.
- 09/18/2015    This Material is unchanged as of this date.
- 03/21/2016    This Material is unchanged as of this date.
- 09/15/2016    This Material is unchanged as of this date.
- 04/03/2017    This Material is unchanged as of this date.
- 08/30/2017    This Material is unchanged as of this date.
- 02/16/2018    This Material is unchanged as of this date.
- 08/15/2018    This Material is unchanged as of this date.
- 02/08/2019    This Material is unchanged as of this date.
- 08/16/2019    This Material is unchanged as of this date.
- 01/31/2020    This Material is unchanged as of this date.
- 09/01/2020    This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

##### VINYL FLOOR TILE

960 SF

09/14/2005 12"X12" Pink VINYL FLOOR TILE. <10% of Tile is broken and cracked. This Material is in FAIR condition overall as of this date. (Original entry updated 09/18/15.)

08/25/2006 Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.

03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
09/01/2020		This Material is unchanged as of this date.	
02/12/2021		This Material is unchanged as of this date.	
08/13/2021		This Material is unchanged as of this date.	
02/23/2022		This Material is unchanged as of this date.	
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

#### VINYL FLOOR TILE MASTIC

960 SF

09/14/2005	Mastic/Adhesive for 12"x12" Pink Vinyl Floor Tile. Damage: <10% Physical Damage - due to broken and cracked Tiles. This Material is in FAIR condition overall as of this date. (Original entry updated 09/18/15)
08/25/2006	Material Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

**CLASSROOMS**

**VINYL WALL COVER**

2,100 SF

09/14/2005 4'X10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

#### VINYL WALL COVER MASTIC

2,100 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'x10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

1,000 SF

09/14/2005 Mastic/Adhesive for Brown and Blue Carpets. This Material is in GOOD condition as of this date.

08/25/2006 Material Quantity changed from 675 SF to 1,000 SF. No other changes as of this date.

03/09/2007 Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.

09/02/2010 Material Re-assessed. (Classroom & Office - 95% Brown - ; Carpet in Storage Room - 5% Blue). This Material is unchanged as of this date.

12/01/2011 Location Description changed from CLASSROOMS to CLASSROOMS, OFFICE AND STORAGE ROOM. No other changes as of this date.

03/07/2014 1 SF is Damaged. This Material is in FAIR condition. Friability changed from Non-Friable to Friable. No other changes as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

DAYCARE PORTABLE (600)

SINK UNDERCOATING

10 SF

09/02/2010	Black Thermal Undercoating on Sink. (4 EA Sinks). Thermal undercoatings are Black and Gray. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Thermal undercoatings are Black and Gray. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

<b>10-174AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

63 SF

08/29/2014	Fire Door Core Insulation. (3 EA Single-Doors). This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

<b>14-198AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>
------------------	----------------	------------------	---------------



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

FOOD PREPERATION AREA

VINYL SHEETING 90 SF

03/19/2015	Light Green Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 2 SF of Sheeting is Peeling up by Sink Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

15-042AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

FOOD PREPERATION AREA

VINYL SHEETING BACKING PAPER/MASTIC 90 SF

03/19/2015	Backing Paper/Adhesive for Light Green Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.
09/18/2015	This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 2 SF of Sheeting is Peeling up by Sink Area. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

15-042AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING 140 SF

09/14/2005	Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.		
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.		
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.		
09/02/2010	Location Description changed from RESTROOMS (2) to RESTROOMS (2 - BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Material located on Walls and Floor. No other changes as of this date.		
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.		
03/07/2014	This Material is unchanged as of this date.		

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
08/29/2014		This Material is unchanged as of this date.	
03/19/2015		This Material is unchanged as of this date.	
09/18/2015		This Material is unchanged as of this date.	
03/21/2016		This Material is unchanged as of this date.	
09/15/2016		This Material is unchanged as of this date.	
04/03/2017		Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.	
08/30/2017		This Material is unchanged as of this date.	
02/16/2018		This Material is unchanged as of this date.	
08/15/2018		This Material is unchanged as of this date.	
02/08/2019		This Material is unchanged as of this date.	
08/16/2019		This Material is unchanged as of this date.	
01/31/2020		This Material is unchanged as of this date.	
09/01/2020		This Material is unchanged as of this date.	
02/12/2021		This Material is unchanged as of this date.	
08/13/2021		This Material is unchanged as of this date.	
02/23/2022		This Material is unchanged as of this date.	

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC 140 SF

09/14/2005	Backing Paper/Adhesive for Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	This Material is unchanged as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
<b>05-212AAA</b>	<b>ASSUMED</b>	<b>NO SAMPLE</b>	<b>( NS )</b>

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

- 09/14/2005 BUILDING NOTES:
  
- 09/14/2005 Manufacturer's Tag Info:  
BY SPACE MASTER; DATE: 4/89; SERIAL: 14786; OSA: 0425.  
This entry for informational and tracking purposes.
  
- 03/09/2007 Building Name changed from PORTABLE DAYCARE - FED CHILDCARE to DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900).  
Location Descriptions changed from PORTABLE DAYCARE - FED CHILDCARE to CLASSROOM.

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM

BASEBOARD MASTIC

140 LF

- 09/14/2005 Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
  
- 03/07/2014 This Material is unchanged as of this date.
  
- 08/29/2014 This Material is unchanged as of this date.
  
- 03/19/2015 This Material is unchanged as of this date.
  
- 09/18/2015 This Material is unchanged as of this date.
  
- 03/21/2016 This Material is unchanged as of this date.
  
- 09/15/2016 This Material is unchanged as of this date.
  
- 04/03/2017 This Material is unchanged as of this date.
  
- 08/30/2017 This Material is unchanged as of this date.
  
- 02/16/2018 This Material is unchanged as of this date.
  
- 08/15/2018 This Material is unchanged as of this date.
  
- 02/08/2019 This Material is unchanged as of this date.
  
- 08/16/2019 This Material is unchanged as of this date.
  
- 01/31/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM

CARPET MASTIC

480 SF

09/14/2005 Mastic/Adhesive for Grey Carpet. This Material is in GOOD condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>			
<b>LOCATION</b>			
<b>MATERIAL TYPE</b>			<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>			

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

### DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

CLASSROOM

CHALK BOARD

24 SF

05/14/2009	Brown Cementitious Chalkboard. Chalkboard is framed, not glued. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

09-098AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM

SUSPENDED CEILING TILE

960 SF

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. This Material is in GOOD condition as of this date. (Original entry updated 03/19/15).
12/01/2011	Damage: <5% Physical Damage - in the form of Restroom has 2 broken Tiles and 1 hole observed; <10% Water Damage - in the form of 1 Tile is Water Damaged. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/07/2014	Water Damaged Tiles have been replaced. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. 2 Tiles Water Damaged, and Classroom has 4 Tiles Physically Damaged. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM

VINYL WALL COVER

1,800 SF

09/14/2005 4'X10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM

VINYL WALL COVER MASTIC

1,800 SF

09/14/2005	Mastic/Adhesive for Vinyl Covering on 4'X10' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM 900

VINYL WALL COVER

1,800 SF

03/11/2010	Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.	
03/07/2014	This Material is unchanged as of this date.	
08/29/2014	This Material is unchanged as of this date.	
03/19/2015	This Material is unchanged as of this date.	
09/18/2015	This Material is unchanged as of this date.	
03/21/2016	This Material is unchanged as of this date.	
09/15/2016	This Material is unchanged as of this date.	
04/03/2017	This Material is unchanged as of this date.	
08/30/2017	This Material is unchanged as of this date.	
02/16/2018	This Material is unchanged as of this date.	
08/15/2018	This Material is unchanged as of this date.	
02/08/2019	This Material is unchanged as of this date.	
08/16/2019	This Material is unchanged as of this date.	
01/31/2020	This Material is unchanged as of this date.	
09/01/2020	This Material is unchanged as of this date.	
02/12/2021	This Material is unchanged as of this date.	
08/13/2021	This Material is unchanged as of this date.	
02/23/2022	This Material is unchanged as of this date.	

10-052AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM 900

VINYL WALL COVER MASTIC

1,800 SF

03/11/2010	Mastic/Adhesive for Vinyl Wall Cover, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

10-052AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM AND RESTROOMS

VINYL SHEETING

480 SF

09/14/2005	Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.
05/14/2009	Location changed from CLASSROOMS to CLASSROOM AND RESTROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM AND RESTROOMS

VINYL SHEETING BACKING PAPER/MASTIC 480 SF

09/14/2005	BACKING PAPER/Adhesive fOR beige VINYL SHEETING. This Material is in GOOD condition as of this date.
05/14/2009	Location changed from CLASSROOMS to CLASSROOM AND RESTROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

05-212AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

42 SF

08/29/2014	Fire Door Core Insulation. (2 EA Single-Doors). This Material is in GOOD condition as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

14-198AAA	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>				
<b>LOCATION</b>				
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>				

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)**

**DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)**

09/14/2005	BUILDING NOTES:
09/14/2005	Manufacturer's Tag Info: By American Modular; OSA #65132; SERIAL# 96-R24-004A, 96-R24-004B. This entry for informational and tracking purposes.
03/09/2007	Building Name changed from PORTABLE DAYCARE - SDC to DAYCARE PORTABLE BUILDING - SDC (BUILDING 800).
10/20/2008	Serial #'s on Manufacturer's Tag Info changed from 96-R24-004A, 96-R24-004B to 96-R243-004A, 96-R243-004B. Date 7/96

**DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)**

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

960 SF

04/20/2006	New 1996 Construction Relocatable Building per Manufacturer's Tag information.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.



# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
05-212.NS	NEW	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**COMMENTS**

**QTY (APPROXIMATE)**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**FAMILY RESOURCE CENTER (BUILDING 700)**

**FAMILY RESOURCE CENTER (BUILDING 700)**

04/21/2008 BUILDING NOTES:

04/21/2008 Manufacturers Tag Info:  
By American Modular System. Date of manufacturer 07/07. DSA #01-108993.  
Serial #07-352-001A, 07-352-001B, 07-352-001C, 07-352-001D, 07-352-001E.

05/14/2009 Building name changed from DAYCARE PORTABLE BUILDING - STATE to STATE PRESCHOOL PORTABLE BUILDING (BUILDING 700).

**FAMILY RESOURCE CENTER (BUILDING 700)**

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

1,440 SF

04/21/2008 New 2007 Construction Relocatable Building per Manufacturer's Tag information.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME

LOCATION

MATERIAL TYPE

QTY (APPROXIMATE)

COMMENTS

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		
08-075AAA	NEW	NO SAMPLE	( NS )

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**METAL STORAGE CONTAINERS (3 EA)**

**METAL STORAGE CONTAINERS (3 EA)**

05/14/2009 BUILDING NOTES:

05/14/2009 Metal Storage Containers (3 EA).

**METAL STORAGE CONTAINERS (3 EA)**

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER 480 SF

03/21/2016 Metal Storage Containers. 3 EA, approximately 160 SF EA.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

16-074.NS	ASSUMED	NO SAMPLE	( NS )
-----------	---------	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**MIDDLE QUAD PATIO**

**MIDDLE QUAD PATIO**

09/18/2015 BUILDING NOTES:

09/18/2015 Metal and concrete construction building.

**MIDDLE QUAD PATIO**

MIDDLE QUAD PATIO

PERMANENT BUILDING

1,600 SF

09/18/2015 Middle Quad Patio. Apparent New Metal and Concrete Structure identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

15-174.NS	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					<b>QTY (APPROXIMATE)</b>
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**PORTABLE NEXT TO P6**

**PORTABLE NEXT TO P6**

02/08/2019 BUILDING NOTES:  
 02/08/2019 Building is not currently in Use.  
 American Modular System  
 DSA# 01-112697  
 Serial# 12-825-001A&B  
 Date MFG 06-12

**PORTABLE NEXT TO P6**

PORTABLE NEXT TO P6

PORTABLE BUILDING

900 SF

02/08/2019 New 2006 Relocatable Construction Building per Manufacture's Tag info.  
 08/16/2019 This Material is unchanged as of this date.  
 01/31/2020 This Material is unchanged as of this date.  
 09/01/2020 This Material is unchanged as of this date.  
 02/12/2021 This Material is unchanged as of this date.  
 08/13/2021 This Material is unchanged as of this date.  
 02/23/2022 This Material is unchanged as of this date.

19-011AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

# SURVEY REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>				<b>QTY (APPROXIMATE)</b>	
<b>COMMENTS</b>					

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

**WOOD STORAGE SHEDS (2 EA)**

**WOOD STORAGE SHEDS (2 EA)**

05/14/2009	BUILDING NOTES:
05/14/2009	Wood Storage Shed (1 EA) used for PE Equipment storage. Located on the west side of Building 400.
12/01/2011	Building Name changed from WOOD STORAGE SHED (1 EA) to WOOD STORAGE SHEDS (2 EA). Area changed from 40 SF to 80 SF. (Second portable is located next to Building 900).

**WOOD STORAGE SHEDS (2 EA)**

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

170 SF

05/14/2009	Apparent New Wood Construction Structures identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.
12/01/2011	Location Description changed from WOOD STORAGE SHED (1 EA) to WOOD STORAGE SHED (1 EA). Quantity changed from 40 SF to 80 SF. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Quantity Re-Assessed. Quantity changed from 80 SF to 170 SF. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.

**SURVEY REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**QTY (APPROXIMATE)**

**COMMENTS**

SAMPLE NO.	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS CODE
------------	------------------	---------------	---------------

09/01/2020    This Material is unchanged as of this date.

02/12/2021    This Material is unchanged as of this date.

02/23/2022    This Material is unchanged as of this date.

09-098AAA	NEW	NO SAMPLE	( NS )
-----------	-----	-----------	--------

End Of Report, Total Of 146 Pages



# HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**MATERIAL CATEGORY**

**LOCATION**

**MATERIAL TYPE**

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MISCELLANEOUS MATERIAL

ALL OFFICES, AND HALLWAY TO STAGE	CARPET MASTIC
BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM	BASEBOARD MASTIC
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
ENTIRE BUILDING	SMOOTH WALL MISCELLANEOUS
ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM	BASEBOARD MASTIC
HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY	SUSPENDED CEILING TILE
KITCHEN	VINYL SHEETING
KITCHEN	VINYL SHEETING BACKING PAPER/MASTIC
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE
KITCHEN PANTRY CLOSET	VINYL FLOOR TILE MASTIC
MULTI-PURPOSE ROOM	SUSPENDED CEILING TILE
MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA	VINYL FLOOR TILE
MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA	VINYL FLOOR TILE MASTIC
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS	VINYL WALL COVER
MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS	VINYL WALL COVER MASTIC
PTA ROOM	VINYL FLOOR TILE
PTA ROOM	VINYL FLOOR TILE MASTIC
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS
STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS
TEACHER'S LOUNGE AND NURSE'S ROOM	SINK UNDERCOATING
WOMENS RESTROOM	MORTAR MISCELLANEOUS

SURFACING MATERIAL

ENTIRE BUILDING	SMOOTH WALL SURFACING
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL
EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL SURFACING

THERMAL SYSTEM INSULATION

ATTIC / PLENUM	PIPE FITTING INSULATION
----------------	-------------------------

**BUS LOOP**

SURFACING MATERIAL

EXTERIOR WALL	ROUGH WALL
EXTERIOR WALL	ROUGH WALL SURFACING

# HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

**BUILDING NAME**

**MATERIAL CATEGORY**

**LOCATION**

**MATERIAL TYPE**

THERMAL SYSTEM INSULATION

EXTERIOR WALL

PAPER TYPE INSULATION

**CLASSROOM P6 (803)**

MISCELLANEOUS MATERIAL

CLASSROOM 6(803)

PERMANENT BUILDING

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

MISCELLANEOUS MATERIAL

ALL ROOMS AND CLOSETS

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

CLASSROOMS 201-202

CUSTODIAN ROOM AND BOILER ROOM

ENTIRE BUILDING

EXTERIOR WINDOWS

RESTROOMS

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

STUDENT RESTROOMS

BASEBOARD MASTIC

CARPET MASTIC

SUSPENDED CEILING TILE

VINYL WALL COVER

VINYL WALL COVER MASTIC

SMOOTH WALL

MISCELLANEOUS

VINYL FLOOR TILE

VINYL FLOOR TILE MASTIC

SINK UNDERCOATING

BASEBOARD MASTIC

FIRE DOOR CORE INSULATION

CAULKING

MORTAR MISCELLANEOUS

MORTAR MISCELLANEOUS

MORTAR MISCELLANEOUS

SURFACING MATERIAL

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

EXTERIOR WALLS

EXTERIOR WALLS

SMOOTH WALL SURFACING

ROUGH WALL

ROUGH WALL SURFACING

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

MISCELLANEOUS MATERIAL

ALL CLASSROOMS AND F.I.S. ROOM

ALL CLASSROOMS AND F.I.S. ROOM

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS

CLASSROOMS 301-306, HALLWAY, AND F.I.S.

CLASSROOMS 301-308, AND RESTROOMS (2)

ENTIRE BUILDING

ENTIRE BUILDING

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

VINYL WALL COVER

VINYL WALL COVER MASTIC

MORTAR MISCELLANEOUS

SUSPENDED CEILING TILE

BASEBOARD MASTIC

CARPET MASTIC

MORTAR MISCELLANEOUS

CEMENTITIOUS

MISCELLANEOUS

FIRE DOOR CORE INSULATION

SMOOTH WALL

MISCELLANEOUS

# HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

## BUILDING NAME

### MATERIAL CATEGORY

#### LOCATION

#### MATERIAL TYPE

EXTERIOR WINDOWS AND DOORS

CAULKING

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE MASTIC

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE MASTIC

WATER HEATER ROOM (NEXT TO RESTROOMS)

BASEBOARD MASTIC

#### SURFACING MATERIAL

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING

## CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### MISCELLANEOUS MATERIAL

ALL CLASSROOMS

CARPET MASTIC

ALL CLASSROOMS, AND LIBRARY

SUSPENDED CEILING TILE

ALL ROOMS

BASEBOARD MASTIC

BOYS AND GIRLS RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

CLASSROOMS, AND LIBRARY

VINYL WALL COVER

CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

ENTIRE BUILDING

CEMENTITIOUS

MISCELLANEOUS

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

ENTIRE BUILDING

SMOOTH WALL

MISCELLANEOUS

EXTERIOR WINDOWS

CAULKING

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS

MORTAR MISCELLANEOUS

LIBRARY STORAGE

BASEBOARD MASTIC

LIBRARY STORAGE

VINYL FLOOR TILE

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE MASTIC

WATER HEATER ROOM AND UTILITY CLOSET

BASEBOARD MASTIC

#### SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

## CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### MISCELLANEOUS MATERIAL

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS

BASEBOARD MASTIC

BOYS AND GIRLS RESTROOM

MORTAR MISCELLANEOUS

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

# HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

## BUILDING NAME

### MATERIAL CATEGORY

#### LOCATION

#### MATERIAL TYPE

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)	MORTAR MISCELLANEOUS
CLASSROOMS 501-506	SINK UNDERCOATING
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER
CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER MASTIC
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	CARPET MASTIC
CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	SUSPENDED CEILING TILE
CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB	VINYL FLOOR TILE
CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB	VINYL FLOOR TILE MASTIC
ENTIRE BUILDING	CEMENTITIOUS MISCELLANEOUS
ENTIRE BUILDING	FIRE DOOR CORE INSULATION
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL MISCELLANEOUS
EXTERIOR WINDOWS	CAULKING
GIRLS' RESTROOMS	MORTAR MISCELLANEOUS
WATER HEATER CLOSET AND STORAGE	BASEBOARD MASTIC
<b>SURFACING MATERIAL</b>	
ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING
EXTERIOR WALLS, AND OVERHANG OF RESTROOMS	ROUGH WALL SURFACING
EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS	ROUGH WALL

## CLASSROOMS 801 PORTABLE BUILDING

### MISCELLANEOUS MATERIAL

CLASSROOM 801

PORTABLE BUILDING

## DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

### MISCELLANEOUS MATERIAL

CLASSROOMS

CLASSROOMS

CLASSROOMS

CLASSROOMS

CLASSROOMS

CLASSROOMS

CLASSROOMS

CLASSROOMS

CLASSROOMS, OFFICE AND STORAGE ROOM

DAYCARE PORTABLE (600)

ENTIRE BUILDING

FOOD PREPERATION AREA

FOOD PREPERATION AREA

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

BASEBOARD MASTIC

COLLAPSIBLE PARTITION WALL

SMOOTH WALL

MISCELLANEOUS

SUSPENDED CEILING TILE

VINYL FLOOR TILE

VINYL FLOOR TILE MASTIC

VINYL WALL COVER

VINYL WALL COVER MASTIC

CARPET MASTIC

SINK UNDERCOATING

FIRE DOOR CORE INSULATION

VINYL SHEETING

VINYL SHEETING BACKING PAPER/MASTIC

VINYL SHEETING

VINYL SHEETING BACKING PAPER/MASTIC

# HOMOGENEOUS MATERIALS IN NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	MATERIAL CATEGORY	LOCATION	MATERIAL TYPE
<b>DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)</b>			
	MISCELLANEOUS MATERIAL		
	CLASSROOM		BASEBOARD MASTIC
	CLASSROOM		CARPET MASTIC
	CLASSROOM		CHALK BOARD
	CLASSROOM		SUSPENDED CEILING TILE
	CLASSROOM		VINYL WALL COVER
	CLASSROOM		VINYL WALL COVER MASTIC
	CLASSROOM 900		VINYL WALL COVER
	CLASSROOM 900		VINYL WALL COVER MASTIC
	CLASSROOM AND RESTROOMS		VINYL SHEETING
	CLASSROOM AND RESTROOMS		VINYL SHEETING BACKING PAPER/MASTIC
	ENTIRE BUILDING		FIRE DOOR CORE INSULATION
<b>DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)</b>			
	MISCELLANEOUS MATERIAL		
	PORTABLE DAYCARE - SDC		PORTABLE BUILDING
<b>FAMILY RESOURCE CENTER (BUILDING 700)</b>			
	MISCELLANEOUS MATERIAL		
	DAYCARE PORTABLE BUILDING - STATE		PORTABLE BUILDING
<b>METAL STORAGE CONTAINERS (3 EA)</b>			
	MISCELLANEOUS MATERIAL		
	METAL STORAGE CONTAINERS (3 EA)		STORAGE CONTAINER
<b>MIDDLE QUAD PATIO</b>			
	MISCELLANEOUS MATERIAL		
	MIDDLE QUAD PATIO		PERMANENT BUILDING
<b>PORTABLE NEXT TO P6</b>			
	MISCELLANEOUS MATERIAL		
	PORTABLE NEXT TO P6		PORTABLE BUILDING
<b>WOOD STORAGE SHEDS (2 EA)</b>			

**HOMOGENEOUS MATERIALS IN  
NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**MATERIAL CATEGORY**

**LOCATION**

**MATERIAL TYPE**

---

MISCELLANEOUS MATERIAL

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

---

**End Of Report, Total Of 6 Pages**

---

**FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>	<b>ASBESTOS CONTENT</b>
<b>ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)</b>				
	ATTIC / PLENUM			
		PIPE FITTING INSULATION	(TBD) LF	Assumed
	BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM			
		BASEBOARD MASTIC	116 LF	New Material
	ENTIRE BUILDING			
		FIRE DOOR CORE INSULATION	546 SF	Assumed
	ENTIRE BUILDING			
		SMOOTH WALL MISCELLANEOUS	24,500 SF	Greater Than 1%
	ENTIRE BUILDING			
		SMOOTH WALL SURFACING	24,500 SF	Greater Than 1%
	ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM			
		BASEBOARD MASTIC	1,420 LF	Assumed
	HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY			
		SUSPENDED CEILING TILE	1,490 SF	Assumed
	KITCHEN			
		VINYL SHEETING	572 SF	Assumed
	KITCHEN			
		VINYL SHEETING BACKING PAPER/MASTIC	572 SF	Assumed
	KITCHEN PANTRY CLOSET			
		VINYL FLOOR TILE	60 SF	Assumed
	KITCHEN PANTRY CLOSET			
		VINYL FLOOR TILE MASTIC	60 SF	Assumed
	MULTI-PURPOSE ROOM			
		SUSPENDED CEILING TILE	2,530 SF	Assumed
	MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS			
		VINYL WALL COVER	18,680 SF	Assumed
	MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS			
		VINYL WALL COVER MASTIC	18,680 SF	Assumed
	PTA ROOM			
		VINYL FLOOR TILE	144 SF	Assumed
	PTA ROOM			
		VINYL FLOOR TILE MASTIC	144 SF	Assumed

**FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>	<b>ASBESTOS CONTENT</b>
<b>BUS LOOP</b>				
	EXTERIOR WALL	PAPER TYPE INSULATION	800 SF	Assumed
<b>CLASSROOMS 201-202 BUILDING (BUILDING 200)</b>				
	CLASSROOMS 201 AND 202	SUSPENDED CEILING TILE	2,600 SF	Assumed
	CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL MISCELLANEOUS	2,600 SF	Greater Than 1%
	CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING	2,600 SF	Greater Than 1%
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION	210 SF	Assumed
	EXTERIOR WINDOWS	CAULKING	200 LF	Assumed
<b>CLASSROOMS 301-306 BUILDING (BUILDING 300)</b>				
	CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS	SUSPENDED CEILING TILE	9,400 SF	Assumed
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION	672 SF	Assumed
	ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS	SMOOTH WALL MISCELLANEOUS	37,800 SF	Assumed
	ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS	SMOOTH WALL SURFACING	37,800 SF	Assumed
	EXTERIOR WINDOWS AND DOORS	CAULKING	900 LF	Assumed
<b>CLASSROOMS 400-406 BUILDING (BUILDING 400)</b>				
	ALL CLASSROOMS, AND LIBRARY	SUSPENDED CEILING TILE	8,400 SF	Assumed
	CLASSROOMS, AND LIBRARY	VINYL WALL COVER	29,880 SF	Assumed
	CLASSROOMS, AND LIBRARY	VINYL WALL COVER MASTIC	29,880 SF	Assumed
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION	399 SF	Assumed



**FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
	ENTIRE BUILDING	SMOOTH WALL MISCELLANEOUS	38,100 SF	Assumed
	ENTIRE BUILDING	SMOOTH WALL SURFACING	38,100 SF	Assumed
	EXTERIOR WALLS, AND OVERHANG OF RESTROOMS	ROUGH WALL	7,200 SF	Assumed
	EXTERIOR WALLS, AND OVERHANG OF RESTROOMS	ROUGH WALL SURFACING	7,200 SF	Assumed
	EXTERIOR WINDOWS	CAULKING	900 LF	Assumed
	LIBRARY STORAGE	BASEBOARD MASTIC	50 LF	Assumed
	LIBRARY STORAGE	VINYL FLOOR TILE	144 SF	Assumed
	LIBRARY STORAGE	VINYL FLOOR TILE MASTIC	144 SF	Assumed
<b>CLASSROOMS 501-506 BUILDING (BUILDING 500)</b>				
	BOYS AND GIRLS RESTROOM	MORTAR MISCELLANEOUS	120 SF	Assumed
	BOYS AND GIRLS RESTROOMS	MORTAR MISCELLANEOUS	600 SF	Assumed
	CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER	30,000 SF	Assumed
	CLASSROOMS 501-506 AND COMPUTER LAB	VINYL WALL COVER MASTIC	30,000 SF	Assumed
	CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB	SUSPENDED CEILING TILE	9,400 SF	Assumed
	ENTIRE BUILDING	CEMENTITIOUS MISCELLANEOUS	50 SF	Assumed
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION	651 SF	Assumed
	ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL MISCELLANEOUS	38,500 SF	Assumed
	ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS	SMOOTH WALL SURFACING	38,500 SF	Assumed

**FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>	<b>ASBESTOS CONTENT</b>
	EXTERIOR WINDOWS	CAULKING	900 LF	Assumed
<b>DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)</b>				
	CLASSROOMS	SMOOTH WALL MISCELLANEOUS	2,120 SF	Assumed
	CLASSROOMS	SUSPENDED CEILING TILE	2,040 SF	Assumed
	CLASSROOMS	VINYL FLOOR TILE	960 SF	Assumed
	CLASSROOMS	VINYL FLOOR TILE MASTIC	960 SF	Assumed
	CLASSROOMS, OFFICE AND STORAGE ROOM	CARPET MASTIC	1,000 SF	Assumed
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION	63 SF	Assumed
	FOOD PREPERATION AREA	VINYL SHEETING	90 SF	Assumed
	FOOD PREPERATION AREA	VINYL SHEETING BACKING PAPER/MASTIC	90 SF	Assumed
	RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM	VINYL SHEETING	140 SF	Assumed
	RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM	VINYL SHEETING BACKING PAPER/MASTIC	140 SF	Assumed
<b>DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)</b>				
	CLASSROOM	SUSPENDED CEILING TILE	960 SF	Assumed
	CLASSROOM AND RESTROOMS	VINYL SHEETING BACKING PAPER/MASTIC	480 SF	Assumed
	ENTIRE BUILDING	FIRE DOOR CORE INSULATION	42 SF	Assumed

End Of Report, Total Of 4 Pages

**NON- FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
<b>ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)</b>				
	ALL OFFICES, AND HALLWAY TO STAGE	CARPET MASTIC	4,430 SF	New Material
	EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL	17,180 SF	Assumed
	EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)	ROUGH WALL SURFACING	17,180 SF	Assumed
	MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA	VINYL FLOOR TILE	4,200 SF	New Material
	MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA	VINYL FLOOR TILE MASTIC	4,200 SF	New Material
	STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS	640 SF	Assumed
	STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM	MORTAR MISCELLANEOUS	270 SF	Assumed
	TEACHER'S LOUNGE AND NURSE'S ROOM	SINK UNDERCOATING	8 SF	Assumed
	WOMENS RESTROOM	MORTAR MISCELLANEOUS	120 SF	Assumed
<b>BUS LOOP</b>				
	EXTERIOR WALL	ROUGH WALL	800 SF	Assumed
	EXTERIOR WALL	ROUGH WALL SURFACING	800 SF	Assumed
<b>CLASSROOM P6 (803)</b>				
	CLASSROOM 6(803)	PERMANENT BUILDING	960 SF	New Material
<b>CLASSROOMS 201-202 BUILDING (BUILDING 200)</b>				
	ALL ROOMS AND CLOSETS	BASEBOARD MASTIC	90 SF	New Material
	CLASSROOMS 201 AND 202	CARPET MASTIC	1,500 SF	New Material
	CLASSROOMS 201 AND 202	VINYL WALL COVER	1,600 SF	Assumed
	CLASSROOMS 201 AND 202	VINYL WALL COVER MASTIC	1,600 SF	Assumed
	CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS	VINYL FLOOR TILE	1,500 SF	New Material
	CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS	VINYL FLOOR TILE MASTIC	1,500 SF	New Material

S= Sq. Ft, I=Inches, L=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

**NON- FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME			
LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
CLASSROOMS 201-202	SINK UNDERCOATING	8 SF	Assumed
CUSTODIAN ROOM AND BOILER ROOM	BASEBOARD MASTIC	80 LF	Assumed
EXTERIOR WALLS	ROUGH WALL	3,200 SF	Assumed
EXTERIOR WALLS	ROUGH WALL SURFACING	3,200 SF	Assumed
RESTROOMS	MORTAR MISCELLANEOUS	200 SF	Assumed
RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM	MORTAR MISCELLANEOUS	560 SF	Assumed
STUDENT RESTROOMS	MORTAR MISCELLANEOUS	300 SF	Assumed
<b>CLASSROOMS 301-306 BUILDING (BUILDING 300)</b>			
ALL CLASSROOMS AND F.I.S. ROOM	VINYL WALL COVER	29,000 SF	Assumed
ALL CLASSROOMS AND F.I.S. ROOM	VINYL WALL COVER MASTIC	29,000 SF	Assumed
BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM	MORTAR MISCELLANEOUS	350 SF	Assumed
CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS	BASEBOARD MASTIC	1,400 LF	New Material
CLASSROOMS 301-306, HALLWAY, AND F.I.S.	CARPET MASTIC	7,684 SF	New Material
CLASSROOMS 301-308, AND RESTROOMS (2)	MORTAR MISCELLANEOUS	700 SF	Assumed
ENTIRE BUILDING	CEMENTITIOUS MISCELLANEOUS	70 SF	Assumed
EXTERIOR WALLS AND OVERHANG ON RESTROOMS	ROUGH WALL	7,200 SF	Assumed
EXTERIOR WALLS AND OVERHANG ON RESTROOMS	ROUGH WALL SURFACING	7,200 SF	Assumed
FLEXIBLE INSTRUCTIONAL SPACE	VINYL FLOOR TILE	756 SF	New Material
FLEXIBLE INSTRUCTIONAL SPACE	VINYL FLOOR TILE MASTIC	756 SF	New Material
TEACHERS' WORK ROOM, AND CLASSROOMS 301-308	SINK UNDERCOATING	28 SF	Assumed
TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM	VINYL FLOOR TILE	1,560 SF	Assumed

**Non- Friable Locations In  
NORTHWOOD ELEMENTARY SCHOOL**

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>QTY (APPROXIMATE)</b>	<b>ASBESTOS CONTENT</b>
	TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM		
	VINYL FLOOR TILE MASTIC	1,560 SF	Assumed
	WATER HEATER ROOM (NEXT TO RESTROOMS)		
	BASEBOARD MASTIC	15 LF	Assumed
<b>CLASSROOMS 400-406 BUILDING (BUILDING 400)</b>			
	ALL CLASSROOMS		
	CARPET MASTIC	7,600 SF	New Material
	ALL ROOMS		
	BASEBOARD MASTIC	1,400 LF	New Material
	BOYS AND GIRLS RESTROOMS AND STORAGE ROOM		
	MORTAR MISCELLANEOUS	350 SF	Assumed
	ENTIRE BUILDING		
	CEMENTITIOUS MISCELLANEOUS	50 SF	Assumed
	LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS		
	MORTAR MISCELLANEOUS	700 SF	Assumed
	TEACHERS' WORK ROOM, AND LIBRARY		
	SINK UNDERCOATING	24 SF	Assumed
	TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS		
	VINYL FLOOR TILE	2,200 SF	Assumed
	TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS		
	VINYL FLOOR TILE MASTIC	2,200 SF	Assumed
	WATER HEATER ROOM AND UTILITY CLOSET		
	BASEBOARD MASTIC	40 LF	Assumed
<b>CLASSROOMS 501-506 BUILDING (BUILDING 500)</b>			
	ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS		
	BASEBOARD MASTIC	1,400 LF	New Material
	BOYS AND GIRLS RESTROOMS		
	MORTAR MISCELLANEOUS	416 SF	Assumed
	CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)		
	MORTAR MISCELLANEOUS	800 SF	Assumed
	CLASSROOMS 501-506		
	SINK UNDERCOATING	20 SF	Assumed
	CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB		
	CARPET MASTIC	8,500 SF	New Material
	CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB		
	VINYL FLOOR TILE	1,540 SF	Assumed
	CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB		
	VINYL FLOOR TILE MASTIC	1,540 SF	Assumed
	EXTERIOR WALLS, AND OVERHANG OF RESTROOMS		
	ROUGH WALL SURFACING	7,200 SF	Assumed
	EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS		
	ROUGH WALL	7,200 SF	Assumed

S= Sq. Ft, l=Inches, L=Linear Ft., N=Number, EA=Each

*HazMat Doc. All Rights Reserved.*

**NON- FRIABLE LOCATIONS IN  
NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	ASBESTOS CONTENT
	GIRLS' RESTROOMS	MORTAR MISCELLANEOUS	600 SF	Assumed
	WATER HEATER CLOSET AND STORAGE	BASEBOARD MASTIC	50 LF	Assumed
<b>DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)</b>				
	CLASSROOMS	BASEBOARD MASTIC	350 LF	Assumed
	CLASSROOMS	COLLAPSIBLE PARTITION WALL	130 SF	Assumed
	CLASSROOMS	VINYL WALL COVER	2,100 SF	Assumed
	CLASSROOMS	VINYL WALL COVER MASTIC	2,100 SF	Assumed
	DAYCARE PORTABLE (600)	SINK UNDERCOATING	10 SF	Assumed
<b>DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)</b>				
	CLASSROOM	BASEBOARD MASTIC	140 LF	Assumed
	CLASSROOM	CARPET MASTIC	480 SF	Assumed
	CLASSROOM	CHALK BOARD	24 SF	Assumed
	CLASSROOM	VINYL WALL COVER	1,800 SF	Assumed
	CLASSROOM	VINYL WALL COVER MASTIC	1,800 SF	Assumed
	CLASSROOM 900	VINYL WALL COVER	1,800 SF	Assumed
	CLASSROOM 900	VINYL WALL COVER MASTIC	1,800 SF	Assumed
	CLASSROOM AND RESTROOMS	VINYL SHEETING	480 SF	Assumed
<b>METAL STORAGE CONTAINERS (3 EA)</b>				
<b>PORTABLE NEXT TO P6</b>				
	PORTABLE NEXT TO P6	PORTABLE BUILDING	900 SF	New Material

End Of Report, Total Of 4 Pages

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ALL OFFICES, AND HALLWAY TO STAGE

CARPET MASTIC 4,430 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

ATTIC / PLENUM

PIPE FITTING INSULATION (TBD) LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC 116 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 546 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 24,500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

SMOOTH WALL SURFACING 24,500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM

BASEBOARD MASTIC 1,420 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL 17,180 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-



# RECOMMENDATIONS FOR NORTHWOOD ELEMENTARY SCHOOL

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING 17,180 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE 1,490 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**KITCHEN**

VINYL SHEETING 572 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

---

**KITCHEN**

VINYL SHEETING BACKING PAPER/MASTIC 572 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE 60 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC 60 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE 2,530 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE 4,200 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE MASTIC 4,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

---

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER 18,680 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC 18,680 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

PTA ROOM

VINYL FLOOR TILE 144 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

PTA ROOM

VINYL FLOOR TILE MASTIC 144 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS 640 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS 270 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING 8 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**WOMENS RESTROOM**

MORTAR MISCELLANEOUS 120 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**BUS LOOP**

**EXTERIOR WALL**

PAPER TYPE INSULATION 800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**EXTERIOR WALL**

ROUGH WALL 800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**EXTERIOR WALL**

ROUGH WALL SURFACING 800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**CLASSROOM P6 (803)**

CLASSROOM 6(803)

PERMANENT BUILDING

960 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

ALL ROOMS AND CLOSETS

BASEBOARD MASTIC

90 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201 AND 202

CARPET MASTIC

1,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201 AND 202

SUSPENDED CEILING TILE

2,600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

CLASSROOMS 201 AND 202

VINYL WALL COVER 1,600 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

CLASSROOMS 201 AND 202

VINYL WALL COVER MASTIC 1,600 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS 2,600 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING 2,600 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE 1,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS

VINYL FLOOR TILE MASTIC 1,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CLASSROOMS 201-202

SINK UNDERCOATING 8 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

CUSTODIAN ROOM AND BOILER ROOM

BASEBOARD MASTIC 80 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 210 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.



**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**EXTERIOR WALLS**

ROUGH WALL 3,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**EXTERIOR WALLS**

ROUGH WALL SURFACING 3,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**EXTERIOR WINDOWS**

CAULKING 200 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RESTROOMS**

MORTAR MISCELLANEOUS 200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM

MORTAR MISCELLANEOUS 560 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STUDENT RESTROOMS

MORTAR MISCELLANEOUS 300 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER 29,000 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC 29,000 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM**

MORTAR MISCELLANEOUS 350 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS**

SUSPENDED CEILING TILE 9,400 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS**

BASEBOARD MASTIC 1,400 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**CLASSROOMS 301-306, HALLWAY, AND F.I.S.**

CARPET MASTIC 7,684 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS 700 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS 70 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 672 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS 37,800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING 37,800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL 7,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS AND OVERHANG ON RESTROOMS

ROUGH WALL SURFACING 7,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS AND DOORS

CAULKING 900 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**FLEXIBLE INSTRUCTIONAL SPACE**

VINYL FLOOR TILE 756 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**FLEXIBLE INSTRUCTIONAL SPACE**

VINYL FLOOR TILE MASTIC 756 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**TEACHERS' WORK ROOM, AND CLASSROOMS 301-308**

SINK UNDERCOATING 28 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM**

VINYL FLOOR TILE 1,560 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM**

VINYL FLOOR TILE MASTIC 1,560 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**WATER HEATER ROOM (NEXT TO RESTROOMS)**

BASEBOARD MASTIC 15 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

---

**ALL CLASSROOMS**

CARPET MASTIC 7,600 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
- 

**ALL CLASSROOMS, AND LIBRARY**

SUSPENDED CEILING TILE 8,400 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**ALL ROOMS**

BASEBOARD MASTIC 1,400 LF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**BOYS AND GIRLS RESTROOMS AND STORAGE ROOM**

MORTAR MISCELLANEOUS 350 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**CLASSROOMS, AND LIBRARY**

VINYL WALL COVER 29,880 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**CLASSROOMS, AND LIBRARY**

VINYL WALL COVER MASTIC 29,880 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**ENTIRE BUILDING**

CEMENTITIOUS MISCELLANEOUS 50 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-



**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 399 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 38,100 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

SMOOTH WALL SURFACING 38,100 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL 7,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR NORTHWOOD ELEMENTARY SCHOOL

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**EXTERIOR WALLS, AND OVERHANG OF RESTROOMS**

ROUGH WALL SURFACING 7,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**EXTERIOR WINDOWS**

CAULKING 900 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS**

MORTAR MISCELLANEOUS 700 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**LIBRARY STORAGE**

BASEBOARD MASTIC 50 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

# RECOMMENDATIONS FOR NORTHWOOD ELEMENTARY SCHOOL

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

LIBRARY STORAGE

VINYL FLOOR TILE 144 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

LIBRARY STORAGE

VINYL FLOOR TILE MASTIC 144 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

TEACHERS' WORK ROOM, AND LIBRARY

SINK UNDERCOATING 24 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS

VINYL FLOOR TILE 2,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS**

VINYL FLOOR TILE MASTIC 2,200 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**WATER HEATER ROOM AND UTILITY CLOSET**

BASEBOARD MASTIC 40 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

**ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS**

BASEBOARD MASTIC 1,400 LF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**BOYS AND GIRLS RESTROOM**

MORTAR MISCELLANEOUS 120 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**BOYS AND GIRLS RESTROOMS**

MORTAR MISCELLANEOUS 600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**BOYS AND GIRLS RESTROOMS**

MORTAR MISCELLANEOUS 416 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)**

MORTAR MISCELLANEOUS 800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 501-506**

SINK UNDERCOATING 20 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**CLASSROOMS 501-506 AND COMPUTER LAB**

VINYL WALL COVER 30,000 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 501-506 AND COMPUTER LAB**

VINYL WALL COVER MASTIC 30,000 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB**

CARPET MASTIC 8,500 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB**

SUSPENDED CEILING TILE 9,400 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

# RECOMMENDATIONS FOR NORTHWOOD ELEMENTARY SCHOOL

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

VINYL FLOOR TILE 1,540 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

---

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

VINYL FLOOR TILE MASTIC 1,540 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

---

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS 50 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 651 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS 38,500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING 38,500 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING 7,200 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS

ROUGH WALL 7,200 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-



**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**EXTERIOR WINDOWS**

CAULKING

900 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**GIRLS' RESTROOMS**

MORTAR MISCELLANEOUS

600 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**WATER HEATER CLOSET AND STORAGE**

BASEBOARD MASTIC

50 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**CLASSROOMS 801 PORTABLE BUILDING**

---

**CLASSROOM 801**

PORTABLE BUILDING

960 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
- 

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

---

**CLASSROOMS**

BASEBOARD MASTIC

350 LF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS**

COLLAPSIBLE PARTITION WALL

130 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**CLASSROOMS**

SMOOTH WALL MISCELLANEOUS 2,120 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS**

SUSPENDED CEILING TILE 2,040 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS**

VINYL FLOOR TILE 960 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS**

VINYL FLOOR TILE MASTIC 960 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**CLASSROOMS**

VINYL WALL COVER 2,100 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS**

VINYL WALL COVER MASTIC 2,100 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**CLASSROOMS, OFFICE AND STORAGE ROOM**

CARPET MASTIC 1,000 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
- 

**DAYCARE PORTABLE (600)**

SINK UNDERCOATING 10 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**ENTIRE BUILDING**

FIRE DOOR CORE INSULATION 63 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**FOOD PREPERATION AREA**

VINYL SHEETING 90 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**FOOD PREPERATION AREA**

VINYL SHEETING BACKING PAPER/MASTIC 90 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM**

VINYL SHEETING 140 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC 140 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM

BASEBOARD MASTIC 140 LF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOM

CARPET MASTIC 480 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CLASSROOM

CHALK BOARD 24 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**CLASSROOM**

SUSPENDED CEILING TILE 960 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**CLASSROOM**

VINYL WALL COVER 1,800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**CLASSROOM**

VINYL WALL COVER MASTIC 1,800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

**CLASSROOM 900**

VINYL WALL COVER 1,800 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-

**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

CLASSROOM 900

VINYL WALL COVER MASTIC 1,800 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

CLASSROOM AND RESTROOMS

VINYL SHEETING 480 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

CLASSROOM AND RESTROOMS

VINYL SHEETING BACKING PAPER/MASTIC 480 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

---

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 42 SF

- (a) No abatement is necessary.
  - (b) Maintain the material in an intact and undamaged condition.
  - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
  - (d) Include this material in the long term surveillance and re-inspection program
  - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.
-



**RECOMMENDATIONS FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

**DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)**

PORTABLE DAYCARE - SDC

PORTABLE BUILDING 960 SF

- (a) This is a replacement/new material.
- (b) The district should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the district's AHERA records.

**FAMILY RESOURCE CENTER (BUILDING 700)**

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING 1,440 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

**METAL STORAGE CONTAINERS (3 EA)**

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER 480 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

**RECOMMENDATIONS FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

---

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

**RECOMMENDATION**

**QTY**

**(APPROXIMATE)**

---

**MIDDLE QUAD PATIO**

---

MIDDLE QUAD PATIO

PERMANENT BUILDING

1,600 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
- 

**PORTABLE NEXT TO P6**

---

PORTABLE NEXT TO P6

PORTABLE BUILDING

900 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
- 

**WOOD STORAGE SHEDS (2 EA)**

---

WOOD STORAGE SHEDS (2 EA)

STORAGE BUILDING

170 SF

- (a) This is a replacement/new material.
  - (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
  - (c) This documentation is to be maintained with the District's AHERA records.
- 

---

End Of Report, Total Of 36 Pages

---

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
-------------------	-------------	---------------	-------------------------	----------------------	----------------------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ALL OFFICES, AND HALLWAY TO STAGE

CARPET MASTIC

<b>16-213AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ATTIC / PLENUM

PIPE FITTING INSULATION

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<b>14-198AAA</b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<b>10-018 NW-69</b>	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Tape

<b>10-018 NW-69</b>	2/1/2010	Positive	2	CHRYSOTILE	CH
---------------------	----------	----------	---	------------	----

Joint Compound

<b>10-018 NW-70</b>	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Drywall

<b>10-018 NW-73</b>	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

Joint Tape

	2/1/2010	Positive	2	CHRYSOTILE	CH
--	----------	----------	---	------------	----

Joint Compound

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
<b><u>10-018 NW-74</u></b> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
<b><u>16-030-A07</u></b> Storage 121, Drywall Board.	1/28/2016	Negative	ND	NONE DETECTED	ND
<b><u>16-030-A08</u></b> Storage 121, Joint Mud.	1/28/2016	Positive	5%	CHRYSTILE	CH
<b><u>16-030-A13</u></b> MP Room by 122 Door, Drywall.	1/28/2016	Negative	ND	NONE DETECTED	ND
<b><u>16-030-A13</u></b> MP Room by 122 Door, Joint Compound.	1/28/2016	Negative	ND	NONE DETECTED	ND

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ENTIRE BUILDING  
SMOOTH WALL SURFACING

<b><u>10-018 NW-68</u></b>	2/1/2010	Positive	2	CHRYSTILE	CH
<b><u>10-018 NW-72</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
<b><u>16-030-A09</u></b> Storage 121, Skim Coat -Paint.	1/28/2016	Negative	ND	NONE DETECTED	ND
<b><u>16-030-A12</u></b> MP Room by 122 Door, Skim Coat and Mud on Drywall.	1/28/2016	Negative	ND	NONE DETECTED	ND

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM  
BASEBOARD MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)  
ROUGH WALL

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<b>16-030-A10</b> Storage 121, Exterior Stucco.	1/28/2016	Positive	2%	CHRYBOTILE	CH
--	-----------	----------	----	------------	----

<b>16-030-A14</b> MP Room Exterior by Door 122, Stucco.	1/28/2016	Negative	ND	NONE DETECTED	ND
--	-----------	----------	----	---------------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

EXTERIOR WALLS, AND ALL PERIMETER WALLS IN BACK OF BUILDING (UTILITY YARD FOR TRASH CAN ROOM WASHING AREA)

ROUGH WALL SURFACING

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

<b>10-018 NW-71</b>	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

KITCHEN

VINYL SHEETING

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<b>16-030-A04</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Kitchen 122, Green Vinyl Sheeting.

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<b>16-030-A05</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Kitchen 122, Backing Paper for Green Vinyl Sheeting.

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MULTI-PURPOSE ROOM

SUSPENDED CEILING TILE

**08-241AAA**                      10/20/2008    Positive                      ASSUMED                      NO SAMPLE                      NS

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE

**16-213AAA**                      9/15/2016    Negative                      NEW MATERIAL                      NO SAMPLE                      NS

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MULTI-PURPOSE ROOM, NURSES ROOM, STAFF WORK ROOM, AND SERVING AREA

VINYL FLOOR TILE MASTIC

**16-213AAA**                      9/15/2016    Negative                      NEW MATERIAL                      NO SAMPLE                      NS

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

PTA ROOM

VINYL FLOOR TILE

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

PTA ROOM

VINYL FLOOR TILE MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

<b>11-202AAA</b>	12/1/2011	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

STAFF RESTROOMS (2), NURSES' RESTROOM, AND KITCHEN RESTROOM

MORTAR MISCELLANEOUS

<b>11-202AAA</b>	12/1/2011	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

TEACHER'S LOUNGE AND NURSE'S ROOM

SINK UNDERCOATING

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)**

WOMENS RESTROOM

MORTAR MISCELLANEOUS

<b>15-174AAA</b>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**BUS LOOP**

**BUS LOOP**

EXTERIOR WALL

PAPER TYPE INSULATION

<b><u>09-212AAA</u></b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

**BUS LOOP**

EXTERIOR WALL

ROUGH WALL

<b><u>09-212AAA</u></b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

**BUS LOOP**

EXTERIOR WALL

ROUGH WALL SURFACING

<b><u>09-212AAA</u></b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----



**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**CLASSROOM P6 (803)**

**CLASSROOM P6 (803)**

CLASSROOM 6(803)

PERMANENT BUILDING

**19-011AAA**

2/8/2019

Negative

NEW MATERIAL

NO SAMPLE

NS

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE No.</b> <b>COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

ALL ROOMS AND CLOSETS  
BASEBOARD MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202  
CARPET MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202  
SUSPENDED CEILING TILE

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>10-018 NW-61</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202  
VINYL WALL COVER

<b><u>06-223AAA</u></b>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202  
VINYL WALL COVER MASTIC

<b><u>06-223AAA</u></b>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS  
SMOOTH WALL MISCELLANEOUS

<b><u>10-018 NW-63</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Tape

<b><u>10-018 NW-63</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

Joint Compound

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

LOCATION

MATERIAL TYPE

SAMPLE NO. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

<b>10-018 NW-64</b> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

<b>10-018 NW-66</b> Joint Tape	2/1/2010	Negative	ND	NONE DETECTED	ND
-----------------------------------	----------	----------	----	---------------	----

<b>10-018 NW-66</b> Joint Compound	2/1/2010	Positive	2	CHRYSOTILE	CH
---------------------------------------	----------	----------	---	------------	----

<b>10-018 NW-67</b> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS  
SMOOTH WALL SURFACING

<b>10-018 NW-62</b>	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

<b>10-018 NW-65</b>	2/1/2010	Positive	2	CHRYSOTILE	CH
---------------------	----------	----------	---	------------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS  
VINYL FLOOR TILE

<b>16-203AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201 AND 202 WET / SINK AREAS AND STORAGE ROOMS  
VINYL FLOOR TILE MASTIC

<b>16-203AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CLASSROOMS 201-202  
SINK UNDERCOATING

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

CUSTODIAN ROOM AND BOILER ROOM  
BASEBOARD MASTIC

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME	LOCATION	MATERIAL TYPE	SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
---------------	----------	---------------	------------	------	--------	------------------	---------------	---------------

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

ENTIRE BUILDING  
FIRE DOOR CORE INSULATION

<b><u>14-198AAA</u></b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

EXTERIOR WALLS  
ROUGH WALL

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>16-030-A18</u></b>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Exterior Wall by Drinking Fountain, Stucco.

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

EXTERIOR WALLS  
ROUGH WALL SURFACING

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

EXTERIOR WINDOWS  
CAULKING

<b><u>09-212AAA</u></b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

RESTROOMS  
MORTAR MISCELLANEOUS

<b><u>09-098AAA</u></b>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>16-030-A22</u></b>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Classroom 202, Grout for 8"x8" Ceramic Floor Tile.

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

RESTROOMS, ENTRY WAY TO CLASSROOMS, AND CUSTODIAL ROOM  
MORTAR MISCELLANEOUS

<b><u>08-241AAA</u></b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
-------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**CLASSROOMS 201-202 BUILDING (BUILDING 200)**

STUDENT RESTROOMS

MORTAR MISCELLANEOUS

<b><u>15-174AAA</u></b>	9/18/2015	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
-------------------	-------------	---------------	-------------------------	----------------------	----------------------

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

<b>16-030-A36</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Room 303, Demising Wall, Vinyl Cover on Sheetrock Wall.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ALL CLASSROOMS AND F.I.S. ROOM

VINYL WALL COVER MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

BOYS' AND GIRLS' RESTROOMS AND STORAGE ROOM

MORTAR MISCELLANEOUS

<b>08-241AAA</b>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

SUSPENDED CEILING TILE

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

<b>10-018 NW-75</b>	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------	----------	----------	----	---------------	----

<b>16-030-A26</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Workroom 304, 2'x4' Suspended Ceiling Tile.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

CLASSROOMS 301-306, F.I.S. AND STORAGE ROOMS

BASEBOARD MASTIC

<b>16-203AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME	LOCATION	MATERIAL TYPE	SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
COMMENTS								

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

CLASSROOMS 301-306, HALLWAY, AND F.I.S.

CARPET MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE		NS
-------------------------	-----------	----------	--------------	-----------	--	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

CLASSROOMS 301-308, AND RESTROOMS (2)

MORTAR MISCELLANEOUS

<b><u>10-174AAA</u></b>	9/2/2010	Positive	ASSUMED	NO SAMPLE		NS
-------------------------	----------	----------	---------	-----------	--	----

<b><u>16-030-A25</u></b>	1/28/2016	Negative	ND	NONE DETECTED		ND
--------------------------	-----------	----------	----	---------------	--	----

Room 310, Grout for 8"x8" Ceramic Floor Tile.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

<b><u>14-198AAA</u></b>	8/29/2014	Positive	ASSUMED	NO SAMPLE		NS
-------------------------	-----------	----------	---------	-----------	--	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<b><u>14-198AAA</u></b>	8/29/2014	Positive	ASSUMED	NO SAMPLE		NS
-------------------------	-----------	----------	---------	-----------	--	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE		NS
-------------------------	-----------	----------	---------	-----------	--	----

<b><u>10-018 NW-77</u></b>	2/1/2010	Negative	ND	NONE DETECTED		ND
----------------------------	----------	----------	----	---------------	--	----

Joint Tape

<b><u>10-018 NW-77</u></b>	2/1/2010	Negative	ND	NONE DETECTED		ND
----------------------------	----------	----------	----	---------------	--	----

Joint Compound

<b><u>10-018 NW-78</u></b>	2/1/2010	Negative	ND	NONE DETECTED		ND
----------------------------	----------	----------	----	---------------	--	----

Walboard

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE NO. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

<b><u>16-030-A31</u></b> Workroom 304, Wallboard.	1/28/2016	Negative	ND	NONE DETECTED	ND
--	-----------	----------	----	---------------	----

<b><u>16-030-A32</u></b> Workroom 304, Joint Compound.	1/28/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

<b><u>16-030-A35</u></b> Room 303, Demising Wall, Sheetrock Wall.	1/28/2016	Negative	ND	NONE DETECTED	ND
--	-----------	----------	----	---------------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS  
SMOOTH WALL SURFACING

<b><u>06-223AAA</u></b>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>10-018 NW-76</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

EXTERIOR WALLS AND OVERHANG ON RESTROOMS  
ROUGH WALL

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>16-030-A33</u></b> Exterior by Drinking Fountain, Stucco Wall.	1/28/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

EXTERIOR WALLS AND OVERHANG ON RESTROOMS  
ROUGH WALL SURFACING

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

EXTERIOR WINDOWS AND DOORS  
CAULKING

<b><u>09-212AAA</u></b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

<b><u>16-030-A34</u></b> Exterior Door by 304, Interior side, Door Frame Caulking.	1/28/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----



**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE

<b>16-213AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

FLEXIBLE INSTRUCTIONAL SPACE

VINYL FLOOR TILE MASTIC

<b>16-213AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

TEACHERS' WORK ROOM, AND CLASSROOMS 301-308

SINK UNDERCOATING

<b>08-241AAA</b>	10/14/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

<b>16-030-A30</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Workroom 304, Gray Thermal Undercoating on Sink.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

<b>16-030-A27</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Workroom 304, Green 12"x12" Vinyl Floor Tile.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

TEACHERS' WORK ROOM, STORAGE ROOMS, AND STAFF RESTROOM

VINYL FLOOR TILE MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

<b>16-030-A28</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Workroom 304, Yellow Mastic for Green 12"x12" Vinyl Floor Tile.

**CLASSROOMS 301-306 BUILDING (BUILDING 300)**

WATER HEATER ROOM (NEXT TO RESTROOMS)

BASEBOARD MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE No.</b> <b>COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ALL CLASSROOMS  
CARPET MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ALL CLASSROOMS, AND LIBRARY  
SUSPENDED CEILING TILE

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>10-018 NW-57</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ALL ROOMS  
BASEBOARD MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

BOYS AND GIRLS RESTROOMS AND STORAGE ROOM  
MORTAR MISCELLANEOUS

<b><u>14-051AAA</u></b>	3/7/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

CLASSROOMS, AND LIBRARY  
VINYL WALL COVER

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>16-030-A39</u></b>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Library (403), Vinyl Cover on Pressed Wood Wall Panel.

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

CLASSROOMS, AND LIBRARY  
VINYL WALL COVER MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

LOCATION

MATERIAL TYPE

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS

<b>14-18AAA</b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-----------------	-----------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<b>14-198AAA</b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

<b>10-018 NW-59</b> Joint Tape	2/1/2010	Negative	ND	NONE DETECTED	ND
-----------------------------------	----------	----------	----	---------------	----

<b>10-018 NW-59</b> Joint Compound	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------------------------	----------	----------	----	---------------	----

<b>10-018 NW-60</b> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

ENTIRE BUILDING

SMOOTH WALL SURFACING

<b>06-223AAA</b>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

<b>BUILDING NAME</b>					
<b>LOCATION</b>					
<b>MATERIAL TYPE</b>					
<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
<b>COMMENTS</b>					

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

EXTERIOR WINDOWS  
CAULKING

<b>09-212AAA</b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

LIBRARY (400), CLASSROOMS 401-406, AND RESTROOMS  
MORTAR MISCELLANEOUS

<b>10-174AAA</b>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

<b>16-030-A37</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Library, Grout for 8"x8" Ceramic Floor Tile.

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

LIBRARY STORAGE  
BASEBOARD MASTIC

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

LIBRARY STORAGE  
VINYL FLOOR TILE

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

LIBRARY STORAGE  
VINYL FLOOR TILE MASTIC

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

TEACHERS' WORK ROOM, AND LIBRARY  
SINK UNDERCOATING

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS  
VINYL FLOOR TILE

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

TEACHERS' WORK ROOM, AND TWO STORAGE ROOMS  
VINYL FLOOR TILE MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

**CLASSROOMS 400-406 BUILDING (BUILDING 400)**

WATER HEATER ROOM AND UTILITY CLOSET  
BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
-------------------	-------------	---------------	-------------------------	----------------------	----------------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

ALL CLASSROOMS, COMPUTER LAB AND STORAGE ROOMS  
BASEBOARD MASTIC

<b>16-213AAA</b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

BOYS AND GIRLS RESTROOM  
MORTAR MISCELLANEOUS

<b>17-059AAA</b>	4/3/2017	Negative	ND	NO SAMPLE	NS
------------------	----------	----------	----	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

BOYS AND GIRLS RESTROOMS  
MORTAR MISCELLANEOUS

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

BOYS AND GIRLS RESTROOMS  
MORTAR MISCELLANEOUS

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-504 (AND RESTROOMS), AND CLASSROOMS 505 & 506 (AND RESTROOMS)  
MORTAR MISCELLANEOUS

<b>10-174AAA</b>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
------------------	----------	----------	---------	-----------	----

<b>16-030-A43</b>	1/28/2016	Negative	ND	NONE DETECTED	ND
-------------------	-----------	----------	----	---------------	----

Room 517, Mortar for Red 8"x8" Ceramic Floor Tile.

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506  
SINK UNDERCOATING

<b>08-241AAA</b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
------------------	------------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

CARPET MASTIC

<b><u>16-213AAA</u></b>	9/15/2016	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

SUSPENDED CEILING TILE

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

<b><u>10-018 NW-53</u></b>	2/1/2010	Negative	ND	NONE DETECTED	ND
----------------------------	----------	----------	----	---------------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

VINYL FLOOR TILE

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

<b><u>16-030-A44</u></b>	1/28/2016	Negative	ND	NONE DETECTED	ND
--------------------------	-----------	----------	----	---------------	----

Room 507, 12"x12" Green Vinyl Floor Tile.

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

CLASSROOMS 501-506, STORAGE ROOMS AND COMPUTER LAB

VINYL FLOOR TILE MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Apparent New Material as of this date.

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

<b>16-030-A45</b> Room 507, Mastic for 12"x12" Green Vinyl Floor Tile.	1/28/2016	Negative	ND	NONE DETECTED	ND
---	-----------	----------	----	---------------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

ENTIRE BUILDING  
CEMENTITIOUS MISCELLANEOUS

<b>14-198AAA</b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

ENTIRE BUILDING  
FIRE DOOR CORE INSULATION

<b>14-198AAA</b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS  
SMOOTH WALL MISCELLANEOUS

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

<b>10-018 NW-55</b> Joint Tape	2/1/2010	Negative	ND	NONE DETECTED	ND
-----------------------------------	----------	----------	----	---------------	----

<b>10-018 NW-55</b> Joint Compound	2/1/2010	Negative	ND	NONE DETECTED	ND
---------------------------------------	----------	----------	----	---------------	----

<b>10-018 NW-56</b> Drywall	2/1/2010	Negative	ND	NONE DETECTED	ND
--------------------------------	----------	----------	----	---------------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS  
SMOOTH WALL SURFACING

<b>06-223AAA</b>	8/25/2006	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

EXTERIOR WALLS, AND OVERHANG OF RESTROOMS  
ROUGH WALL SURFACING

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----



**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

EXTERIOR WALLS, AND OVERHANGS OF RESTROOMS  
ROUGH WALL

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

EXTERIOR WINDOWS  
CAULKING

<b><u>09-212AAA</u></b>	9/8/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

GIRLS' RESTROOMS  
MORTAR MISCELLANEOUS

<b><u>08-241AAA</u></b>	10/20/2008	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	------------	----------	---------	-----------	----

**CLASSROOMS 501-506 BUILDING (BUILDING 500)**

WATER HEATER CLOSET AND STORAGE  
BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**CLASSROOMS 801 PORTABLE BUILDING**

**CLASSROOMS 801 PORTABLE BUILDING**

CLASSROOM 801

PORTABLE BUILDING

**08-241AAA**

10/20/2008 Negative

NEW MATERIAL

NO SAMPLE

NS

New 2008 Construction Relocatable Building per Manufacturer's Tag information.

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
BASEBOARD MASTIC

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
COLLAPSIBLE PARTITION WALL

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
SMOOTH WALL MISCELLANEOUS

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
SUSPENDED CEILING TILE

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
VINYL FLOOR TILE

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
VINYL FLOOR TILE MASTIC

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
VINYL WALL COVER

**05-212AAA**                      9/14/2005    Positive                      ASSUMED                      NO SAMPLE                      NS

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

BUILDING NAME	LOCATION	MATERIAL TYPE	SAMPLE No.	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
---------------	----------	---------------	------------	------	--------	------------------	---------------	---------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS  
VINYL WALL COVER MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

CLASSROOMS, OFFICE AND STORAGE ROOM  
CARPET MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

DAYCARE PORTABLE (600)  
SINK UNDERCOATING

<b><u>10-174AAA</u></b>	9/2/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

ENTIRE BUILDING  
FIRE DOOR CORE INSULATION

<b><u>14-198AAA</u></b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

FOOD PREPERATION AREA  
VINYL SHEETING

<b><u>15-042AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

FOOD PREPERATION AREA  
VINYL SHEETING BACKING PAPER/MASTIC

<b><u>15-042AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM  
VINYL SHEETING

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
-------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)**

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

<b>05-212AAA</b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**  
**LOCATION**  
**MATERIAL TYPE**

<b>SAMPLE No.</b> <b>COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM  
BASEBOARD MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM  
CARPET MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM  
CHALK BOARD

<b><u>09-098AAA</u></b>	5/14/2009	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM  
SUSPENDED CEILING TILE

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM  
VINYL WALL COVER

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM  
VINYL WALL COVER MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM 900  
VINYL WALL COVER

<b><u>10-052AAA</u></b>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM 900

VINYL WALL COVER MASTIC

<b><u>10-052AAA</u></b>	3/10/2010	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM AND RESTROOMS

VINYL SHEETING

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

CLASSROOM AND RESTROOMS

VINYL SHEETING BACKING PAPER/MASTIC

<b><u>05-212AAA</u></b>	9/14/2005	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)**

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

<b><u>14-198AAA</u></b>	8/29/2014	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

**SAMPLES REPORT FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No. COMMENTS</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
--------------------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)**

**DAYCARE PORTABLE BUILDING - SDC (BUILDING 800)**

PORTABLE DAYCARE - SDC

PORTABLE BUILDING

**05-212.NS**

9/14/2005

Negative

NEW MATERIAL

NO SAMPLE

NS

New 1996 Construction Relocatable Building per Manufacturer's Tag information.



**SAMPLES REPORT FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**FAMILY RESOURCE CENTER (BUILDING 700)**

**FAMILY RESOURCE CENTER (BUILDING 700)**

DAYCARE PORTABLE BUILDING - STATE

PORTABLE BUILDING

<b><u>08-075AAA</u></b>	4/21/2008	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	-----------	----------	--------------	-----------	----

New 2007 Construction Relocatable Building per Manufacturer's Tag information.

**SAMPLES REPORT FOR  
NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**METAL STORAGE CONTAINERS (3 EA)**

**METAL STORAGE CONTAINERS (3 EA)**

METAL STORAGE CONTAINERS (3 EA)

STORAGE CONTAINER

<b><u>16-074.NS</u></b>	3/21/2016	Positive	ASSUMED	NO SAMPLE	NS
-------------------------	-----------	----------	---------	-----------	----

Metal Storage Structure.

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**MIDDLE QUAD PATIO**

**MIDDLE QUAD PATIO**

MIDDLE QUAD PATIO

PERMANENT BUILDING

**15-174.NS**

9/18/2015 Negative

NEW MATERIAL NO SAMPLE

NS

Apparent New Metal and Concrete Construction Building.

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

SAMPLE No. COMMENTS	DATE	RESULT	ASBESTOS CONTENT	ASBESTOS NAME	ASBESTOS TYPE
------------------------	------	--------	---------------------	------------------	------------------

**PORTABLE NEXT TO P6**

**PORTABLE NEXT TO P6**

PORTABLE NEXT TO P6

PORTABLE BUILDING

<b><u>19-011AAA</u></b>	2/8/2019	Negative	NEW MATERIAL	NO SAMPLE	NS
-------------------------	----------	----------	--------------	-----------	----

**SAMPLES REPORT FOR**  
**NORTHWOOD ELEMENTARY SCHOOL**

**BUILDING NAME**

**LOCATION**

**MATERIAL TYPE**

<b>SAMPLE No.</b>	<b>DATE</b>	<b>RESULT</b>	<b>ASBESTOS CONTENT</b>	<b>ASBESTOS NAME</b>	<b>ASBESTOS TYPE</b>
-------------------	-------------	---------------	-----------------------------	--------------------------	--------------------------

**WOOD STORAGE SHEDS (2 EA)**

**WOOD STORAGE SHEDS (2 EA)**

WOOD STORAGE SHEDS (2 EA)  
STORAGE BUILDING

<b>09-098AAA</b>	5/14/2009	Negative	NEW MATERIAL	NO SAMPLE	NS
------------------	-----------	----------	--------------	-----------	----

Wood Construction Structures.

---

**End Of Report, Total Of 35 Pages**

---

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM

BASEBOARD MASTIC

116 LF

**P:** Less Than 5%

**W:** No Evidence

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
08/25/2006	Book Storage Room added to Location. 30 LF added to quantity. Location Name changed from CUSTODIAL ROOM, AND PANTRY ROOM to BOOK STORAGE ROOM, CUSTODIAL ROOM, AND PANTRY ROOM. Quantity changed from 86 LF to 116 LF to reflect this fact. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 LF Damage and Missing Baseboard in Book Storage Room. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS	24,500 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
---------------------------	-----------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damage: <5% Physical Damage - in exterior Water Heater Room; <10% Water Damage - in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.
03/09/2007	Damage: <10% Water Damage - approximately 20 SF in Kitchen. Condition changed to reflect this fact. No other changes as of this date.
11/09/2007	This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.
04/21/2008	Damage in the Water Heater Room is on all Walls. No other changes as of this date.
10/20/2008	Exterior Water Heater Room has 3/4 of Ceiling missing. <10% Water Damage. No other changes as of this date.
05/14/2009	Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.
09/08/2009	Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.
02/01/2010	Samples 10-019 NW-69 (Joint Tape / Compound), NW-70 (Drywall) , NW-73 (Joint Tape / Compound) and NW-74 (Drywall) collected on this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. Pantry by Exhuast has minor cuts and holes. No other change as of this date.
01/28/2016	Sample 16-030-A07 collected from Storage 121, Drywall Board. Sample 16-030-A08 collected from Storage 121, Joint Mud. Sample 16-030-A13 collected from Multi-purpose Room by 122 Door, Drywall.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### ENTIRE BUILDING

SMOOTH WALL SURFACING

24,500 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED FRIABLE SURFACING ACM

08/25/2006 Skim Coat for Gypsum Wallboard System. (Material also exists behind Vinyl Covered Wall Panels in some areas). Damages noted in exterior Water Heater Room. This Material is in FAIR condition overall as of this date.

03/09/2007 Damage: <10% Water Damage - approximately 20 SF in in Kitchen. Condition changed to reflect this fact. No other changes as of this date.

11/09/2007 This Material in POOR condition in Water Heater Room. This Material is in FAIR condition overall as of this date.

10/20/2008 Exterior Water Heater Room has 3/4 of Ceiling is missing. <10% Water Damage. No other changes as of this date.

05/14/2009 Additional Damage observed. 2 SF is Water Damaged in the Pantry by the Exhaust. Material is cracked on the East and South Walls of the Book Storage Room/ Conference Room (Old Custodial Room). No other changes as of this date.

09/08/2009 Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.

02/01/2010 Samples 10-019 NW-68 and NW-72 collected on this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 Additional Damage observed. Pantry by Exhuast has minor cuts and holes. No other change as of this date.

01/28/2016 Sample 16-030-A09 collected from Storage 121, Paint. Sample 16-030-A12 collected from MP Room by 122 Door, Skim Coat and Mud on Drywall.

03/21/2016 This Material is unchanged as of this date.



# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W):
	MATERIAL TYPE		
	RISK ASSESMENT CATEGORY		
	COMMENTS		

09/15/2016	Partial Repairs observed. Damages noted on 05/14/09 have been covered with a Vinyl Panel. No other changes as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	This Material is unchanged as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

ENTIRE BUILDING EXCEPT CUSTODIAL ROOM AND PANTRY ROOM

BASEBOARD MASTIC

1,420 LF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED FRIABLE SURFACING ACM

09/15/2016	Mastic/Adhesive for 4" and 6" Dark Gray Baseboard. New Material installed during Summer 2016 Flooring project. This Material is in GOOD condition as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Damage Observed. <5% Physical Damage - in the form of 2 LF Loose Baseboard in Hallway near Nurse's Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

02/23/2022 This Material is unchanged as of this date.

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY

SUSPENDED CEILING TILE	1,490 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
------------------------	----------	--

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

- 10/20/2008 2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03./19/15.)
- 05/14/2009 Additional Material identified. Location changed from HALLWAY CONFERENCE ROOM, STAFF ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM. Quantity changed from 1,450 SF to 1,490 SF. 1 Tile is water damaged in the Data Equipment Room next to the air vent. Friability changed from Moderate to High. This Material is in FAIR condition as of this date.
- 09/08/2009 Damage reassessed. There are now a total of 3 Tiles water damaged in Data Equipment Room next to air vent. Material remains in <10% water damage. No other changes as of this date.
- 02/01/2010 Sample 10-019 NW-71 collected on this date.
- 09/02/2010 Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM AND DATA EQUIPMENT ROOM to HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM. Additional damage in the form of 1 Tile is missing in Data Equipment Room. Also, 1 Tile is water stained at Nurses' Room. Data Equipment Room has 1 Tile water damaged. No other changes as of this date.
- 12/01/2011 Location Description changed from HALLWAY CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, AND NURSES' ROOM to HALLWAY OF CONFERENCE ROOM, CONFERENCE ROOM, STAFF ROOM, DATA EQUIPMENT ROOM, NURSES' ROOM, NURSES' CLOSET, PRINCIPAL'S OFFICE, AND LOBBY. Additional Damage - in the form of 1 Tile is Water stained in Lobby. Also, 2 Tiles are missing in Data Equipment Room. Material remains in <5% Physical Damage and <10% Water Damage. No other changes as of this date.
- 03/07/2014 This Material is unchanged as of this date.
- 08/29/2014 This Material is unchanged as of this date.
- 03/19/2015 Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.
- 09/18/2015 Damage Re-Assessed. Repairs made to Lobby and Nurse's Room. Damage Re-Assessed and is currently as follows for the following room: Date Equipment Room has 3 Tiles Physically Damaged and 1 Water Damaged. Additional Damage observed, Staff Room has 3 Tiles Physically Damaged. No other change as of this date.
- 03/21/2016 This Material is unchanged as of this date.
- 09/15/2016 This Material is unchanged as of this date.
- 04/03/2017 Additional Damage Observed. Data Room now has 2 Tile with Physical Damage, 1 Tile is Missing and 1 has Water Damage. No other changes as of this date.
- 08/30/2017 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>RISK ASSESSMENT CATEGORY</b>	<b>COMMENTS</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)</b>
----------------------	-----------------	----------------------	---------------------------------	-----------------	------------------------------	---

02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				Additional Damage Observed. <5% Physical Damage in the form of a total of 2 Ceiling Tiles with Water Stains in the Data Equipment Room. Staff Room has 2 SF of Water Stains on various Ceiling Tiles and 1 Broken Tile. Material Condition remains in FAIR condition overall. No other changes as of this date.		
01/31/2020				This Material is unchanged as of this date.		
09/01/2020				This Material is unchanged as of this date.		
02/12/2021				This Material is unchanged as of this date.		
08/13/2021				This Material is unchanged as of this date.		
02/23/2022				This Material is unchanged as of this date.		

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN

VINYL SHEETING	572 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
----------------	--------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005				Green Vinyl Sheeting. This Material is in GOOD condition as of this date.		
08/25/2006				Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.		
10/11/2012				Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.		
03/07/2014				This Material is unchanged as of this date.		
08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				This Material is unchanged as of this date.		
01/28/2016				Sample 16-030-A04 collected from Kitchen 122, Green Vinyl Sheeting.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				This Material is unchanged as of this date.		
04/03/2017				This Material is unchanged as of this date.		
08/30/2017				This Material is unchanged as of this date.		
02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

572 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Backing Paper/Adhesive for Green Vinyl Sheeting. This Material is in GOOD condition as of this date.  
08/25/2006 Material Re-Assessed. (Apparent New Material identified by the AHERA accredited Inspector). Recommendation changed to reflect this status. No other changes as of this date.  
10/11/2012 Damage: <5% Physical Damage - in the form of 1 SF is Damaged. Material condition changed from GOOD to FAIR overall as of this date.  
03/07/2014 This Material is unchanged as of this date.  
08/29/2014 This Material is unchanged as of this date.  
03/19/2015 This Material is unchanged as of this date.  
09/18/2015 This Material is unchanged as of this date.  
01/28/2016 Sample 16-030-A05 collected from Kitchen 122, Backing Paper for Green Vinyl Sheeting.  
03/21/2016 This Material is unchanged as of this date.  
09/15/2016 This Material is unchanged as of this date.  
04/03/2017 This Material is unchanged as of this date.  
08/30/2017 This Material is unchanged as of this date.  
02/16/2018 This Material is unchanged as of this date.  
08/15/2018 This Material is unchanged as of this date.  
02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN PANTRY CLOSET

VINYL FLOOR TILE 60 SF P: Less Than 5%  
W: No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.  
10/11/2012 Damage: <5% Physical Damage - in the form of 1 Tile is missing, 3 Tiles are broken, and Mastic/Adhesive is exposed. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Non-Friable to Friable to reflect this change.  
03/07/2014 2 additional Tiles are broken and Mastic/Adhesive is exposed. No other changes as of this date.  
08/29/2014 This Material is unchanged as of this date.  
03/19/2015 This Material is unchanged as of this date.  
09/18/2015 This Material is unchanged as of this date.  
03/21/2016 This Material is unchanged as of this date.  
09/15/2016 This Material is unchanged as of this date.  
04/03/2017 Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.  
08/30/2017 This Material is unchanged as of this date.  
02/16/2018 This Material is unchanged as of this date.  
08/15/2018 This Material is unchanged as of this date.  
02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	-------------------	--

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### KITCHEN PANTRY CLOSET

VINYL FLOOR TILE MASTIC

60 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 9"X9" Red Vinyl Floor Tile. This Material is in GOOD condition as of this date.
03/07/2014	6 Tiles are broken and Mastic/Adhesive is exposed. This Material is in FAIR condition. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Additional Damage Observed. 8 Tiles Broken with Mastic Exposed and 4 Tiles Loose. 2 SF of Water Damage and debris at back of the closet. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### MULTI-PURPOSE ROOM

SUSPENDEd CEILING TILE

2,530 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	2'x2' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern.10 Tiles have Water Stains. This Material is in FAIR condition as of this date. (Original Entry updated 03/19/15.)
------------	--

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

09/08/2009	Material remains in <10% Water Damage. Also, <5% Physical Damage in the form of 1 broken Tile. No other changes as of this date.					
04/05/2013	Damage Re-Assessed. Only 1 Tile is Water stained. Material remains in FAIR condition. No other changes as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.					
09/18/2015	Damage Re-Assessed. Damage is currently as follows for the following room: Multipurpose Room has 4 Tiles Water Damaged and 1 Tile Physically Damaged. No other changes as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	Additional Damage observed. Multi-Purpose Room has 8 Tiles with Damage in the form of stains. No other changes as of this date.					
04/03/2017	Additional Damage Observed. Multi-Purpose Room now has 12 Tiles with Water Damage. No other changes as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER

18,680 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	4'X8' Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.					
03/07/2014	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				This Material is unchanged as of this date.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				This Material is unchanged as of this date.		
04/03/2017				This Material is unchanged as of this date.		
08/30/2017				Damage Observed. <5% Physical Damage - in the form of Several areas have Scrapes in the Materail. Material condition changed from GOOD to FAIR overall. No other changes as of this date.		
02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				This Material is unchanged as of this date.		
01/31/2020				Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.		
09/01/2020				Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.		
02/12/2021				This Material is unchanged as of this date.		
08/13/2021				This Material is unchanged as of this date.		
02/23/2022				This Material is unchanged as of this date.		

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### MULTI-PURPOSE ROOM, OFFICES, AND HALLWAYS

VINYL WALL COVER MASTIC

18,680 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005				Mastic/Adhesive for Vinyl Covered Wall Panels, (over Gypsum Wallboard System). This Material is in GOOD condition as of this date.		
03/07/2014				This Material is unchanged as of this date.		
08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				This Material is unchanged as of this date.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				This Material is unchanged as of this date.		



# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

04/03/2017	This Material is unchanged as of this date.					
08/30/2017	Damage Observed. <5% Physical Damage - in the form of Several areas have Scrapes in the Materail. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	Additional Damage Observed. 1 SF of Loose Peeling Vinyl Floor Wall in Staff Lounge. No other changes as of this date.					
09/01/2020	Additional Damage Observed. In Multi-Purpose Room 1 SF of Torn Vinyl Wall Cover on North Wall. 4 SF of Torn Vinyl Wall Cover on South Wall. No other changes as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### PTA ROOM

VINYL FLOOR TILE	144 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
------------------	--------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.					
03/07/2014	Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	-------------------	--

02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

### ADMINISTRATION AND MULTI-PURPOSE ROOM BUILDING (BUILDING 100)

#### PTA ROOM

VINYL FLOOR TILE MASTIC

144 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date.  
03/07/2014 Location name changed from CONFERENCE ROOM (OLD CUSTODIAN ROOM) to PTA ROOM. 1 Tile is broken and Mastic/Adhesive is exposed. No other changes as of this date.  
08/29/2014 This Material is unchanged as of this date.  
03/19/2015 This Material is unchanged as of this date.  
09/18/2015 This Material is unchanged as of this date.  
03/21/2016 This Material is unchanged as of this date.  
09/15/2016 This Material is unchanged as of this date.  
04/03/2017 This Material is unchanged as of this date.  
08/30/2017 This Material is unchanged as of this date.  
02/16/2018 This Material is unchanged as of this date.  
08/15/2018 This Material is unchanged as of this date.  
02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

CLASSROOMS 201 AND 202

SUSPENDED CEILING TILE

2,600 SF

**P:** No Visible Damage

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	3 Tiles are Water Stained in Classroom 202. No other changes as of this date.
09/08/2009	Material remains in <10% Water Damage and in FAIR condition. This Material is unchanged as of this date.
02/01/2010	Sample 10-019 NW-61 collected on this date.
03/11/2010	Additional Damage observed in Classroom 201 has 1 Tile Water Damaged. No other changes as of this date.
09/02/2010	Additional Damage observed in the form of Classroom 202 now had a total of 6 Tiles Water stained. Also, Classroom 201 has an additional 5 Tiles Water Damaged. No other changes as of this date.
12/01/2011	Damages Re-Assessed. Classroom 201, 4 Tiles have been replaced, and 1 remains Water Damaged. Classroom 202 now has a total of 5 Tiles Water stained - 1 has been repaired. No other changes as of this date.
10/11/2012	Material condition Re-Assessed. 4 Water stained Tiles in Classroom 202 have been repaired. Material remains in FAIR condition. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Room 202 now has 2 Tiles with Water stains. No other changes as of this date.
04/03/2017	Additional Damage Observed. <10% Water Damage - in the form of 10 Tiles with Water Damage in Classroom 201. No other changes as of this date.
08/30/2017	Additional Damage Observed. Room 202 has 2 Tiles with Physical Damage in the form of Cracked and Chipped corners. No other changes as of this date.
02/16/2018	Additional Damage Observed. Room 202 now has 5 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201, 4 other Tiles have Water Stains. No other changes as of this date.
08/15/2018	Additional Damage Observed. Room 202 now has 6 Tiles with Water Stains. Partail Repairs made to Tiles in Classroom 201 4 Tiles Replaced 2 Tiles have Water Stains. No other changes as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

#### CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS 2,600 SF P: Less Than 5%  
W: No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.  
03/09/2007 Material changed from Gypsum Wallboard System. ' to ' GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.  
05/14/2009 2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. No other changes as of this date.  
09/08/2009 Material remains in <5% physical damage. This Material is unchanged as of this date.  
02/01/2010 Samples 10-019 NW-63 (Joint Tape / Compound), NW-64 (Drywall), NW-66 (Joint Tape / Compound), and NW-67 (Drywall) collected on this date.  
09/26/2013 Material Re-Assessed. Friability changed from Moderate to Low. Material changed from GOOD to FAIR condition. No other changes as of this date.  
03/07/2014 Friability changed from Low to Moderate. No other changes as of this date.  
08/29/2014 This Material is unchanged as of this date.  
03/19/2015 This Material is unchanged as of this date.  
09/18/2015 Additional Damage observed. Exterior Storage Rooms have minor holes and cuts. No other changes as of this date.  
03/21/2016 This Material is unchanged as of this date.  
09/15/2016 This Material is unchanged as of this date.  
04/03/2017 This Material is unchanged as of this date.  
08/30/2017 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>RISK ASSESMENT CATEGORY</b>	<b>COMMENTS</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)</b>
----------------------	-----------------	----------------------	--------------------------------	-----------------	------------------------------	---

02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				This Material is unchanged as of this date.		
01/31/2020				This Material is unchanged as of this date.		
09/01/2020				Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.		
02/12/2021				This Material is unchanged as of this date.		
08/13/2021				This Material is unchanged as of this date.		
02/23/2022				This Material is unchanged as of this date.		

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

#### CLASSROOMS 201 AND 202, RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING	2,600 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
-----------------------	----------	---

#### DAMAGED FRIABLE SURFACING ACM

08/25/2006				Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.		
03/09/2007				Material Description changed from ' Skim Coat for Gypsum Wallboard System. ' to ' Skim Coat for GYPSUM WALLBOARD SYSTEM, (with 4'x8' Covered Wall Panels in some areas). ' No other changes as of this date.		
05/14/2009				2 SF is Damaged in the Exterior Storage Closets, 1 SF in each, where Exhaust Ducts have been removed. Several holes and cuts observed on the Walls and Ceilings in 2 Storage Closets and the Custodian Room. Friability changed from Low to Moderate. No other changes as of this date.		
09/08/2009				Material remains in <5% Physical Damage. This Material is unchanged as of this date.		
02/01/2010				Samples 10-019 NW-62 and NW-65 collected on this date.		
09/26/2013				Material Re-Assessed. Material changed from GOOD to FAIR condition as of this date. No other changes as of this date.		
03/07/2014				This Material is unchanged as of this date.		
08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				Additional Damage observed, Exterior Storage Rooms have minor holes and cuts. No other change as of this date.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				This Material is unchanged as of this date.		

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	Additional Damage Observed. 2 SF of Missing Wall in Storage Room near Classroom 201. No other changes as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 201-202 BUILDING (BUILDING 200)

#### EXTERIOR WINDOWS

##### CAULKING

200 LF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing degradation of heat and moisture factors and missing portion of material in various locations. This Material is in FAIR condition as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
MATERIAL TYPE			
RISK ASSESMENT CATEGORY			
COMMENTS			

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P): WATER DAMAGE (W):
---------------	----------	---------------	-------------------------	----------	----------------------	---

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS

SUSPENDED CEILING TILE

9,400 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Suspended Ceiling Tile . Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 305 has 3 Tiles Water Stained. RSP Room still has water stains. No other changes as of this date.
05/14/2009	Additional Damage observed. 2 Tiles are Water Damaged in the Storage Room of Classrooms 303 and 304 as of this date.
09/08/2009	Damage Re-Assessed. Additional Damage observed in the form of 2 Tiles are water stained in Classroom 307, and RSP Room has 2 Tiles Water stained. Damage remains in <10% Water Damage. No other changes as of this date.
02/01/2010	Samples 10-019 NW-75 collected on this date.
03/11/2010	Additional Damage observed in the form of Classroom 303 has 2 Tiles Water Damaged. Friability changed from Moderate to High to reflect this change.
09/02/2010	Additional Damage in the form of Classroom 302 has 1 Tile broken and 1 Tile Water stained. Classroom 305 has 2 additional Tiles Water stained. Damages repaired in Storage Room of Classrooms 303 and 304. No other changes as of this date.
12/01/2011	Additional Damage - in the form of Classroom 302 has 1 additional Tile water damaged. No other changes as of this date.
04/05/2013	Material Condition Re-Assessed. Damaged Tiles have been Removed and Replaced with new Tiles in Classrooms 302, 303 and 304. Room 305 still remains Damaged with 2 Water Damaged Tiles. Material remains in FAIR condition. Friability changed from High to Moderate. No other changes as of this date.
03/07/2014	Friability changed from Moderate to High. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. No other changes as of this date.
09/18/2015	Damage Re-Assessed. Repairs made to Room 305 and RSP Room. Classroom 307 has 1 Tile Physically Damaged. Additional Damages observed, Storage Room between Rooms 303 and 304 has 1 Tile Physically Damaged and Storage Room between Rooms 301 and 302 has 2 Tiles Physically Damaged. No other changes as of this date.
01/28/2016	Sample 16-030-A26 collected from Workroom 304, 2'x4' Suspended Ceiling Tile.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Location Description changed. Location Description changed from RSP ROOM, CLASSROOMS 301-306 AND FOUR STORAGE ROOMS to CLASSROOMS 301-306, F.I.S. AND FOUR STORAGE ROOMS. No other changes as of this date.



# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
04/03/2017				Additional Damage Observed. 2 Tiles have Water Damage in Classroom 304. No other changes as of this date.		
08/30/2017				This Material is unchanged as of this date.		
02/16/2018				Additional Damage Observed. 2 Broken Tiles in Classroom 306. Partial Repairs made to Tiles in Classroom 304. Remains in FAIR condition. No other changes as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				This Material is unchanged as of this date.		
01/31/2020				This Material is unchanged as of this date.		
09/01/2020				Additional Damage Observed. 3 Tiles Broken in Work Room Between Classrooms 303 and 304. 5 Cracked Tiles in Classroom 305. 4 Tiles with Water Stains in Classroom 306. No other changes as of this date.		
02/12/2021				Additional Damage Observed. <5% Physical Damage in th form of 1 Tile with Water Stains and 1 Tile with Cracks in Work Room of Classrooms 305 and 306. Material remains in FAIR condition overall. No other changes as of this date.		
08/13/2021				This Material is unchanged as of this date.		
02/23/2022				This Material is unchanged as of this date.		

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL MISCELLANEOUS	37,800 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
---------------------------	-----------	---

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Gypsum Wallboard system, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.
02/01/2010	Samples 10-019 NW-77 (Joint Tape / Compound), and NW-78 (Drywall) collected on this date.
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.
01/28/2016	Sample 16-030-A31 collected from Workroom 304, Wallboard. Sample 16-030-A32 collected from Workroom 304, Joint Compound. Sample 16-030-A35 collected from Room 303, Demising Wall, Sheetrock Wall.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

03/21/2016	This Material is unchanged as of this date.					
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

ENTIRE BUILDING INCLUDING RESTROOMS, UTILITY ROOMS AND STORAGE ROOMS

SMOOTH WALL SURFACING	37,800 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
-----------------------	-----------	---

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System, (with 4'x8' Covered Wall Panels in some areas). This Material is in GOOD condition as of this date.					
02/01/2010	Sample 10-019 NW-76 collected on this date.					
12/01/2011	Damage: <5% Physical Damage - in the form of Storage Room, next to Girls Restroom, approximately 20 SF of Dry Wall has been removed. Material condition changed from GOOD to FAIR overall. No other changes as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	Additional Damage observed. Storage Room next to Girls Restroom has minor holes and cuts. No other changes as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	Material Removed in various locations and Replaced with New as part of the Summer 2016 renovation project. Material Quantity changed from 38,200 SF to 37,800 SF. No other changes as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 301-306 BUILDING (BUILDING 300)

#### EXTERIOR WINDOWS AND DOORS

##### CAULKING

900 LF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows and Doors. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
01/28/2016	Sample 16-030-A34 collected from Exterior Door by 304, Interior side, Door Frame Caulking.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
MATERIAL TYPE			
RISK ASSESMENT CATEGORY			
COMMENTS			

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

ALL CLASSROOMS, AND LIBRARY

SUSPENDED CEILING TILE

8,400 SF

**P:** No Visible Damage  
**W:** <10% Stains or Flaking

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'X4' SUSPENDED CEILING TILE. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
10/20/2008	Classroom 402 has 4 Tiles Water Stained. Classroom 403 has 2 Tiles Water Stained. Classroom 406 has 2 Tiles Water Stained. No other changes as of this date.
05/14/2009	Tiles have been Repaired in Classroom 403. No other changes as of this date.
09/08/2009	Repairs have been made in Classroom 402 and Tiles have been replaced. Material remains in <10% Water Damage and in FAIR condition. No other changes as of this date.
02/01/2010	Sample 10-019 NW-57 collected on this date.
03/11/2010	Material Re-Assessed. Water Damage is located in Classrooms 403 and 406. No other changes as of this date.
09/02/2010	Additional Damage in the form of Library has 4 Tiles Water stained. 1 Tile has been replaced in Classroom 402. Classroom 404 has 1 Tile Water Damaged. 2 Tiles are still Water Damaged in Classroom 406. No other changes as of this date.
12/01/2011	Additional Damage - in the form of Library has 3 more Tiles Water Damaged, Classroom 408 has 2 Tiles Water Damaged, and Classroom 403 has 1 Tile Water Damaged. No other changes as of this date.
04/05/2013	Material condition Re-Assessed. Damaged Tiles have been repaired in Library. Material remains in FAIR condition overall. No other changes as of this date.
09/26/2013	This Material is unchanged as of this date.
03/07/2014	1 Tile is Water Damaged in the Library. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Damages are currently as follows: Classroom 406 has 3 Tiles Water Damaged and Library has 2 Tiles Physically Damaged. Previous Damage noted in Classroom 408 is incorrectly entered and is non-existent. Additional Damages observed; Storage Closet between Rooms 401 and 402 has 1 Tile Physically Damaged and Classroom 401 has 3 Water Damaged Tiles. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Damages clarified. Damages are as follows: 401 has 1 Tile with Water Damage, 402 has 4 Tiles with Water Damage, Workroom for 403 and 404 has 3 Tiles with Water Damage, 404 has 1 Tile with Water Damage, 405 has 3 Tiles with Water Damage, Workroom for 406 has 2 Tiles with Water Damage, and 406 has 4 Tile with Water Damage. No other changes as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

04/03/2017	Additional Damage Observed. 2 Tiles with Water Damage in Classroom 404. No other changes as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	Additional Damage Observed. Classroom 402 now has 6 Tiles with Water Damage on them. No other changes as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### CLASSROOMS, AND LIBRARY

VINYL WALL COVER

29,880 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
01/28/2016	Sample 16-030-A39 collected from Library (403), Vinyl Cover on Pressed Wood Wall Panel.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	Material Re-assessed. Damage in Classroom 401 is not Observed, possibly covered up. Remains in FAIR condition. No other changes as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>RISK ASSESMENT CATEGORY</b>	<b>COMMENTS</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)</b>
----------------------	-----------------	----------------------	--------------------------------	-----------------	------------------------------	---

08/15/2018 This Material is unchanged as of this date.  
02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.  
02/12/2021 This Material is unchanged as of this date.  
08/13/2021 This Material is unchanged as of this date.  
02/23/2022 This Material is unchanged as of this date.

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### CLASSROOMS, AND LIBRARY

VINYL WALL COVER MASTIC

29,880 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 MASTIC/Adhesive FOR VINYL COVERING ON 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.  
03/07/2014 This Material is unchanged as of this date.  
08/29/2014 This Material is unchanged as of this date.  
03/19/2015 This Material is unchanged as of this date.  
09/18/2015 This Material is unchanged as of this date.  
03/21/2016 This Material is unchanged as of this date.  
09/15/2016 Damage observed. Damage: <5% Physical Damage - in the form of 6" tear in the Vinyl in Classroom 401. Material Condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.  
04/03/2017 This Material is unchanged as of this date.  
08/30/2017 This Material is unchanged as of this date.  
02/16/2018 This Material is unchanged as of this date.  
08/15/2018 This Material is unchanged as of this date.  
02/08/2019 This Material is unchanged as of this date.  
08/16/2019 This Material is unchanged as of this date.  
01/31/2020 This Material is unchanged as of this date.  
09/01/2020 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
	MATERIAL TYPE		
	RISK ASSESSMENT CATEGORY		
COMMENTS			

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS	38,100 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
---------------------------	-----------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005 GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. Damage: <5% Physical Damage - in PE Storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.

03/09/2007 Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS.' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.

04/21/2008 50 SF is Damaged above the Double Entry Doors and 2 SF of debris on Floor. Missing Material with broken edges in the center of the ceiling as of this date.

09/08/2009 Previously mentioned 50 SF of Damage is located in PE Storage Room. No other changes as of this date.

02/01/2010 Samples 10-019 NW-59 (Joint Tape / Compound), and NW-60 (Drywall) collected on this date.

09/26/2013 This Material is unchanged as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other changes as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.



# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
	MATERIAL TYPE		
	RISK ASSESMENT CATEGORY		
COMMENTS			

01/31/2020	This Material is unchanged as of this date.		
09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.		
02/12/2021	This Material is unchanged as of this date.		
08/13/2021	This Material is unchanged as of this date.		
02/23/2022	This Material is unchanged as of this date.		

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### ENTIRE BUILDING

SMOOTH WALL SURFACING	38,100 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
-----------------------	-----------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist under 4'X8' Vinyl Covered Wall Pnaels. Damage: <5% Physical Damage - in PE storage Room; Water Damage: <10% - in PE Storage Room. This Material is in FAIR condition overall as of this date.		
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. MATERIAL ASSUMED TO EXIST UNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also located under 4'x8' Vinyl Covered Wall Panels). ' No other unchanges as of this date.		
09/26/2013	This Material is unchanged as of this date.		
03/07/2014	This Material is unchanged as of this date.		
08/29/2014	This Material is unchanged as of this date.		
03/19/2015	This Material is unchanged as of this date.		
09/18/2015	Additional Damage observed. Exterior Storage Closet by Students Restrooms has minor holes and cuts. No other change as of this date.		
03/21/2016	This Material is unchanged as of this date.		
09/15/2016	This Material is unchanged as of this date.		
04/03/2017	This Material is unchanged as of this date.		
08/30/2017	This Material is unchanged as of this date.		
02/16/2018	This Material is unchanged as of this date.		
08/15/2018	This Material is unchanged as of this date.		
02/08/2019	This Material is unchanged as of this date.		
08/16/2019	This Material is unchanged as of this date.		
01/31/2020	This Material is unchanged as of this date.		

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

09/01/2020	Additional Damage Observed. 2 LF Crack in Work Room of Classroom 402. No other changes as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL	7,200 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
------------	----------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Stucco Exterior Walls and Restrooms Overhangs. This Material is in GOOD condition as of this date.					
03/09/2007	Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG OF RESTROOMS. Material Description changed from ' STUCCO oN EXTERIOR WALLS aND RESTROOMS OVERHANG. ' to ' Stucco Exterior Walls and Overhang. ' No other changes as of this date.					
05/14/2009	This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.					
09/08/2009	Material remains in <5% Physical Damage. This Material is unchanged as of this date.					
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### EXTERIOR WALLS, AND OVERHANG OF RESTROOMS

ROUGH WALL SURFACING

7,200 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED FRIABLE SURFACING ACM

09/14/2005 Skim Coat for Stucco on Exterior Walls and Restrooms Overhang. This Material is in GOOD condition as of this date.

03/09/2007 Location Name changed from EXTERIOR to EXTERIOR WALLS, AND OVERHANG OF RESTROOMS. Material Description changed from ' Skim Coat for STUCCO oN EXTERIOR WALLS aND RESTROOMS OVERHANG. ' to ' Skim Coat for Stucco Exterior Walls and Overhang. ' No other changes as of this date.

05/14/2009 This Material has hairline cracks on various surfaces. Friability changed from Non-Friable to Friable. No other changes as of this date.

09/08/2009 Material remains in <5% Physical Damage. This Material is unchanged as of this date.

09/26/2013 Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### EXTERIOR WINDOWS

##### CAULKING

900 LF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009 Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.

03/07/2014 This Material is unchanged as of this date.

08/29/2014 This Material is unchanged as of this date.

03/19/2015 This Material is unchanged as of this date.

09/18/2015 This Material is unchanged as of this date.

03/21/2016 This Material is unchanged as of this date.

09/15/2016 This Material is unchanged as of this date.

04/03/2017 This Material is unchanged as of this date.

08/30/2017 This Material is unchanged as of this date.

02/16/2018 This Material is unchanged as of this date.

08/15/2018 This Material is unchanged as of this date.

02/08/2019 This Material is unchanged as of this date.

08/16/2019 This Material is unchanged as of this date.

01/31/2020 This Material is unchanged as of this date.

09/01/2020 This Material is unchanged as of this date.

02/12/2021 This Material is unchanged as of this date.

08/13/2021 This Material is unchanged as of this date.

02/23/2022 This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P: WATER DAMAGE (W:)</b>
<b>RISK ASSESMENT CATEGORY</b>	<b>COMMENTS</b>			

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### LIBRARY STORAGE

BASEBOARD MASTIC

50 LF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of loose Baseboard in 2 locations exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	Repairs observed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### LIBRARY STORAGE

VINYL FLOOR TILE

144 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
------------	---

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

09/02/2010				Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.		
04/05/2013				Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.		
09/26/2013				This Material is unchanged as of this date.		
03/07/2014				This Material is unchanged as of this date.		
08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other changes as of this date.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.		
04/03/2017				Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.		
08/30/2017				Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.		
02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				This Material is unchanged as of this date.		
01/31/2020				This Material is unchanged as of this date.		
09/01/2020				This Material is unchanged as of this date.		
02/12/2021				This Material is unchanged as of this date.		
08/13/2021				This Material is unchanged as of this date.		
08/13/2021				This Material is unchanged as of this date.		
02/23/2022				This Material is unchanged as of this date.		

### CLASSROOMS 400-406 BUILDING (BUILDING 400)

#### LIBRARY STORAGE

VINYL FLOOR TILE MASTIC

144 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Mastic/Adhesive for 9"x9" Beige Vinyl Floor Tile. This Material is in GOOD condition as of this date.
------------	---

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>RISK ASSESSMENT CATEGORY</b>	<b>COMMENTS</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)</b>
09/02/2010				Damage: <5% Physical Damage - in the form of 1 broken Tile, exposing Mastic/Adhesive. Material condition changed from GOOD to FAIR overall as of this date.		
04/05/2013				Material Condition Re-Assessed. Damages repaired as of this date. Material Condition changed from FAIR to GOOD. No other changes as of this date.		
03/07/2014				This Material is unchanged as of this date.		
08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				Repair noted on 04/05/13 involves the installation of One 9"x9" Green Vinyl Floor Tile. No other change as of this date.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				Additional Damage observed. 2 Tiles are missing exposing Mastic/Adhesive. No other changes as of this date.		
04/03/2017				Material Re-assessed. Missing Tiles have been replaced however, 1 Tile is Broken with Mastic Exposed. Material remains in FAIR condition. No other changes as of this date.		
08/30/2017				Additional Damage Observed. 2 Tiles are Missing Mastic Exposed. No other changes as of this date.		
02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				This Material is unchanged as of this date.		
01/31/2020				This Material is unchanged as of this date.		
09/01/2020				This Material is unchanged as of this date.		
02/12/2021				This Material is unchanged as of this date.		
08/13/2021				This Material is unchanged as of this date.		
02/23/2022				This Material is unchanged as of this date.		

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P: WATER DAMAGE (W:)</b>
<b>RISK ASSESMENT CATEGORY</b>	<b>COMMENTS</b>			

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### BOYS AND GIRLS RESTROOM

MORTAR MISCELLANEOUS

120 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

04/03/2017	Grout/Mortar for 4"x6" Black Base Ceramic Wall Tiles. Damage Observed. <5% Physical Damage - in the form of 1 Tile is Missing, Mastic Exposed in Boy's Restroom. 1 Tile is Loose and 1 Tile is Cracked in Girl's Restroom. Material condition is FAIR. Friability is Low. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### BOYS AND GIRLS RESTROOMS

MORTAR MISCELLANEOUS

600 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

10/20/2008	Grout/Mortar for 4"x4" White Wall Tiles. This Material is in GOOD condition as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.



# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

04/03/2017	Damage Observed. <5% Physical Damage - in the form of 1 Tile Missing Mastic Exposed in Boys Restroom. 1 Tile is Loose from the grout and 1 Tile is cracked in Girls Restroom. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
08/30/2017	Additional Damage Observed. In Girls Restroom 2 Tiles detached and lying on the floor Mastic Exposed.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/21/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER

30,000 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

01/31/2020				This Material is unchanged as of this date.		
09/01/2020				This Material is unchanged as of this date.		
02/21/2021				Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.		
02/23/2022				This Material is unchanged as of this date.		

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### CLASSROOMS 501-506 AND COMPUTER LAB

VINYL WALL COVER MASTIC	30,000 SF	P: Less Than 5% W: No Evidence
-------------------------	-----------	-----------------------------------

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005				Mastic/Adhesive for Vinyl Covering on 4'x8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.		
03/07/2014				This Material is unchanged as of this date.		
08/29/2014				This Material is unchanged as of this date.		
03/19/2015				This Material is unchanged as of this date.		
09/18/2015				Damage observed. Center Classroom has 1/2 SF of Physical Damage. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.		
03/21/2016				This Material is unchanged as of this date.		
09/15/2016				This Material is unchanged as of this date.		
04/03/2017				This Material is unchanged as of this date.		
08/30/2017				This Material is unchanged as of this date.		
02/16/2018				This Material is unchanged as of this date.		
08/15/2018				This Material is unchanged as of this date.		
02/08/2019				This Material is unchanged as of this date.		
08/16/2019				This Material is unchanged as of this date.		
01/31/2020				This Material is unchanged as of this date.		
09/01/2020				This Material is unchanged as of this date.		
02/21/2021				Additional Damage Observed. <5% Physical Damage in the form of 1/4 SF of Missing Vinyl Wall Cover on Wall next to RSP Room. Material remains in FAIR condition overall. No other changes as of this date.		
02/23/2022				This Material is unchanged as of this date.		

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

CLASSROOMS 501-506, AND SCIENCE / COMPUTER LAB

SUSPENDED CEILING TILE

9,400 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with a pitted mark form pattern. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
09/14/2005	This Material is unchanged as of this date.
02/01/2010	Sample 10-019 NW-53 collected on this date.
03/11/2010	Damage: <10% Water Damage - in the form of 1 Tile has Water stains in Classroom 502. Material remains in GOOD condition overall as of this date.
09/02/2010	Damages reassessed and Material is now in <10% Physical Damage. Additional damage observed in the following locations: Classroom 501, 1 Tile water damaged; Storage Room of Classroom 501 and 502, 1 Tile water damaged; Classroom 503, 1 Tile water damaged; Storage Room of Classroom 503 and 504, 1 Tile Water Damaged; Classroom 504, 3 Tiles Water Damaged; Classroom 506, 1 Tile Water Damaged; Between 505/506, 1 Tile Water Damaged and 1 Tile is broken; Classroom 507, 2 Tiles Water Damaged; and, Classroom 508, 3 Tiles broken, and 1 Tile water stained. No other changes as of this date.
12/01/2011	Additional Damage observed - in the form of Classroom 502 and 507 each have 1 broken Tile. Classroom 508 has an additional Tile Water stained. Also, Storage Room of Classroom 501 and 502 has 1 additional Tile Water Damaged. No other changes as of this date.
09/26/2013	Material Re-Assessed. Material changed from GOOD to FAIR condition. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a pitted mark form pattern. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Damage Re-Assessed. Repairs made to following rooms: Classroom 501, Classroom 502 and Classroom 508. Damages are currently as follows for the following rooms: Storage Room between Classrooms 501 and 502 has 2 Tiles Physically Damaged, Classroom 503 has 2 Water Damaged Tiles and 1 Tile Physically Damaged, Storage Room between Classrooms 503 and 504 has 3 Water Damaged Tiles, Classroom 504 has 2 Water Damaged Tiles, Classroom 506 has 2 Water Damaged Tiles, Storage Room between Classrooms 505 and 506 has 1 Physically Damaged Tile and Classroom 507 has 1 Water Damaged Tile and 1 Physically Damaged Tile. Additional Damage observed, Classroom 505 has 3 Tiles Physically Damaged. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Damage is as follows: Room 501 has 2 Tiles with Water Damage and 1 broken Tile; Workroom for 503 and 504 has 1 Tile with Water Damage; Room 506 has 2 Tiles with Water Damage; and Room 508 has 2 Tiles with Water Damage. No other changes as of this date.
04/03/2017	Additional Damage Observed. 4 Tiles have Water Damage and 1 Tile is Broken in Classroom 501. No other changes as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

08/30/2017	This Material is unchanged as of this date.					
02/16/2018	Material Re-assessed. Some Water Damage has been Painted Over. Remains in FAIR condition. No other changes as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	Additional Damage Observed. <5% Physical Damage in the form of a total of 3 Ceiling Tiles with Water Stains in Classroom 506. Material Condition remains in FAIR condition overall. No other changes as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	Additional Damage Observed. 2 Tiles with Water Stains and 1 Tile with 2 LF Crack in Workroom next to RSP Room. No other changes as of this date.					
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 1 Tile with a Cracked Corner in Classroom 502. Material remains in FAIR condition overall. No other changes as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### ENTIRE BUILDING

CEMENTITIOUS MISCELLANEOUS	50 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
----------------------------	-------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/29/2014	Exterior A/C Cementitious Window Panel. Replacement on lower and upper Window Panel. Only on Some areas. This Material is in GOOD condition as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	Damage observed. Damage: <5% Physical Damage - in the form of 1 broken Panel in Room 503. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	Material Re-assessed. Partial Repairs made to Broken Panel in Classroom 503. Panel is Partially Covered with Plywood. No other changes as of this date.					
02/08/2019	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	--

08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL MISCELLANEOUS

38,500 SF

**P:** Less Than 5%

**W:** <10% Stains or Flaking

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.
02/01/2010	Samples 10-019 NW-55 (Joint Tape / Compound), and NW-56 (Drywall) collected on this date.
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of Water Damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
09/26/2013	This Material is unchanged as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESSMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	--------------------------	----------	----------------------	---

02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/21/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

ENTIRE BUILDING INCLUDING RESTROOMS, STORAGE ROOMS AND UTILITY ROOMS

SMOOTH WALL SURFACING	38,500 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
-----------------------	-----------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/25/2006	Skim Coat for Gypsum Wallboard System Walls and Ceilings. Material Assumed to exist Under 4'X8' Vinyl Covered Wall Panels. This Material is in GOOD condition as of this date.
03/09/2007	Material Description changed from ' Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. MATERIAL aSSUMED tO eXIST uNDER 4'X8' VINYL COVERED WALL PANELS. ' to ' Skim Coat for Gypsum Wallboard System Walls and Ceilings. (Material is also under 4'x8' Vinyl Covered Wall Panels). ' No other changes as of this date.
04/12/2012	Damage: <5% Physical Damage - in the form of approximately 1 SF of missing paint on Ceiling, and Joint Tape & Mud is exposed; <10% Water Damage - in the form of water damage observed at Main Entrance, between Classrooms 503 & 504. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
09/26/2013	Friability changed from Moderate to Low. No other changes as of this date.
03/07/2014	Friability changed from Low to Moderate. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Additional Damages observed. Center Classroom has 1/2 SF of Physical Damage, Storage Rooms between Rooms 505 and 506 have minor holes and cuts. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	Additional Damage observed. Classroom 504 has a small hole, approximately 2"x2". No other changes as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/21/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### CLASSROOMS 501-506 BUILDING (BUILDING 500)

#### EXTERIOR WINDOWS

##### CAULKING

**P:** Less Than 5%  
**W:** <10% Stains or Flaking

900 LF

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/08/2009	Caulking on Exterior Windows. Damage: <5% Physical Damage and <10% Water Damage due to existing missing and damaged sections of material, and heat and moisture degradation factors in various locations. This Material is in FAIR condition as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	This Material is unchanged as of this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/21/2021	Additional Damage Observed. <5% Physical Damage in the form of 3 LF of Cracks on Window of Classroom 503. Material remains in FAIR condition overall. No other changes as of this date.					
02/23/2022	This Material is unchanged as of this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

SUSPENDED CEILING TILE	2,040 SF	<b>P:</b> Less Than 5% <b>W:</b> No Evidence
------------------------	----------	---

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. Tiles are White with a smooth texture on fiberglass panel. This Material is in GOOD condition as of this date. (Original Entry updated 03/19/15.)
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
11/09/2007	Material re-assessed. Damage: <5% Physical Damage - due to 14 Tiles with minor holes and cuts. Friability changed from Low to Moderate. Material condition change from GOOD to FAIR overall.
12/01/2011	Additional Damage - in the form of several Tiles are Damaged. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with a smooth texture on fiberglass panel. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.



# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

VINYL FLOOR TILE

960 SF

**P:** Less Than 10%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	12"X12" Pink VINYL FLOOR TILE. <10% of Tile is broken and cracked. This Material is in FAIR condition overall as of this date. (Original entry updated 09/18/15.)
08/25/2006	Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### CLASSROOMS

VINYL FLOOR TILE MASTIC

960 SF

**P:** Less Than 10%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for 12"x12" Pink Vinyl Floor Tile. Damage: <10% Physical Damage - due to broken and cracked Tiles. This Material is in FAIR condition overall as of this date. (Original entry updated 09/18/15)
08/25/2006	Material Quantity changed from 1,265 SF to 960 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
03/07/2014	This Material is unchanged as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	Material Description Re-Assessed. Material is Pink. Material description changed from '12"X12" tan VINYL FLOOR TILE' to ' 12"X12" Pink VINYL FLOOR TILE'. Original entry updated. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Additional Damage Observed. 2 Broken Tiles near Restroom area. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

CLASSROOMS, OFFICE AND STORAGE ROOM

CARPET MASTIC

1,000 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Mastic/Adhesive for Brown and Blue Carpets. This Material is in GOOD condition as of this date.
08/25/2006	Material Quantity changed from 675 SF to 1,000 SF. No other changes as of this date.
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC to CLASSROOMS. No other changes as of this date.
09/02/2010	Material Re-assessed. (Classroom & Office - 95% Brown - ; Carpet in Storage Room - 5% Blue). This Material is unchanged as of this date.
12/01/2011	Location Description changed from CLASSROOMS to CLASSROOMS, OFFICE AND STORAGE ROOM. No other changes as of this date.
03/07/2014	1 SF is Damaged. This Material is in FAIR condition. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	This Material is unchanged as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### FOOD PREPERATION AREA

VINYL SHEETING	90 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
----------------	-------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/19/2015	Light Green Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	Damage Observed. <5% Physical Damage - in the form of 2 SF of Sheeting is Peeling up by Sink Area. Material condition changed from GOOD to FAIR overall. Friability changed from Non-Friable to Friable. No other changes as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

#### FOOD PREPERATION AREA

VINYL SHEETING BACKING PAPER/MASTIC	90 SF	<b>P:</b> Less Than 5% <b>W:</b> <10% Stains or Flaking
-------------------------------------	-------	--

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/19/2015	Backing Paper/Adhesive for Light Green Vinyl Floor Sheeting. This Material is in GOOD condition as of this date.
09/18/2015	This Material is unchanged as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

<b>BUILDING NAME</b>	<b>LOCATION</b>	<b>MATERIAL TYPE</b>	<b>QTY (APPROXIMATE)</b>	<b>PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)</b>
<b>RISK ASSESMENT CATEGORY</b>	<b>COMMENTS</b>			

04/03/2017	Damage Observed. <5% Physical Damage - in the form of 2 SF of Sheeting is Peeling up by Sink Area. Material condition changed from GOOD to FAIR overall. No other changes as of this date.			
08/30/2017	This Material is unchanged as of this date.			
02/16/2018	This Material is unchanged as of this date.			
08/15/2018	This Material is unchanged as of this date.			
02/08/2019	This Material is unchanged as of this date.			
08/16/2019	This Material is unchanged as of this date.			
01/31/2020	This Material is unchanged as of this date.			
09/01/2020	This Material is unchanged as of this date.			
02/12/2021	This Material is unchanged as of this date.			
08/13/2021	This Material is unchanged as of this date.			
02/23/2022	This Material is unchanged as of this date.			

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING

140 SF

**P:** Less Than 5%

**W:** No Evidence

### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.			
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.			
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.			
09/02/2010	Location Description changed from RESTROOMS (2) to RESTROOMS (2 - BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Material located on Walls and Floor. No other changes as of this date.			
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.			
03/07/2014	This Material is unchanged as of this date.			
08/29/2014	This Material is unchanged as of this date.			
03/19/2015	This Material is unchanged as of this date.			
09/18/2015	This Material is unchanged as of this date.			
03/21/2016	This Material is unchanged as of this date.			
09/15/2016	This Material is unchanged as of this date.			

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P:) WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	---

04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.					
08/30/2017	This Material is unchanged as of this date.					
02/16/2018	This Material is unchanged as of this date.					
08/15/2018	This Material is unchanged as of this date.					
02/08/2019	This Material is unchanged as of this date.					
08/16/2019	This Material is unchanged as of this date.					
01/31/2020	This Material is unchanged as of this date.					
09/01/2020	This Material is unchanged as of this date.					
02/12/2021	This Material is unchanged as of this date.					
08/13/2021	This Material is unchanged as of this date.					
02/23/2022	This Material is unchanged as of this date.					

### DAYCARE PORTABLE BUILDING - CDC (BUILDING 600)

RESTROOMS (1 EA BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM

VINYL SHEETING BACKING PAPER/MASTIC

140 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	Backing Paper/Adhesive for Beige Vinyl Sheeting. This Material is in GOOD condition as of this date.					
08/25/2006	Material Quantity changed from 100 SF to 140 SF. No other changes as of this date.					
03/09/2007	Location Name changed from PORTABLE DAYCARE - CDC TWO RESTROOMS to RESTROOMS (2). No other changes as of this date.					
12/01/2011	Location Description changed from RESTROOMS (2) to RESTROOMS (1 EA- BOYS' AND GIRLS'), STAFF ROOM, AND CUSTODIAN ROOM. Damage: <5% Physical Damage - in the form of approximately 4 SF is missing in Custodian Room. Material condition changed from GOOD to FAIR overall as of this date.					
03/07/2014	This Material is unchanged as of this date.					
08/29/2014	This Material is unchanged as of this date.					
03/19/2015	This Material is unchanged as of this date.					
09/18/2015	This Material is unchanged as of this date.					
03/21/2016	This Material is unchanged as of this date.					
09/15/2016	This Material is unchanged as of this date.					
04/03/2017	Additional Damage Observed. 1 SF of Cracked and Broken Flooring in Both the Boys Restroom and Girls Restroom. No other changes as fo this date.					

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
		<b>RISK ASSESMENT CATEGORY</b>		
		<b>COMMENTS</b>		

02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.

# DAMAGE REPORT FOR

## NORTHWOOD ELEMENTARY SCHOOL

BUILDING NAME	LOCATION	MATERIAL TYPE	RISK ASSESMENT CATEGORY	COMMENTS	QTY (APPROXIMATE)	PHYSICAL DAMAGE (P: WATER DAMAGE (W:)
---------------	----------	---------------	-------------------------	----------	----------------------	--

### DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

### DAYCARE PORTABLE BUILDING - FED CHILDCARE (BUILDING 900)

#### CLASSROOM

SUSPENDED CEILING TILE

960 SF

**P:** Less Than 5%

**W:** No Evidence

#### DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/14/2005	2'x4' Suspended Ceiling Tile. Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. This Material is in GOOD condition as of this date. (Original entry updated 03/19/15).
12/01/2011	Damage: <5% Physical Damage - in the form of Restroom has 2 broken Tiles and 1 hole observed; <10% Water Damage - in the form of 1 Tile is Water Damaged. Material condition changed from GOOD to FAIR overall as of this date. No other changes as of this date.
03/07/2014	Water Damaged Tiles have been replaced. No other changes as of this date.
08/29/2014	This Material is unchanged as of this date.
03/19/2015	Tiles are White with 'chicken feet' mark form pattern. Some replacement Tiles have a pin hole form pattern. Some replacement Tiles are White with a rough texture form pattern on a plastic cover on yellow fiberglass panel. Original Entry updated. This Material is unchanged as of this date.
09/18/2015	Additional Damage observed. 2 Tiles Water Damaged, and Classroom has 4 Tiles Physically Damaged. No other changes as of this date.
03/21/2016	This Material is unchanged as of this date.
09/15/2016	This Material is unchanged as of this date.
04/03/2017	This Material is unchanged as of this date.
08/30/2017	This Material is unchanged as of this date.
02/16/2018	This Material is unchanged as of this date.
08/15/2018	This Material is unchanged as of this date.
02/08/2019	This Material is unchanged as of this date.
08/16/2019	This Material is unchanged as of this date.
01/31/2020	This Material is unchanged as of this date.
09/01/2020	This Material is unchanged as of this date.
02/12/2021	This Material is unchanged as of this date.
08/13/2021	This Material is unchanged as of this date.
02/23/2022	This Material is unchanged as of this date.


End Of Report, Total Of 51 Pages









Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field

Park

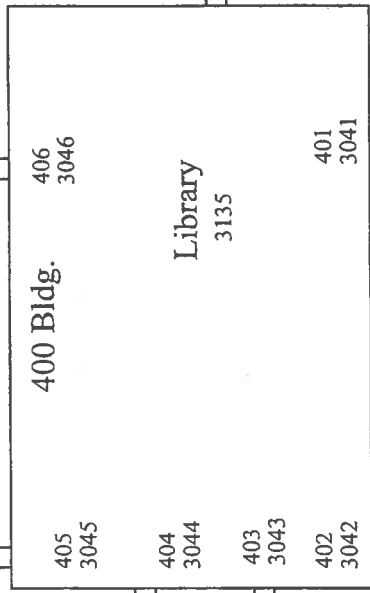


Playground

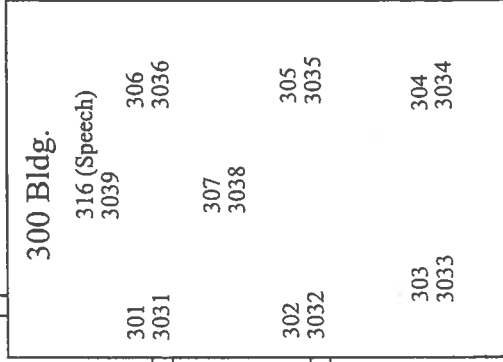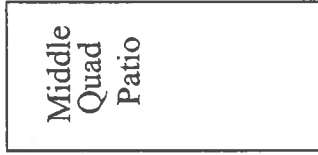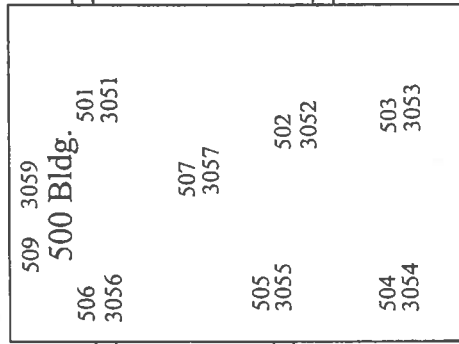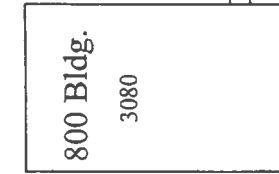
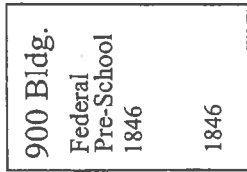


Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 02-22-2022

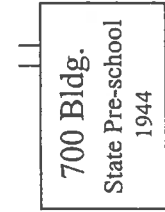

Playground

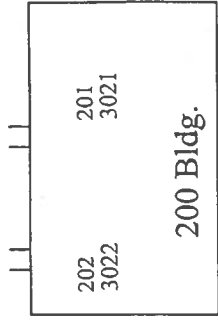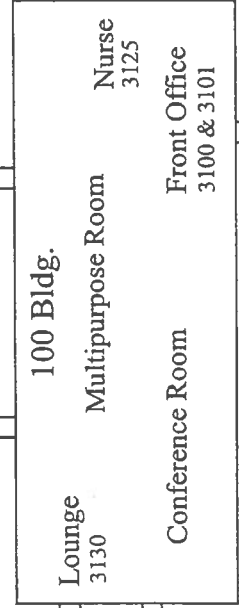

Parking Lot


Trimble Road

Lakewood Drive







Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field




Park

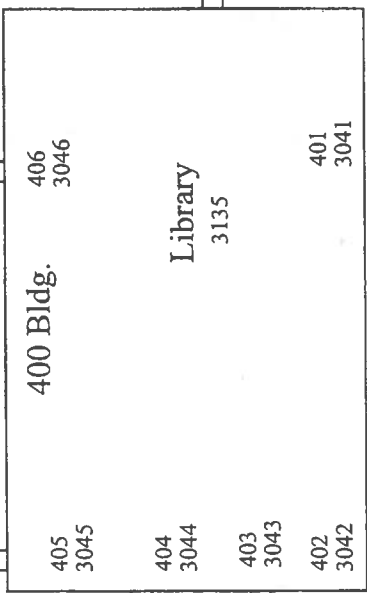

Playground

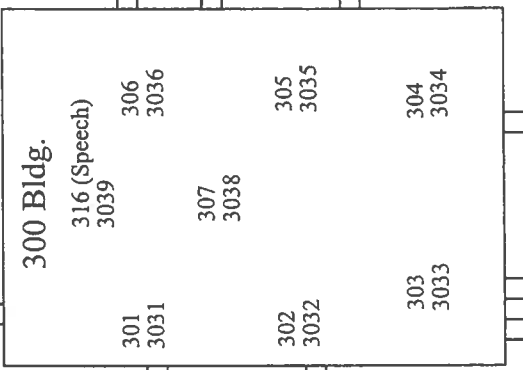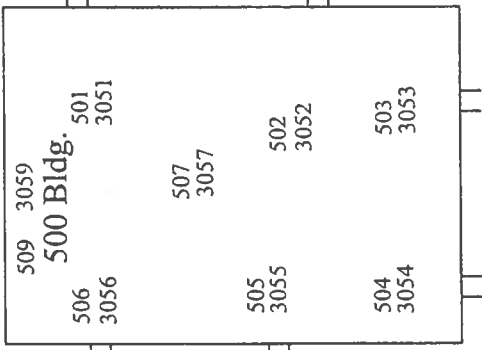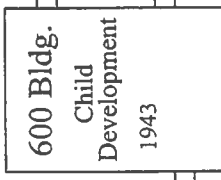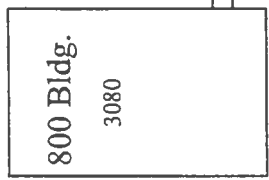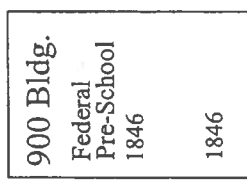


Playground

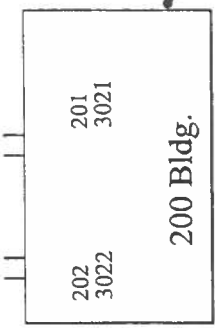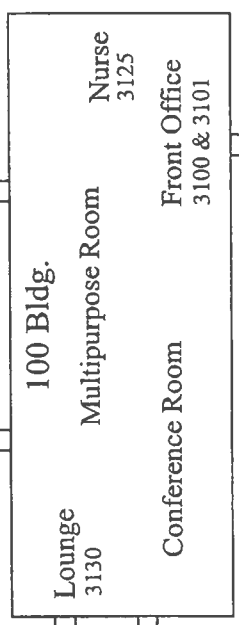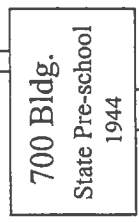

Parking Lot

Trimble Road

Lakewood Drive




NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 12/31/8








Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field



Park

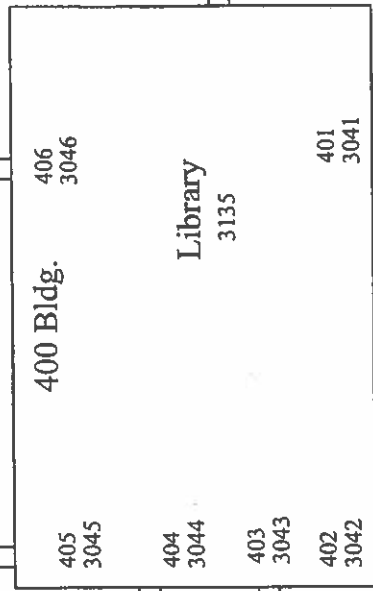

Playground

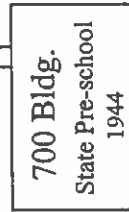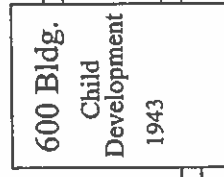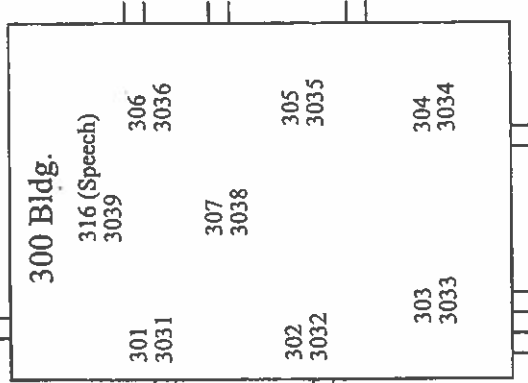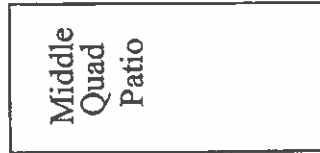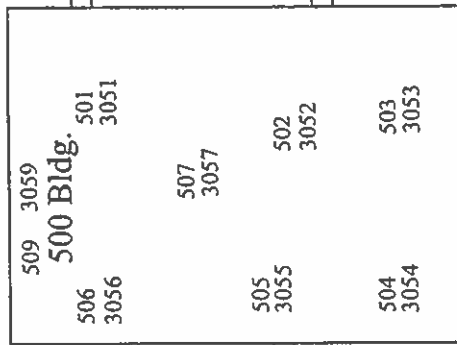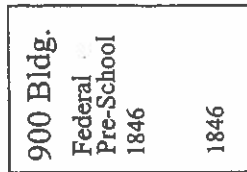

Playground

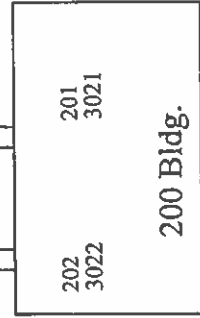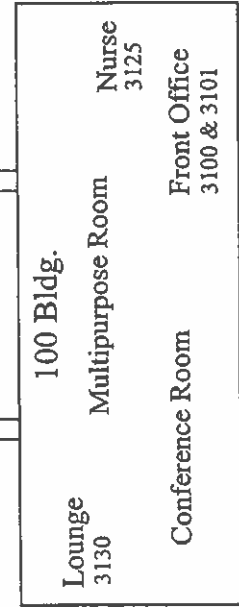

Parking Lot

Trimble Road

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON 1/22/10

# Northwood Elementary School


2760 E. Trimble Road

San Jose, CA 95132








(408) 923-1940

Field



Park

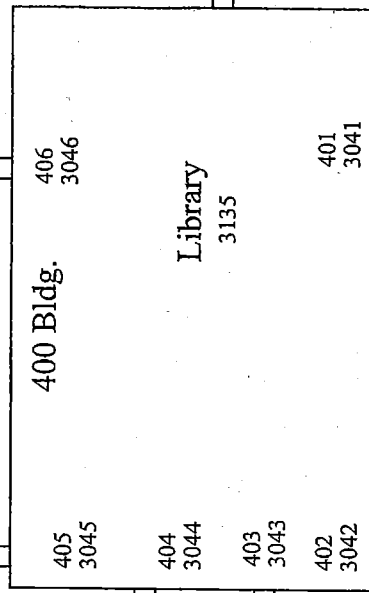



Playground

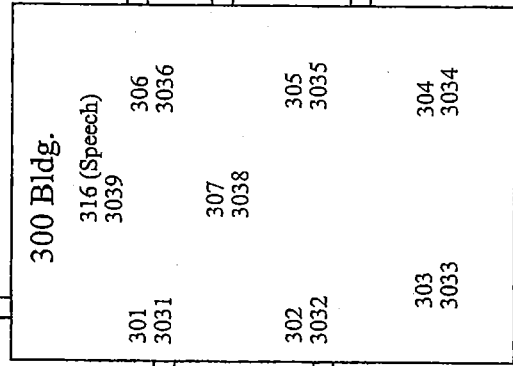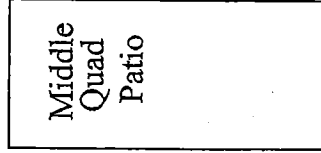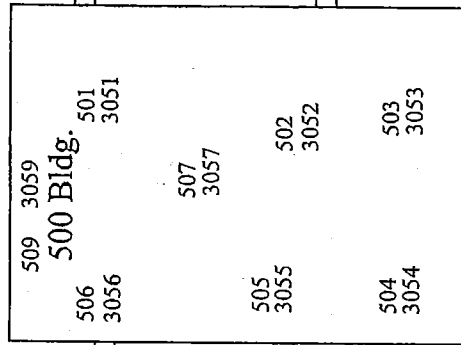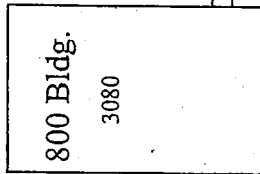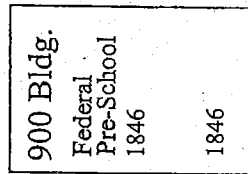

Bus Loop

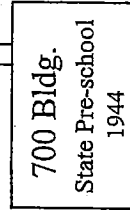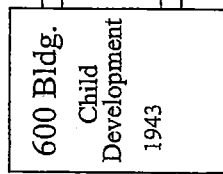

Playground

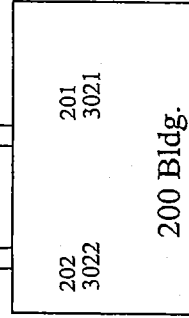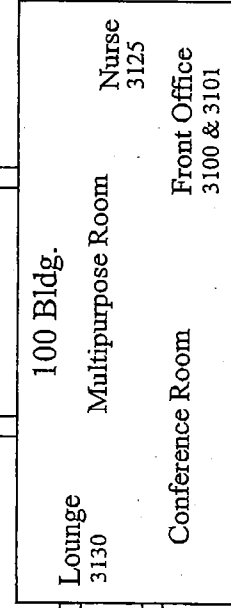

NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED ON: 02/11/9

Lakewood Drive

Trimble Road

Parking Lot

Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940












NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 1-3-2020

Bus Loop


Park

Field

Playground

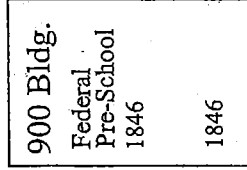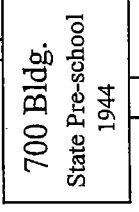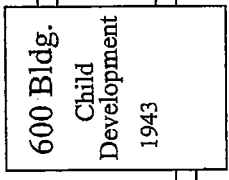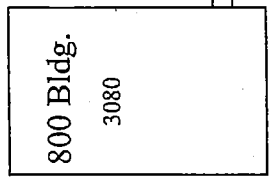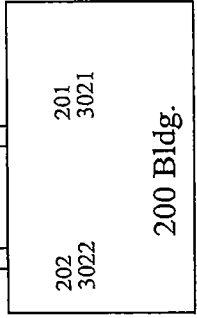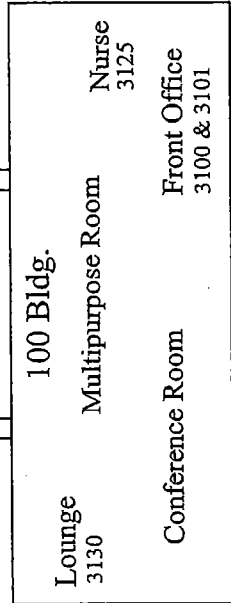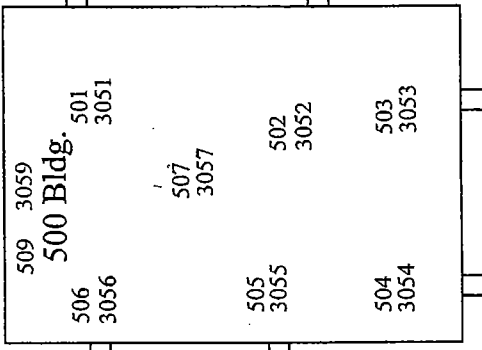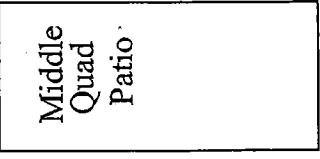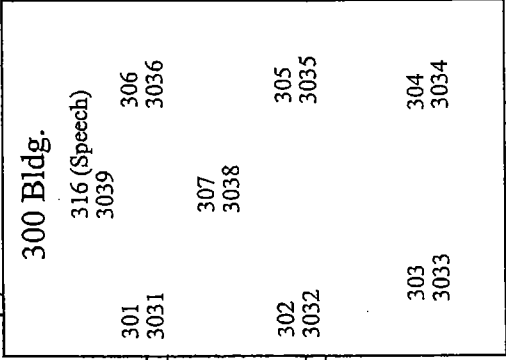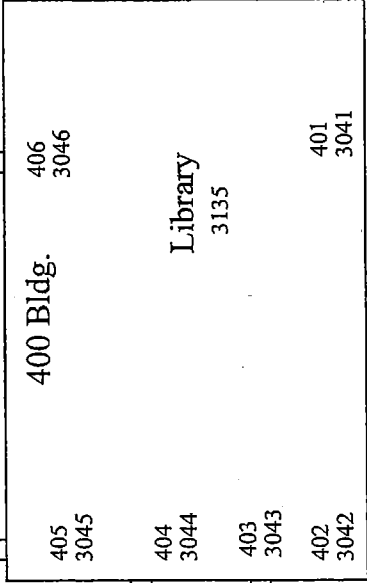

Playground



Trimble Road

Lakewood Drive













Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field Park

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 5/13/18

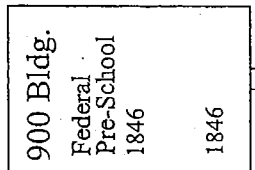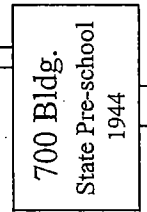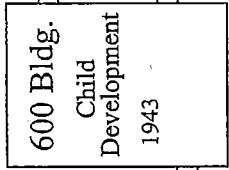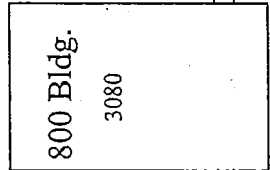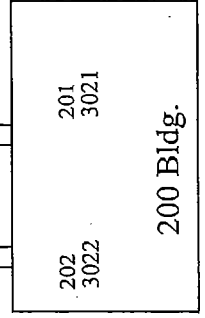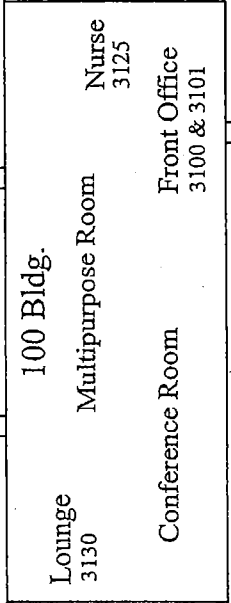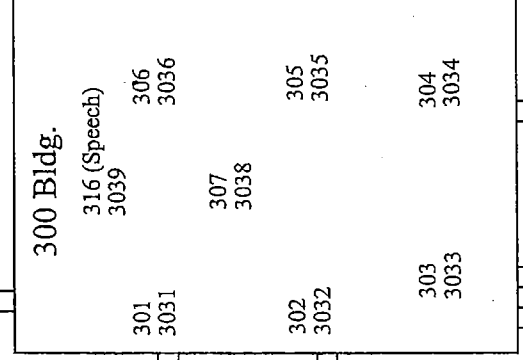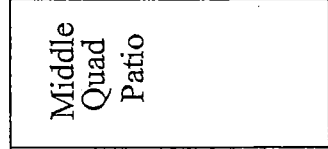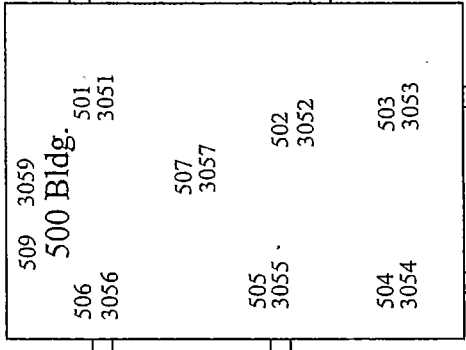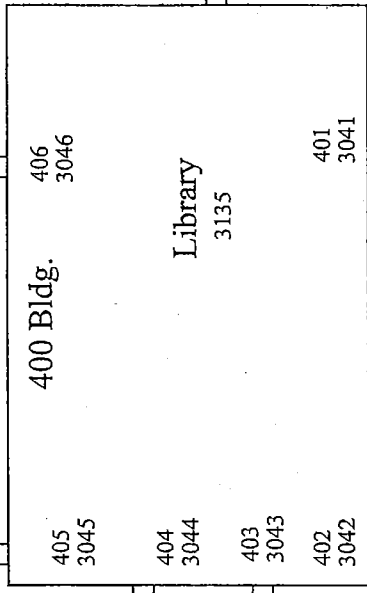

Playground

Playground


Parking Lot

Trimble Road










Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field



Park

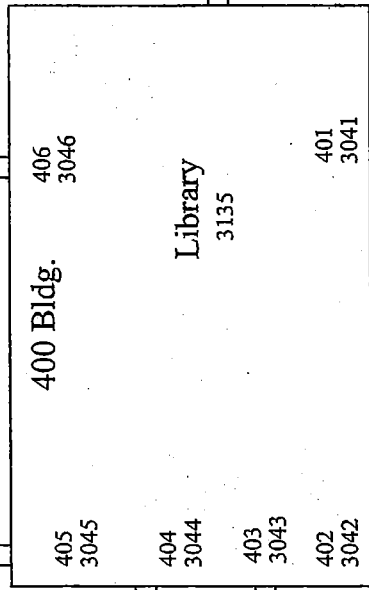

Playground

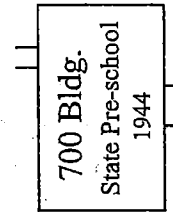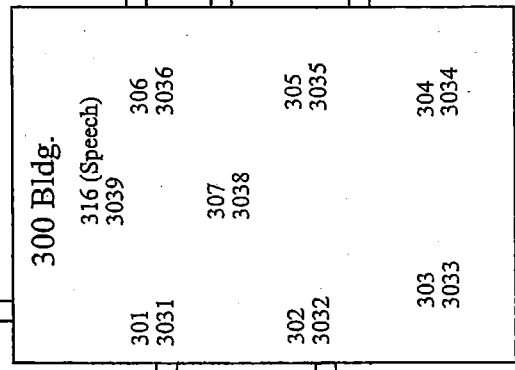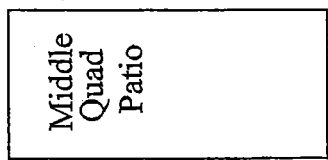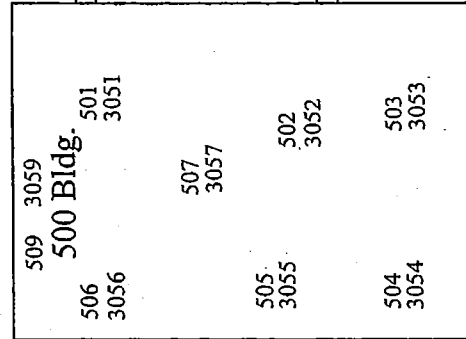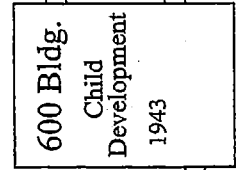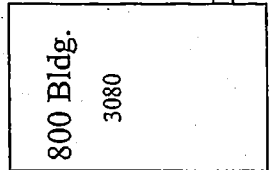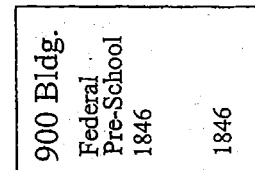

Playground

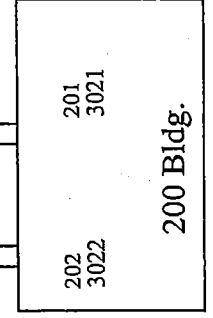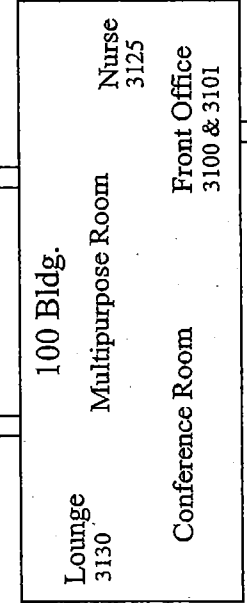

Parking Lot

Trimble Road

Lakewood Drive


Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 9102-80-20








**Northwood Elementary School**  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field

Park


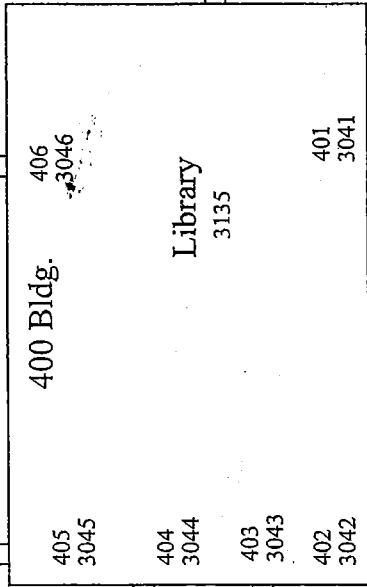


Playground

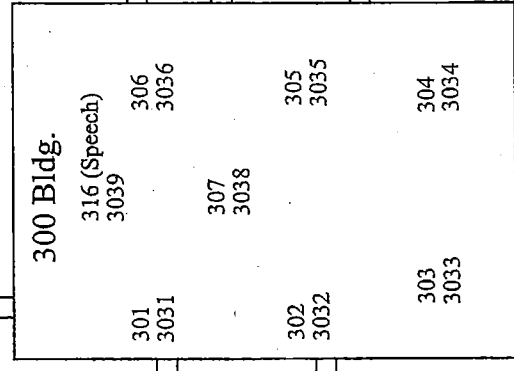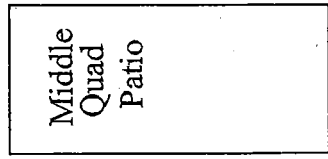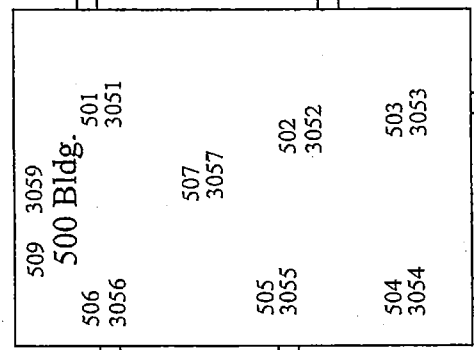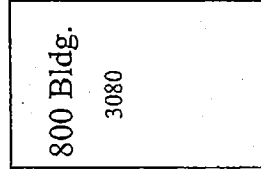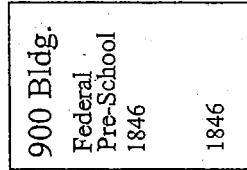



Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 8/15/18

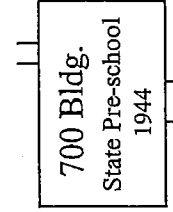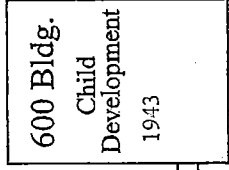

Playground

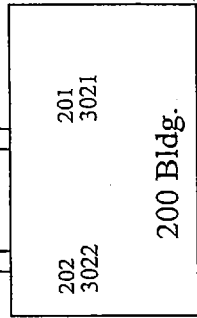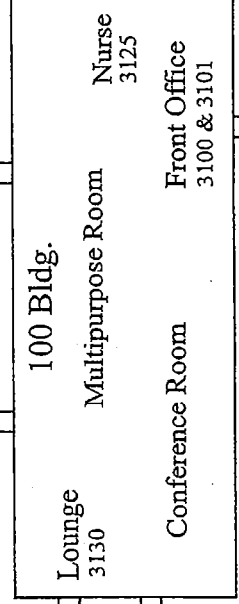

Parking Lot

Trimble Road


Lakewood Drive










Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field

Park

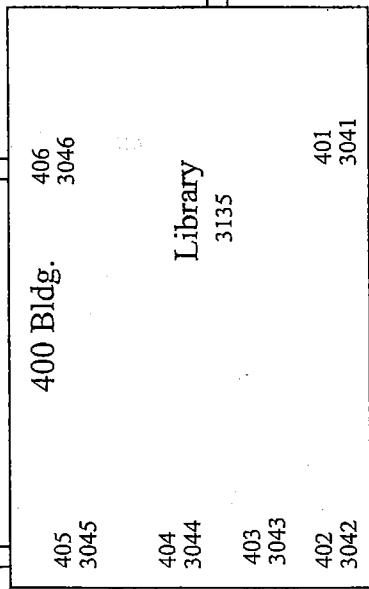




Playground

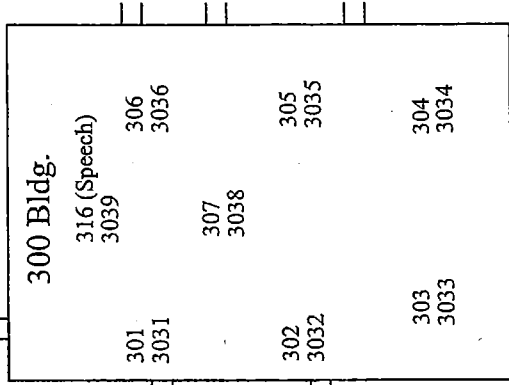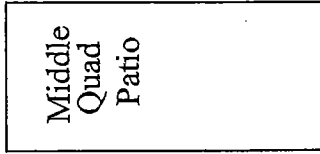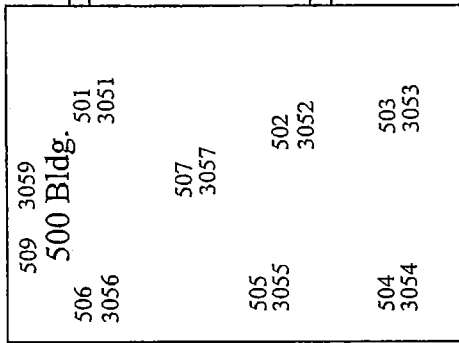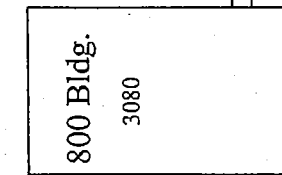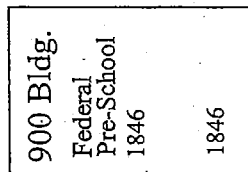

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 2/16/18

Playground

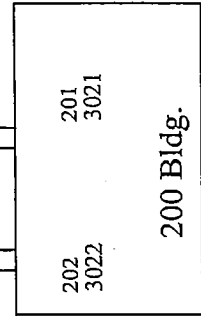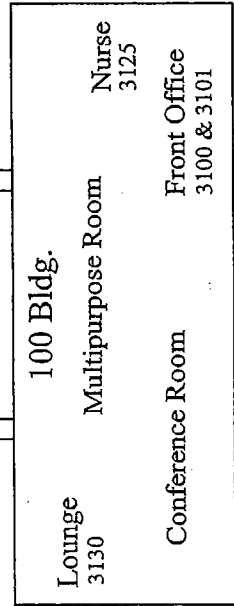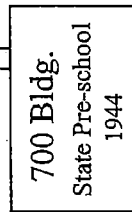

Parking Lot

Trimble Road

Lakewood Drive

Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Lakewood Drive













NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 2/10/88

Bus Loop

Park

Playground

Field

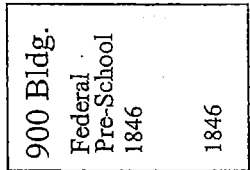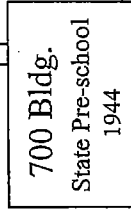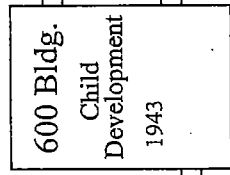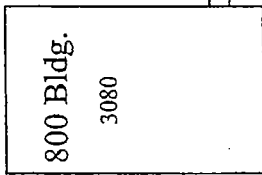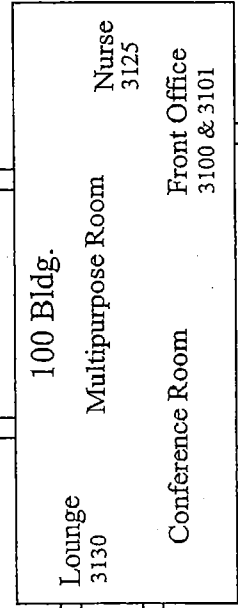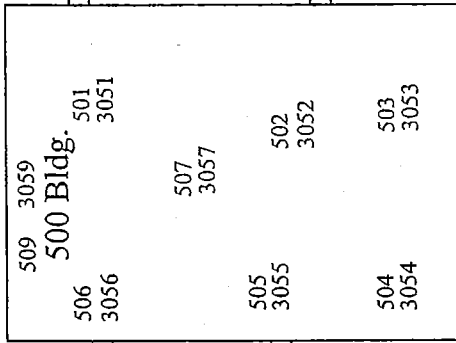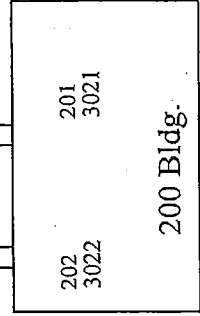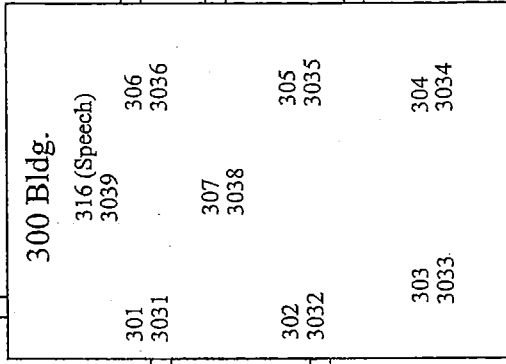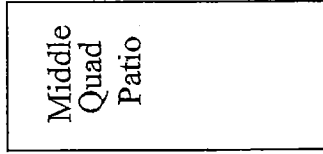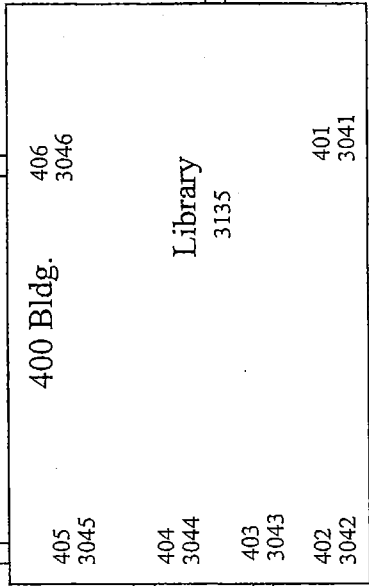

Playground


Parking Lot

Trimble Road










Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field



Park

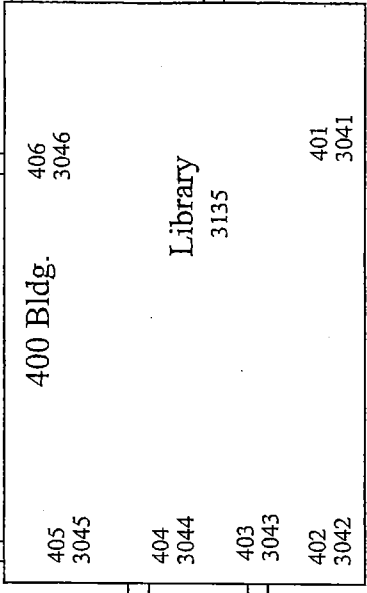



Playground

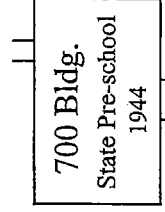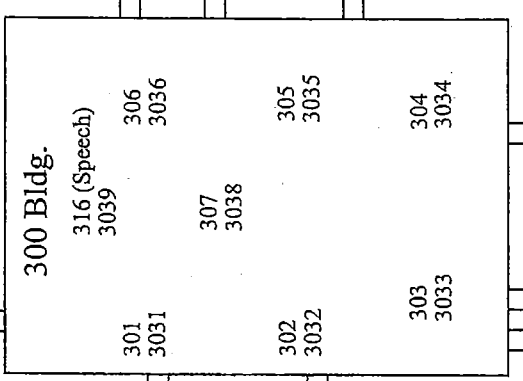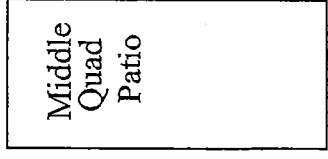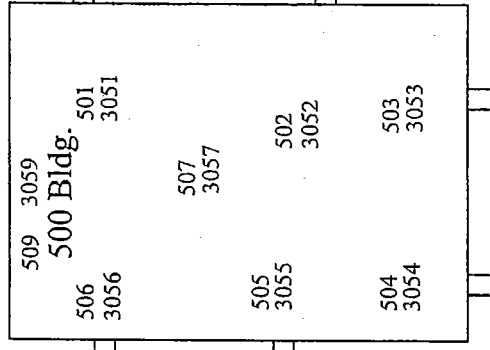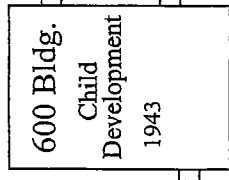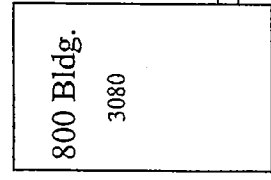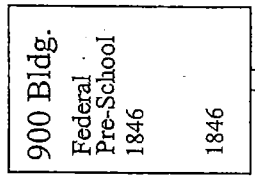

Playground

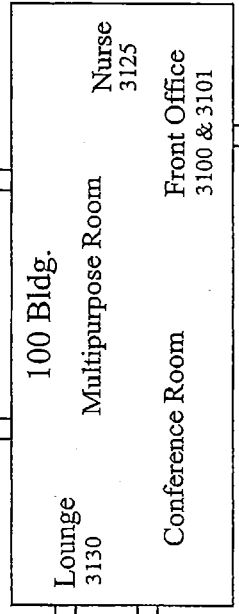

Trimble Road

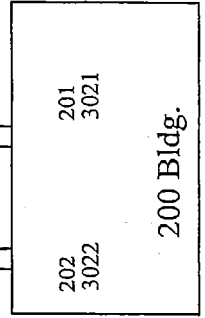


Lakewood Drive

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 4/3/17








Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field

Park


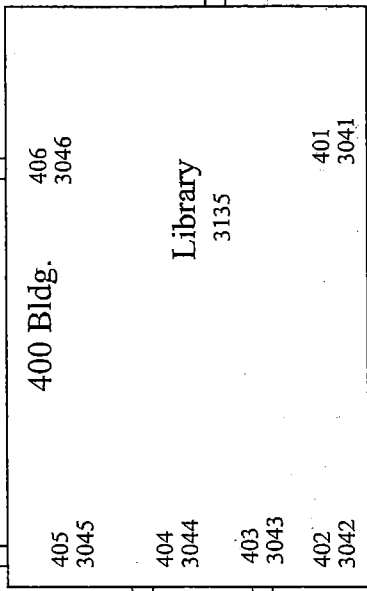


Playground

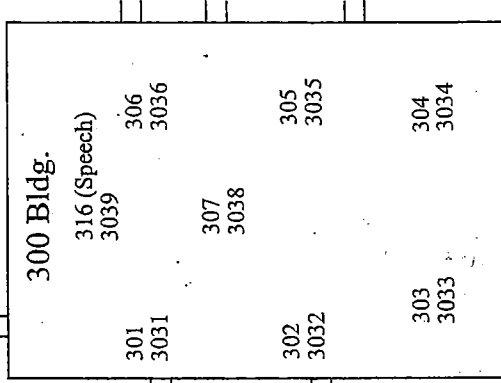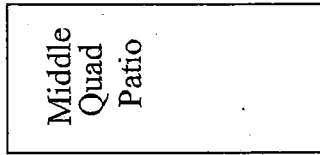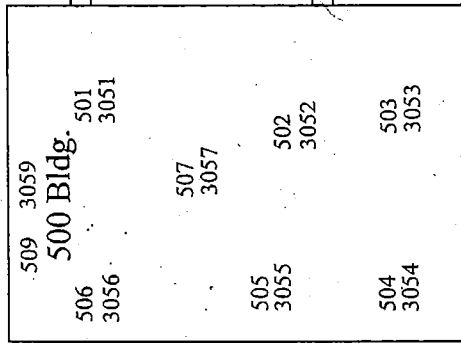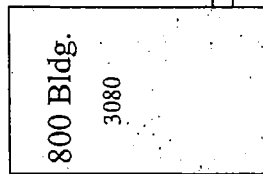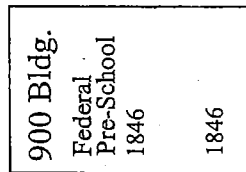



Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 9/15/16

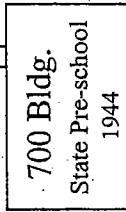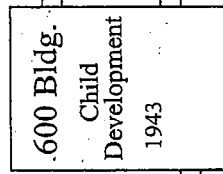

Playground

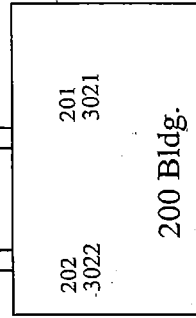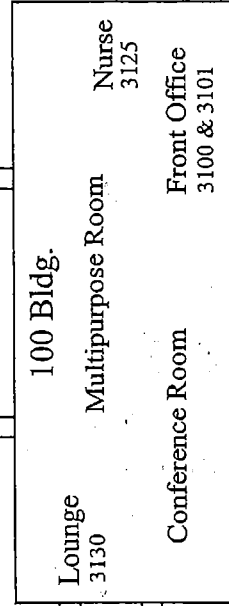

Parking Lot


Trimble Road

Lakewood Drive









Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field





Park

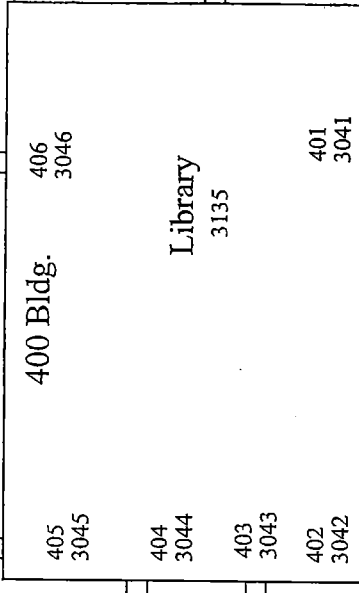

Playground

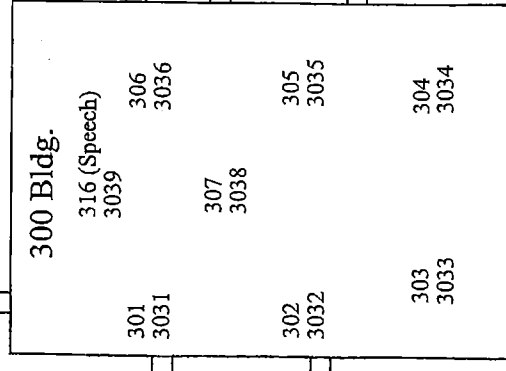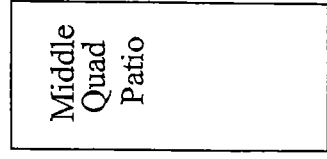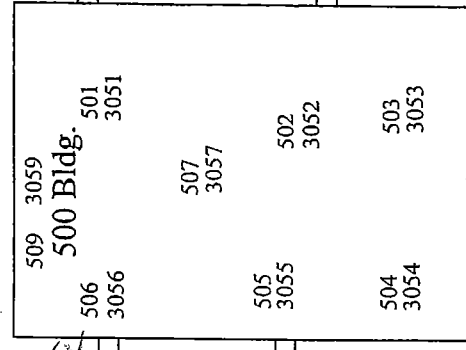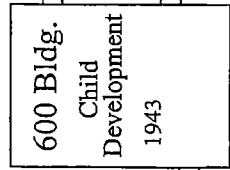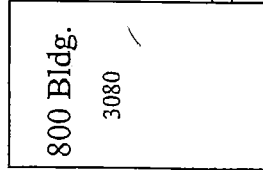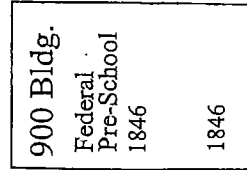

Playground

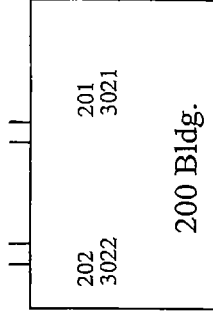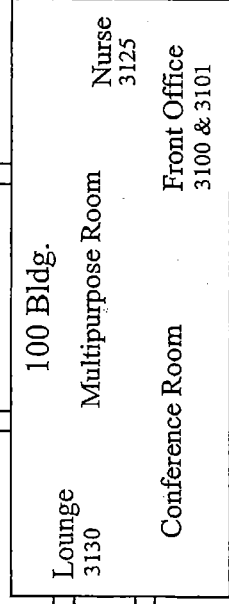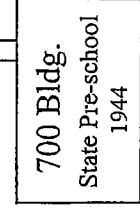

Trimble Road

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 9/02-12-30-2016

**Northwood Elementary School**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

**Field**












**Park**

**Playground**

Lakewood Drive

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 9-18-15

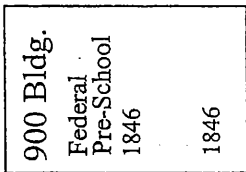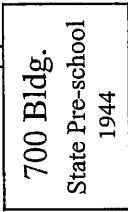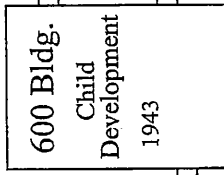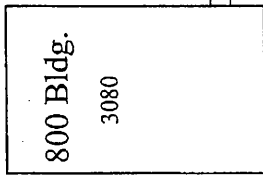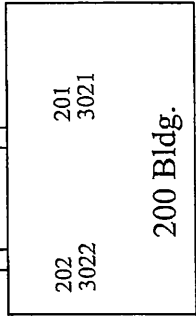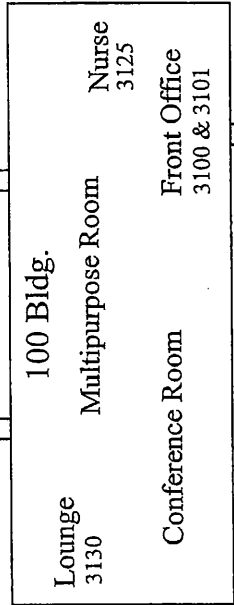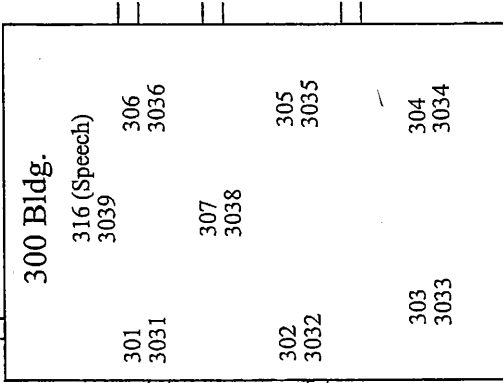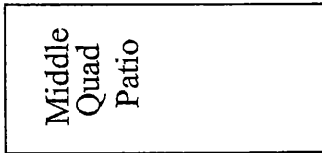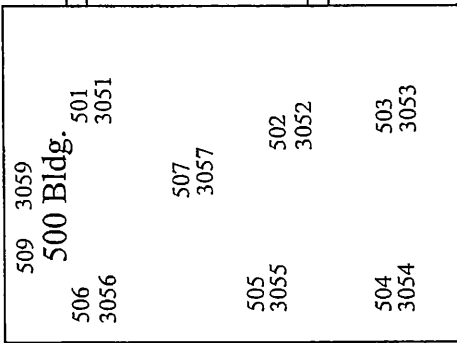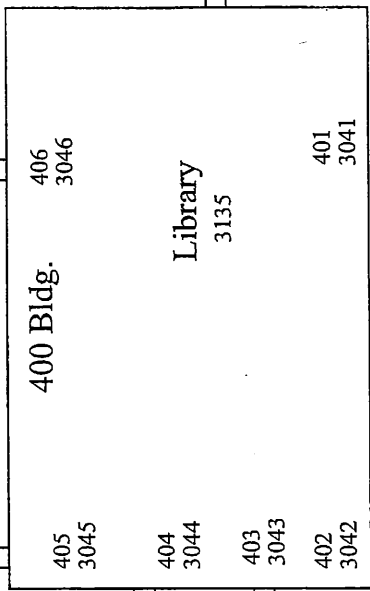

**Playground**


Parking Lot

Trimble Road












Northwood Elementary School  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Field

Park

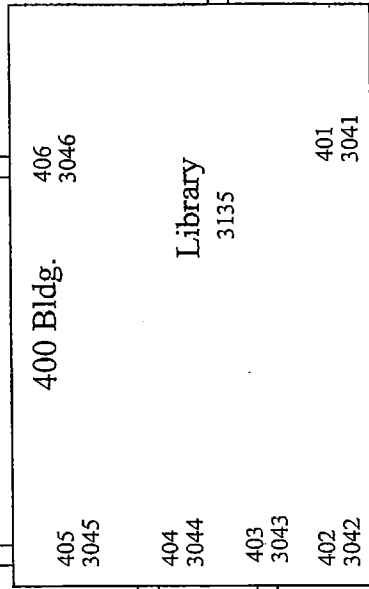

Playground

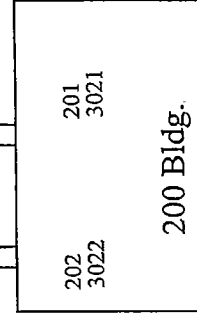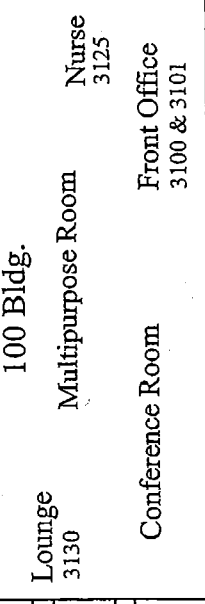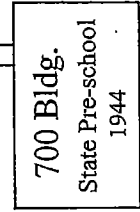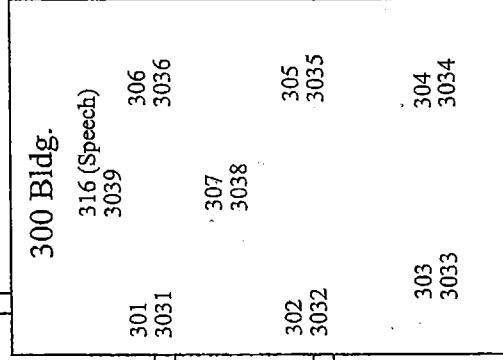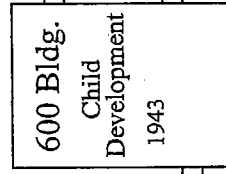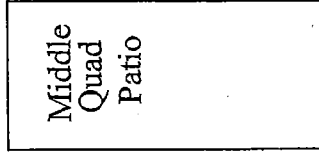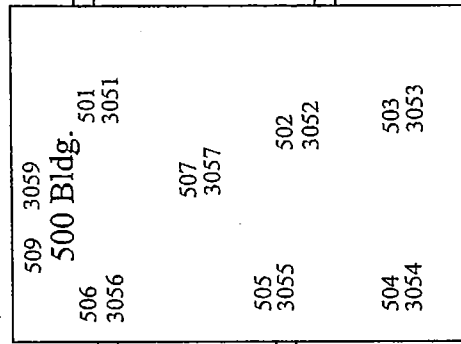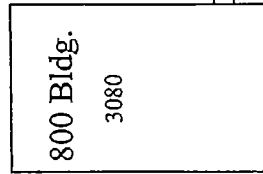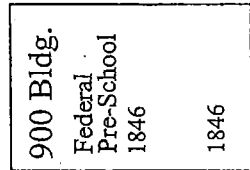

Playground

Parking Lot

Trimble Road

Bus Loop

Lakewood Drive

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 03-19-2015

~~NORTHWOOD ELEMENTARY SCHOOL~~  
 INSPECTED ON: 08-29-2014

Bus Loop

Park

Field

Playground

Playground

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

Wood Shed


Metal Container

Metal Containers

Parking Lot

**400 Bldg.**  
 406 Williamson(1)  
 405 Heiss (1/2)  
 404 Helfenberger (K)  
 403 Lewis-Cook (3)  
 402 Cheadle II (3)

**Library (middle 400)**  
 401 Stinson (3)



**900 Bldg.**  
 Federal Pre-School  
 Winquist, Radford, Bala

**800 Bldg.**  
 Tanaka (2)

**500 Bldg.**  
 509 Athwal (1)  
 506 Brown (SDC)  
 505 Serochi (SDC)  
 504 Kramer(5)  
 501 Wong (4/5)  
 507 middle  
 502 Burroughs(5)  
 503 Lyle(4)

**MIDDLE QUAD PATIO**

**300 Bldg.**  
 316 (Speech)  
 307 RSP (middle) - Yee  
 306 Fujikawa(1)  
 305 Evans/Lewis(2)  
 304 Kinney (2)  
 301 Orth (2/3)  
 302 Lui (1)  
 303 Brum (K)

**700 Bldg.**  
 State Preschool  
 Wilburn (Pre)

**100 Bldg.**  
 Lounge  
 Multipurpose Room  
 Nurse  
 Conference Room  
 Front Office

**200 Bldg.**  
 202 LaTendresse (K)  
 201 Green (K)

**600 Bldg.**  
 Child Development



NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 5-7-14

Bus Loop

**Northwood SCHOOL**  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Metal Container

Field

Playground

Playground

Park

Wood Shed

**400 Bldg.**

405 Heiss (1/2)	406 Williamson(1)
404 Helfenberger (K)	Library (middle 400)
403 Lewis-Cook (3)	401 Stinson (3)
402 Cheadle II (3)	

**300 Bldg.**

301 Orth (2/3)	306 Fujikawa(1)
302 Lui (1)	305 Evans/Lewis(2)
303 Brum (K)	304 Kinney (2)
	316 (Speech)
	307 RSP (middle) - Yee

**200 Bldg.**

202 LaTendresse (K)	201 Green (K)
---------------------	---------------



MIDDLE QUAD PATIO

**500 Bldg.**

509 Athwal (1)	501 Wong (4/5)
506 Brown (SDC)	502 Burroughs(5)
505 Serochi (SDC)	503 Lyle(4)
504 Kramer(5)	507 middle
	Boyd (4)

**100 Bldg.**

Lounge	Nurse
Conference Room	Front Office
	Multipurpose Room

**801 Bldg.**  
Carabal (3)

**800 Bldg.**  
Tanaka (2)

**600 Bldg.**  
Child Development

**700 Bldg.**  
State Preschool  
Wilburn (Pre)

**900 Bldg.**  
Federal Pre-School  
Winquist, Radford, Bala

Playground

Metal Containers

Parking Lot

WOOD SHED

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 09-26-2013

Bus Loop

Park

Field

Playground

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

Metal Container

Wood Shed

**400 Bldg.**  
 406 Williamson(1)  
 405 Heiss (1/2)  
 404 Helfenberger (K)  
 403 Lewis-Cook (3)  
 402 Cheadle II (3)  
 Library (middle 400)  
 401 Stinson (3)

**801 Bldg.**  
 Carabal (3)

**900 Bldg.**  
 Federal Pre-School  
 Winquist, Radford, Bala

**800 Bldg.**  
 Tanaka (2)



**500 Bldg.**  
 509 Athwal (1)  
 506 Brown (SDC)  
 505 Serochi (SDC)  
 504 Kramer(5)  
 501 Wong (4/5)  
 502 Burroughs(5)  
 503 Lyle(4)  
 Boyd (4) middle 507

**600 Bldg.**  
 Child Development

**300 Bldg.**  
 316 (Speech)  
 306 Fujikawa(1)  
 302 Lui (1)  
 305 Evans/Lewis(2)  
 304 Kinney (2)  
 301 Orth (2/3)  
 30Z RSP (middle) - Yee  
 303 Brum (K)

**MIDDLE QUAD PATIO**

**700 Bldg.**  
 State Preschool  
 Wilburn (Pre)

**100 Bldg.**  
 Lounge  
 Multipurpose Room  
 Nurse  
 Conference Room  
 Front Office

Playground

Metal Containers

**200 Bldg.**  
 202 LaTendresse (K)  
 201 Green (K)

Playground

Parking Lot

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 4/05/13

Bus Loop

Park

Field

Playground

Playground

Playground

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

Metal Container

Metal Containers

**400 Bldg.**  
 405 Heiss (1/2)  
 404 Helfenberger (K)  
 403 Lewis-Cook (3)  
 402 Cheadle II (3)  
 406 Williamson(1)  
**Library (middle 400)**  
 401 Stinson (3)

**800 Bldg.**  
 Tanaka (2)

**900 Bldg.**  
 Federal Pre-School  
 Winquist,  
 Radford,  
 Bala



**500 Bldg.**  
 509 Athwal (1)  
 506 Brown (SDC)  
 505 Serochi (SDC)  
 504 Kramer(5)  
 501 Wong (4/5)  
 502 Burroughs(5)  
 503 Lyle(4)  
 507 Boyd (4) middle

**300 Bldg.**  
 301 Orth (2/3)  
 302 Lui (1)  
 303 Brum (K)  
 306 Fujikawa(1)  
 307 RSP (middle) - Yee  
 305 Evans/Lewis(2)  
 304 Kinney (2)  
 316 (Speech)

**MIDDLE QUAD PATIO**

**600 Bldg.**  
 Child Development

**700 Bldg.**  
 State Preschool  
 Wilburn (Pre)

**100 Bldg.**  
 Lounge  
 Multipurpose Room  
 Nurse  
 Conference Room  
 Front Office

**200 Bldg.**  
 202 LaTendresse (K)  
 201 Green (K)  
 Kinney (2)

Parking Lot



NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED ON: 10-11-12

Bus Loop

Playground

Park

Field

Playground

Wood Shed


**400 Bldg.**

405 Heiss (1/2)  
404 Helfenberger (K)  
403 Lewis-Cook (3)  
402 Cheadle II (3)

406 Williamson(1)

Library (middle 400)

401 Stinson (3)



**300 Bldg.**

301 Orth (2/3)  
302 Lui (1)  
303 Brum (K)

306 Fujikawa(1)

307 RSP (middle) - Yee  
305 Evans/Lewis(2)  
304 Kinney (2)

316 (Speech)

MIDDLE QUAD PATIO

**500 Bldg.**

509 Athwal (1)  
501 Wong (4/5)  
506 Brown (SDC)  
505 Serochi (SDC)  
504 Kramer(5)

Boyd (4) middle 507

502 Burroughs(5)  
503 Lyle(4)

**100 Bldg.**

Lounge  
Conference Room  
Multipurpose Room  
Nurse  
Front Office

**700 Bldg.**

State Preschool  
Wilburn (Pre)

Northwood SCHOOL  
2760 E. Trimble Road  
San Jose, CA 95132  
(408) 923-1940

Metal Container

**801 Bldg.**

Carabal (3)

**800 Bldg.**

Tanaka (2)

**600 Bldg.**

Child Development

**900 Bldg.**

Federal Pre-School  
Winquist, Radford, Bala

Playground

Metal Containers

Parking Lot

**200 Bldg.**

202 LaTendresse (K)  
201 Green (K)











**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 04-12-12


Bus Loop

Park

Field

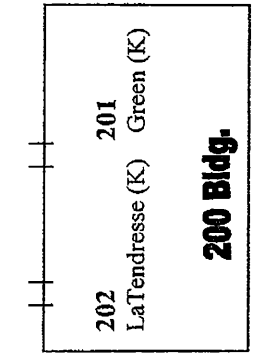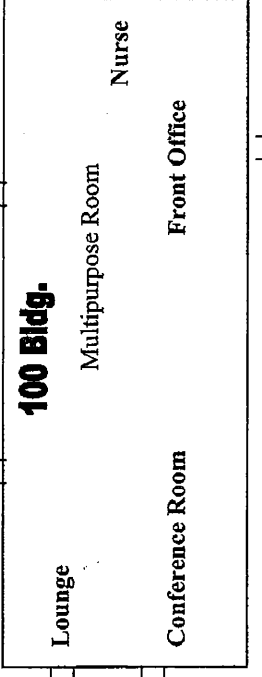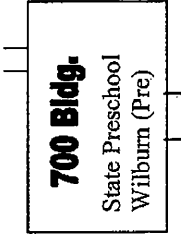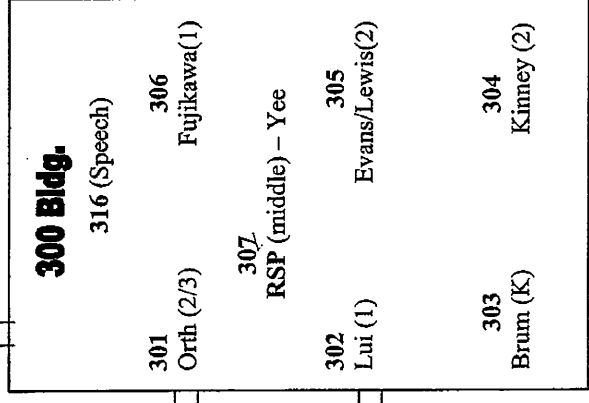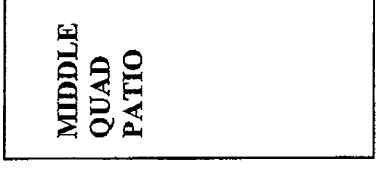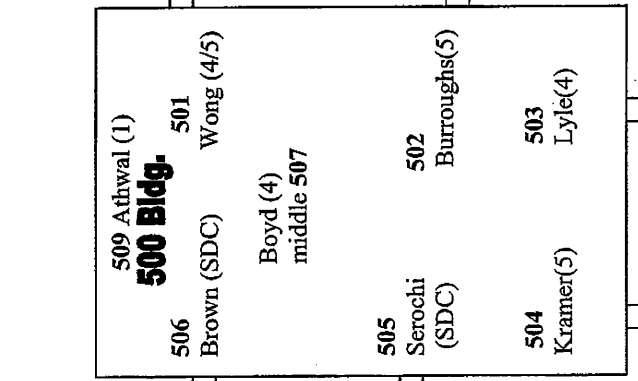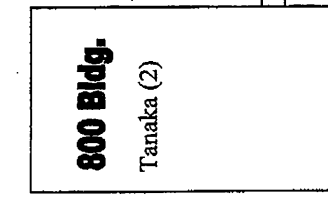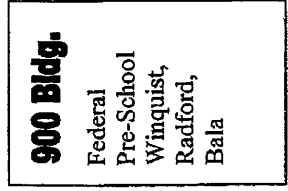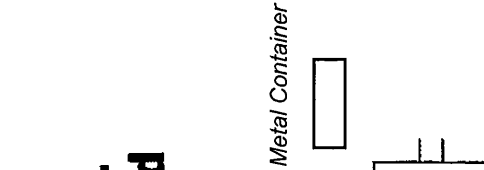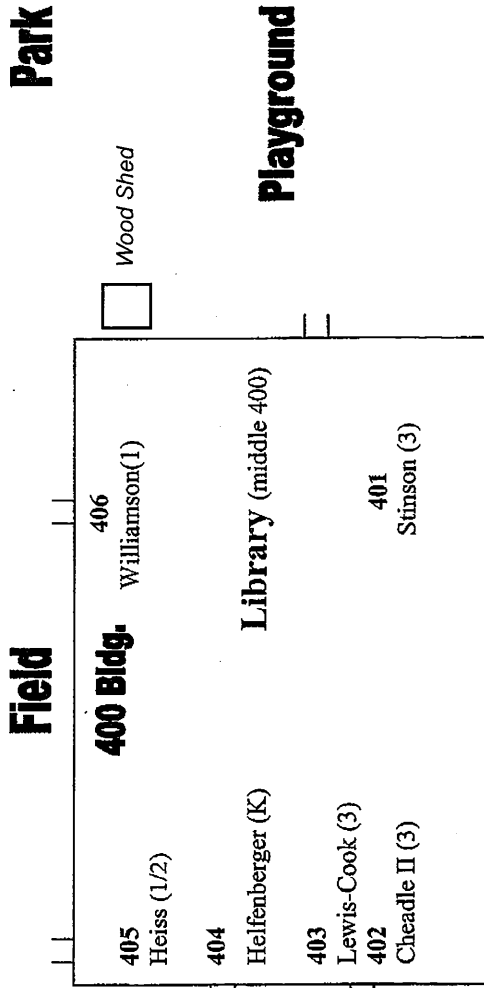

Playground

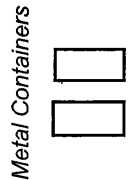

Parking Lot

Playground

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 12-1-11

Bus Loop

Playground

Park

Playground

Field

Wood Shed

**400 Bldg.**  
 406 Williamson(1)  
 405 Heiss (1/2)  
 404 Helfenberger (K)  
 403 Lewis-Cook (3)  
 402 Cheadle II (3)  
 Library (middle 400)  
 401 Stinson (3)

Flag

**300 Bldg.**  
 316 (Speech)  
 306 Fujikawa(1)  
 307 RSP (middle) - Yee  
 305 Evans/Lewis(2)  
 304 Kinney (2)  
 303 Brum (K)  
 302 Lui (1)

MIDDLE QUAD PATIO

**500 Bldg.**  
 509 Athwal (1)  
 501 Wong (4/5)  
 502 Burroughs(5)  
 503 Lyle(4)  
 504 Kramer(5)  
 505 Serochi (SDC)  
 506 Brown (SDC)  
 Boyd (4) middle 507

**100 Bldg.**  
 Multipurpose Room  
 Nurse  
 Front Office  
 Lounge  
 Conference Room

**700 Bldg.**  
 State Preschool  
 Wilburn (Pre)

Parking Lot

**Northwood SCHOOL**  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

Metal Container

**801 Bldg.**  
 Carabal (3)

**800 Bldg.**  
 Tanaka (2)

**600 Bldg.**  
 Child Development

**900 Bldg.**  
 Federal Pre-School  
 Winquist, Radford, Bala

Playground

Metal Containers



**200 Bldg.**

202 LaTendresse (K)  
 201 Green (K)

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 9/2-3/10

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

**Field**

**Park**

**Playground**

**Playground**


**400 Bldg.**

405 Heiss (1/2)      406 Williamson(1)

404 Helfenberger (K)      **Library** (middle 400)

403 Lewis-Cook (3)      401 Stinson (3)

402 Cheadle II (3)



**900 Bldg.**

Federal Pre-School  
 Winquist, Radford, Bala

**800 Bldg.**

Tanaka (2)

**500 Bldg.**

509 Athwal (1)      501 Wong (4/5)

506 Brown (SDC)      Boyd (4) middle 507

505 Serochi (SDC)      502 Burroughs(5)

504 Kramer(5)      503 Lyle(4)

**600 Bldg.**

Child Development

**300 Bldg.**

301 Orth (2/3)      306 Fujikawa(1)

302 Lui (1)      307 RSP (middle) - Yee

303 Brum (K)      305 Evans/Lewis(2)

304 Kinney (2)

**MIDDLE QUAD PATIO**

**700 Bldg.**

State Preschool  
 Wilburn (Pre)

**100 Bldg.**

Lounge      **Multipurpose Room**

Conference Room      Nurse

Front Office

**Playground**

**200 Bldg.**

202 LaTendresse (K)      201 Green (K)

**Parking Lot**

*Drop*

**Bus Loop**

*wood*

*W3*



NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 3/11/10

Bus Loop

Park

Field

Playground

Playground

**400 Bldg.**

405 Heiss (1/2)      406 Williamson(1)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

**Library (middle 400)**

401 Stinson (3)



**300 Bldg.**

316 (Speech)

301 Orth (2/3)

307 RSP (middle) - Yee

302 Lui (1)

303 Brum (K)

306 Fujikawa(1)

305 Evans/Lewis(2)

304 Kinney (2)

**MIDDLE QUAD PATIO**

**500 Bldg.**

509 Athwal (1)

501 Wong (4/5)

506 Brown (SDC)

Boyd (4) middle 507

502 Burroughs(5)

505 Serochi (SDC)

504 Kramer(5)

503 Lyle(4)

**100 Bldg.**

Lounge

Multipurpose Room

Nurse

Conference Room

Front Office

**700 Bldg.**

State Preschool Wilburn (Pre)

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

**801 Bldg.**

Carabal (3)

**800 Bldg.**

Tanaka (2)

**600 Bldg.**

Child Development

**900 Bldg.**

Federal Pre-School Winquist, Radford, Bala

Playground

Parking Lot

**200 Bldg.**

202 LaTendresse (K)

201 Green (K)



NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 09-08-09

Bus Loop

Playground


Park

Playground

Field

*wood storage*

**400 Bldg.**  
 406 Williamson(1)  
 405 Heiss (1/2)  
 404 Helfenberger (K)  
 403 Lewis-Cook (3)  
 402 Cheadle II (3)  
 Library (middle 400)  
 401 Stinson (3)



**300 Bldg.**  
 316 (Speech)  
 306 Fujikawa(1)  
 307 RSP (middle) - Yee  
 305 Evans/Lewis(2)  
 304 Kinney (2)  
 303 Brum (K)  
 302 Lui (1)  
 301 Orth (2/3)

MIDDLE QUAD PATIO

**500 Bldg.**  
 509 Athwal (1)  
 506 Brown (SDC)  
 505 Serochi (SDC)  
 504 Kramer(5)  
 503 Lyle(4)  
 502 Burroughs(5)  
 501 Wong (4/5)  
 Boyd (4) middle 507

**100 Bldg.**  
 Lounge  
 Multipurpose Room  
 Conference Room  
 Front Office  
 Nurse


**700 Bldg.**  
 State Preschool  
 Wilburn (Pre)

**801 Bldg.**  
 Carabal (3)

**800 Bldg.**  
 Tanaka (2)

**600 Bldg.**  
 Child Development

**900 Bldg.**  
 Federal Pre-School  
 Winquist, Radford, Bala

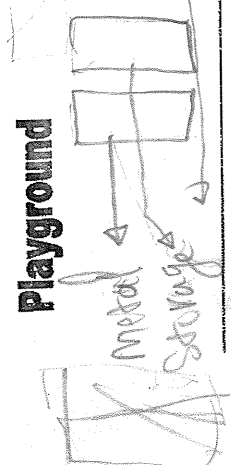

Parking Lot

**Northwood SCHOOL**  
 2760 E. Trimble Road  
 San Jose, CA 95132  
 (408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED ON: 5/11/09

Bus Loop

Park

Playground

Playground

Field

**400 Bldg.**

406 Williamson(1)

405 Heiss (1/2)

404 Helfenberger (K)

403 Lewis-Cook (3)

402 Cheadle II (3)

401 Stinson (3)

**Library** (middle 400)

**300 Bldg.**

316 (Speech)

306 Fujikawa(1)

307 RSP (middle) - Yee

305 Evans/Lewis(2)

304 Kinney (2)

303 Brum (K)


302 Lui (1)

301 Orth (2/3)

**200 Bldg.**

202 LaTendresse (K)

201 Green (K)



MIDDLE QUAD PATIO

**500 Bldg.**

509 Athwal (1)

501 Wong (4/5)

506 Brown (SDC)

Boyd (4) middle 507

502 Burroughs(5)

505 Serochi (SDC)

504 Kramer(5)

503 Lyle(4)

**100 Bldg.**

Multipurpose Room

Nurse

Front Office

Lounge

Conference Room

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

**801 Bldg.**

Carabal (3)

**800 Bldg.**

Tanaka (2)

**600 Bldg.**

Child Development

**900 Bldg.**

Federal Pre-School

Winquist, Radford, Bala

**700 Bldg.**

State Preschool

Wilburn (Pre)











Playground

Parking Lot


**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

VIEW

Playground

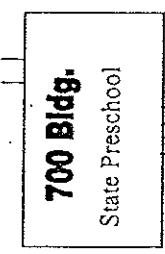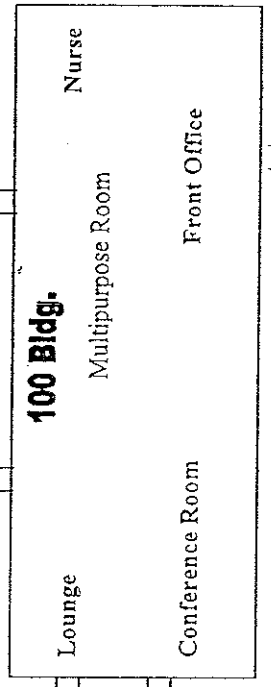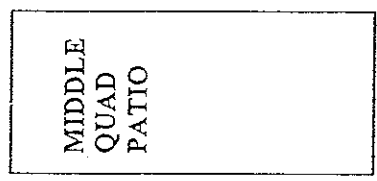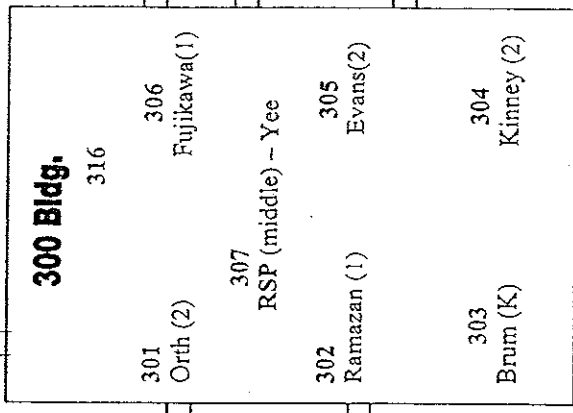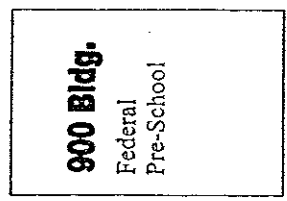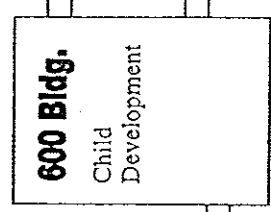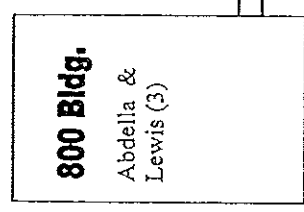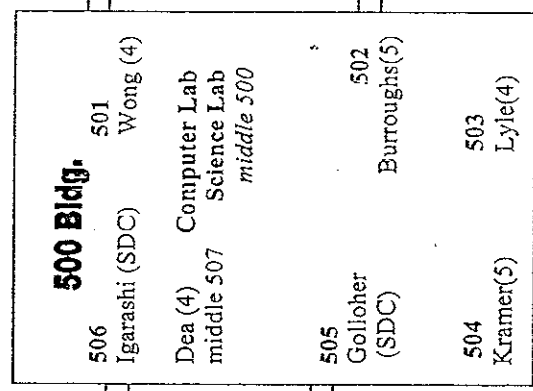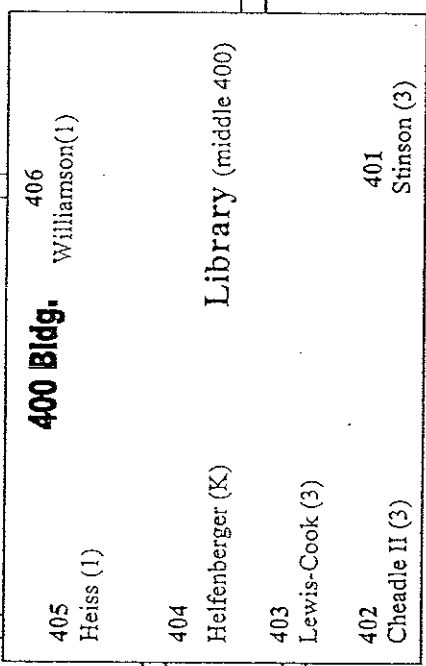

Playground

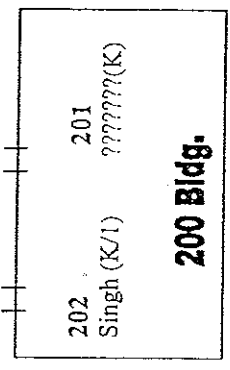

Bus Loop

NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 10/20/08

Parking Lot

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**


NORTHWOOD ELEMENTARY SCHOOL  
 INSPECTED ON: 4-21-08

Bus Loop

Playground

**400 Bldg.**  
 405 Heiss (1)  
 406 Williamson(1)  
 404 Helfenberger (K)  
 403 Lewis-Cook (3)  
 402 Cheadle II (3)  
 401 Stinson (3)  
 Library (middle 400)

Playground



**500 Bldg.**  
 506 Igarashi (SDC)  
 501 Wong (4)  
 505 Golloher (SDC)  
 504 Kramer(5)  
 502 Burroughs(5)  
 503 Lyle(4)  
 Dea (4) Computer Lab  
 middle 507 Science Lab  
 middle 500

**300 Bldg.**  
 301 Orth (2)  
 307 RSP (middle) - Yee  
 302 Ramazan (1)  
 303 Brum (K)  
 306 Fujikawa(1)  
 305 Evans(2)  
 304 Kinney (2)

MIDDLE QUAD PATIO

**100 Bldg.**  
 Lounge  
 Multipurpose Room  
 Nurse  
 Conference Room  
 Front Office

**200 Bldg.**  
 202 Singh (K/1)  
 201 ??????(K)

**800 Bldg.**  
 Abdella & Lewis (3)

**600 Bldg.**  
 Child Development

**900 Bldg.**  
 Federal Pre-School

**700 Bldg.**  
 State Preschool

Playground

Parking Lot

**Northwood SCHOOL**  
**2760 E. Trimble Road**  
**San Jose, CA 95132**  
**(408) 923-1940**

**NORTHWOOD ELEMENTARY SCHOOL**  
**INSPECTED ON: 11-09-07**

**Bus Loop**

**Playground**


**400 Bldg.**

405 Heiss (1)      406 Williamson(1)

404 Helfenberger (K)      Library (middle 400)

403 Lewis-Cook (3)

402 Cheadle II (3)      401 Stinson (3)



**500 Bldg.**

506 Igarashi (SDC)      501 Wong (4)

Dea (4)      Computer Lab      502 Burroughs(5)

middle 507      Science Lab      middle 500

505 Golloher (SDC)      503 Lytle(4)

504 Kramer(5)

**MIDDLE QUAD PATIO**

**300 Bldg.**

301 Orth (2)      306 Fujikawa(1)

307 RSP (middle) - Yee

302 Ramazan (1)      305 Evans(2)

303 Brum (K)      304 Kinney (2)

**800 Bldg.**

Abdella & Lewis (3)

**600 Bldg.**

Child Development

**900 Bldg.**

Federal Pre-School

**100 Bldg.**

Lounge      Nurse

Conference Room      Multipurpose Room

Front Office

**700 Bldg.**

State Preschool

**200 Bldg.**

202 Singh (K/1)      201 ???????(K)

**Playground**

**Parking Lot** →

# FIRE ESCAPE MAP

## NORTHWOOD SCHOOL




2760 E. TRIMBLE ROAD  
SAN JOSE, CA 95132  
(408) 923-1940

NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED ON: 03/09/07

Bus Loop

Park

Playground

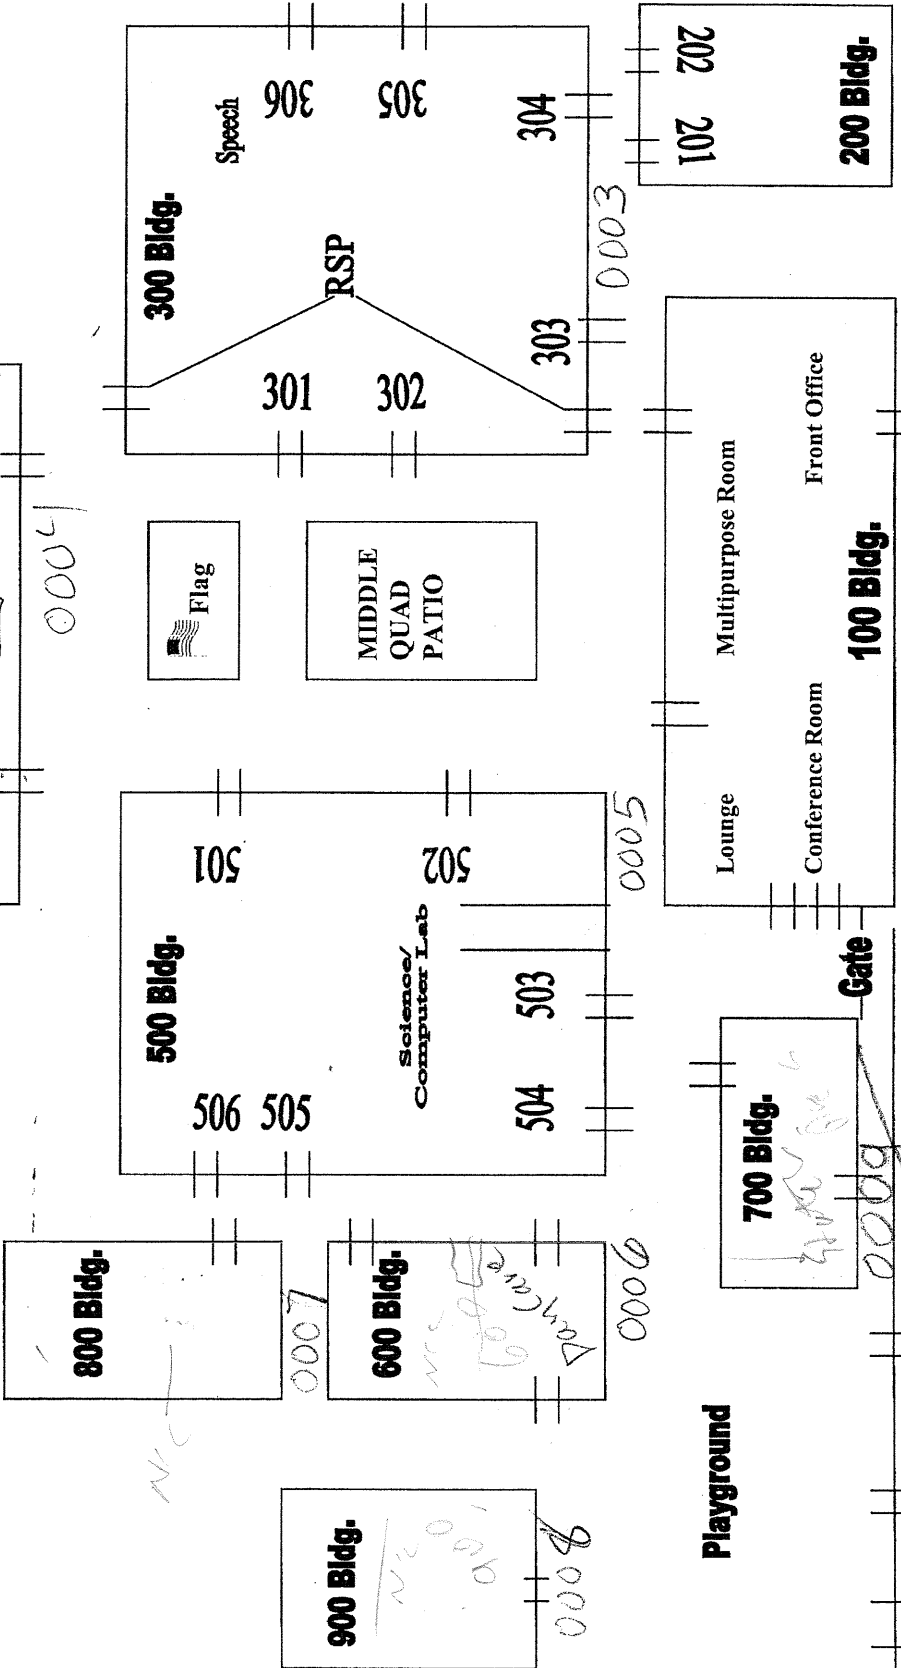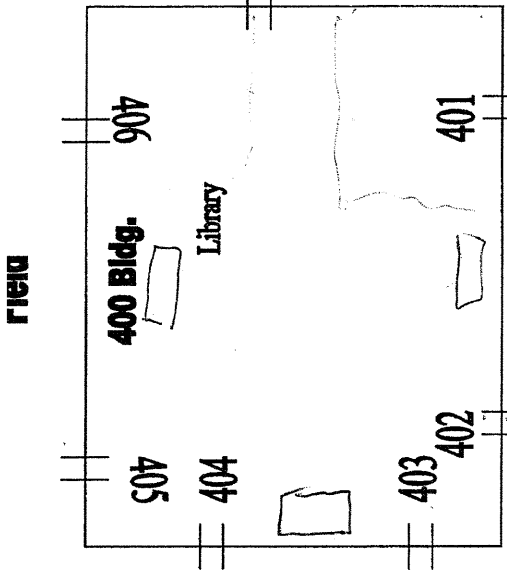

2000

0001

0003

0005

0000

0008

0007

0004

2000

# FIRE ESCAPE MAP

## NORTHWOOD SCHOOL

2760 E. TRIMBLE ROAD  
SAN JOSE, CA 95132  
(408) 923-1940











NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED ON: 08-25-06

Bus Loop

Park

Playground

Playground

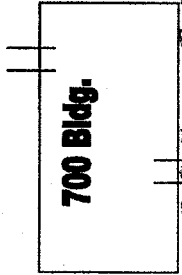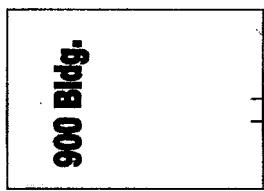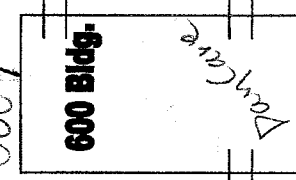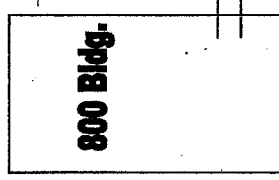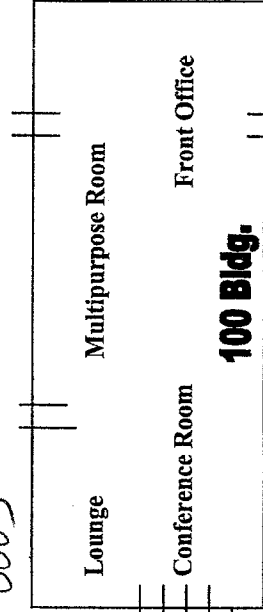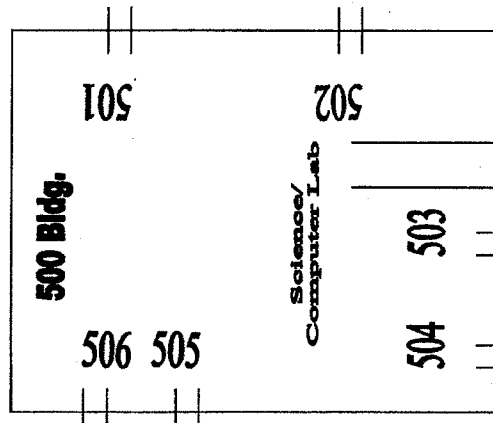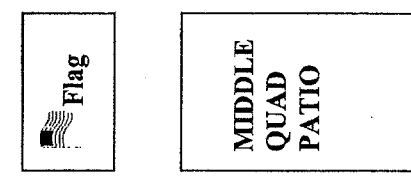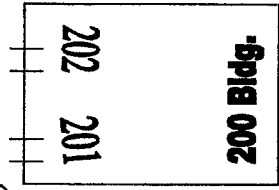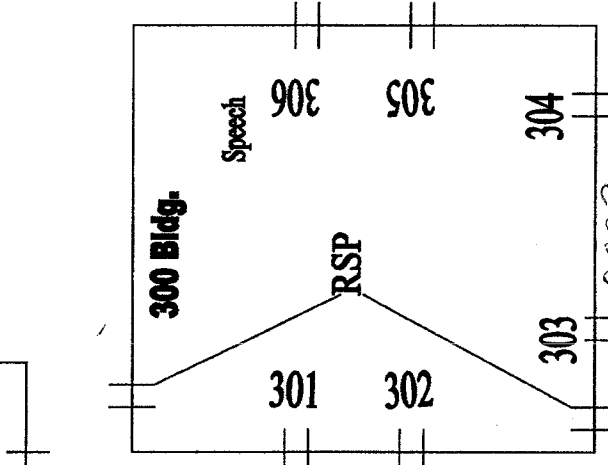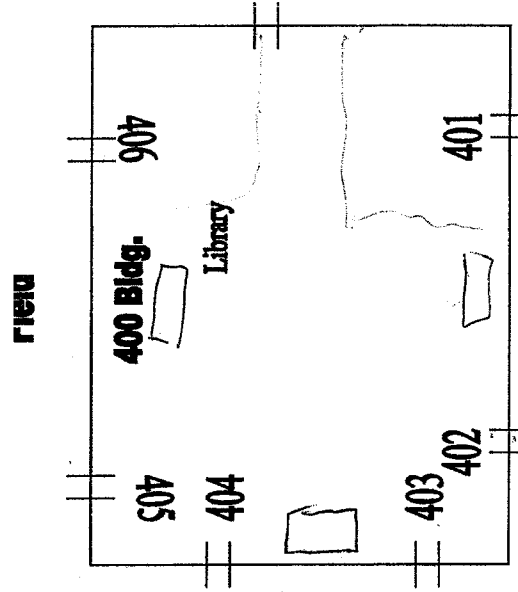

Gate

Parking Lot

0002

0004

0003

0001

0005

0007

0006

0008

0009

NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED ON: 04/20/06











Bus Loop

Playground

Park

Playground

Field

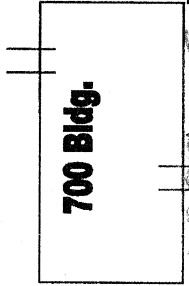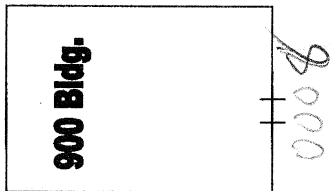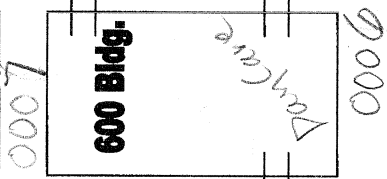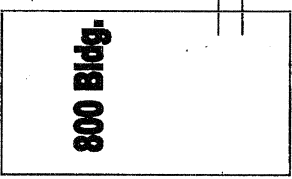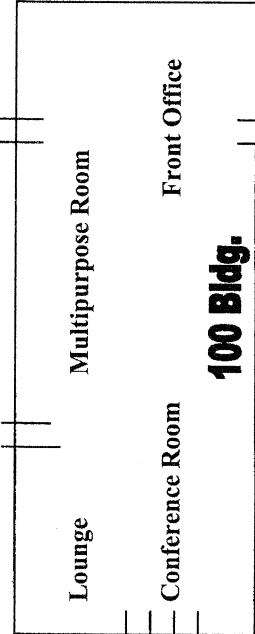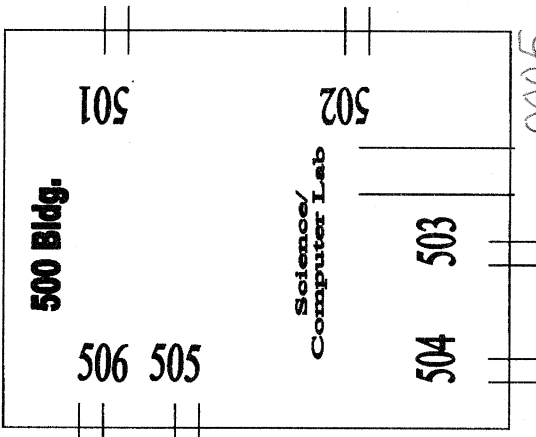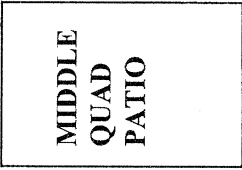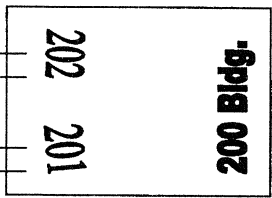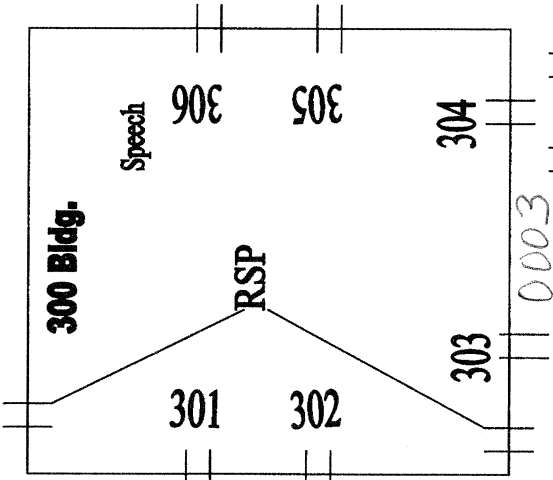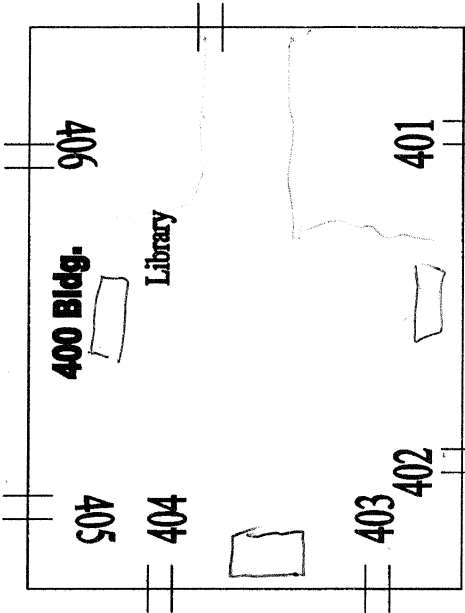

Gate

Playground

Parking Lot

# FIRE ESCAPE MAP

**NORTHWOOD SCHOOL**  
2760 E. TRIMBLE ROAD  
SAN JOSE, CA 95132  
(408) 923-1940



NORTHWOOD ELEMENTARY SCHOOL  
INSPECTED SEPTEMBER 2005











Bus Loop

Playground

Park

Playground

Field

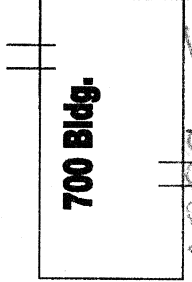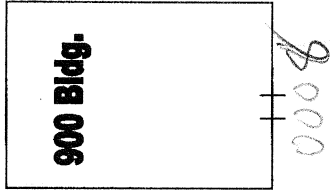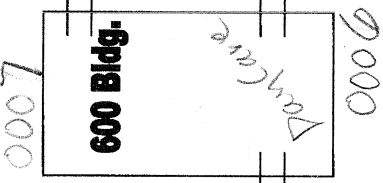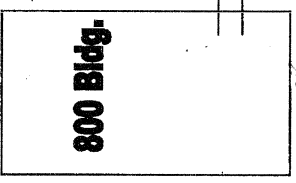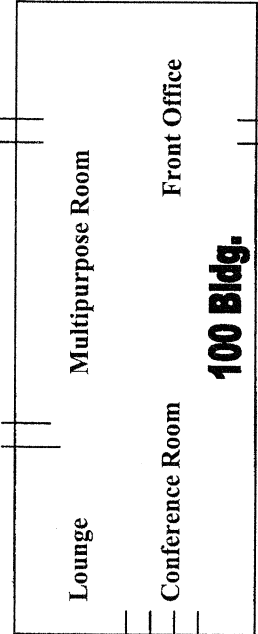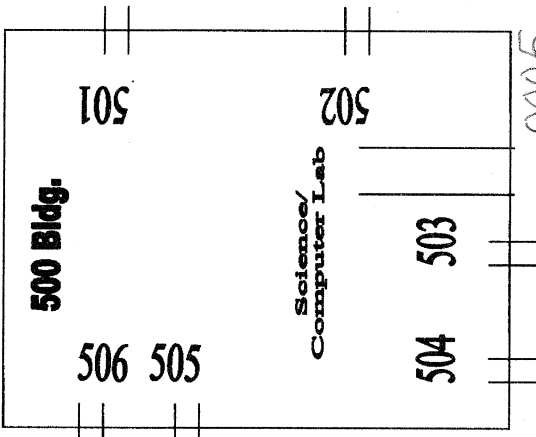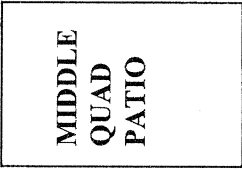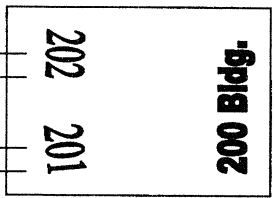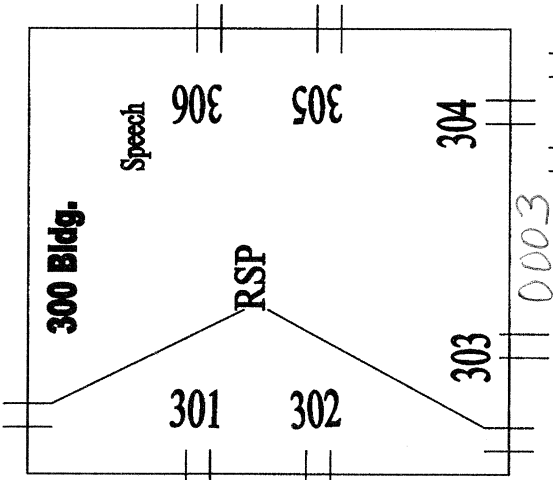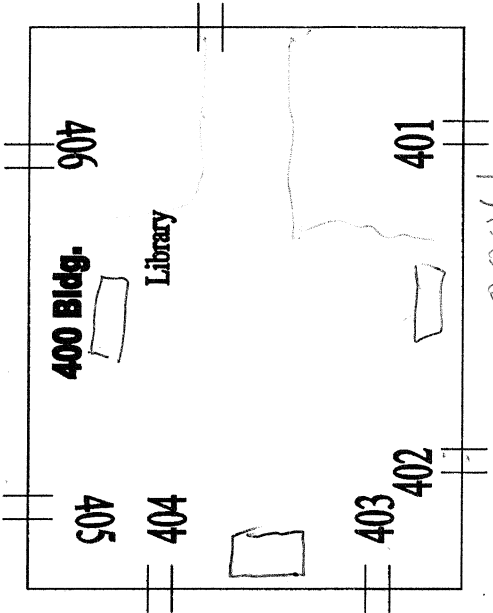

Gate

Playground

Parking Lot

# FIRE ESCAPE MAP

**NORTHWOOD SCHOOL**  
2760 E. TRIMBLE ROAD  
SAN JOSE, CA 95132  
(408) 923-1940