

SIX-MONTH SURVEILLANCE AHERA REPORT

**BUESD MAINTENANCE AND TRANSPORTATION YARD
945 PIEDMONT ROAD
SAN JOSE, CA 95132**

**PREPARED FOR:
BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
1376 PIEDMONT ROAD
SAN JOSE, CA 95132**

**INSPECTED ON:
Mar. 27, 2017**

HAZMAT DOC PROJECT #17-059

**PREPARED BY:
HAZMAT DOC
3080 OLCOTT STREET • SUITE 135 D
SANTA CLARA, CA 95054
Tel: 408.748.0055
Fax: 408.748.0066**

**BERRYESSA UNION ELEMENTARY SCHOOL DISTRICT
BUESD MAINTENANCE AND TRANSPORTATION YARD**


**INSPECTED ON:
Mar. 27, 2017**

INSPECTED BY:



**Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798**

REPORTED BY:

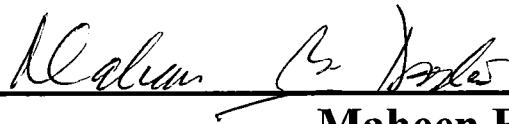

**Maheen B. Doctor
Cal/OSHA Certified Asbestos Consultant
Certification Number 95-1798**

CONTENTS

PART - I

LEGEND AND GLOSSARY OF TERMS

PART – II

AHERA REPORT A – LIST OF BUILDINGS

PART – III

AHERA REPORT B – SURVEY REPORT

PART – IV

HOMOGENEOUS MATERIALS REPORT

PART – V

FRIABLE LOCATIONS REPORT

PART – VI

NON-FRIABLE LOCATIONS REPORT

PART – VII

RECOMMENDATIONS REPORT

PART – VIII

SAMPLES REPORT

PART – IX

DAMAGE REPORT

PART - X

SITE MAPS

LEGEND

THE FOLLOWING IS A LIST OF ABBREVIATIONS USED IN THIS REPORT:

Asbestos Sample Types:

| | | |
|----|---|---------------|
| AC | = | ACTINOLITE |
| AM | = | AMOSITE |
| AN | = | ANTHOPHYLLITE |
| CH | = | CHRYSOTILE |
| CR | = | CROCIDOLITE |
| TR | = | TREMOLITE |
| ND | = | NONE DETECTED |
| NS | = | NO SAMPLE |

Measurements

| | | |
|---------|---|------------------|
| APPROX. | = | APPROXIMATELY |
| EA | = | EACH |
| I | = | INCHES |
| LF | = | LINEAR FEET |
| N | = | NUMBER |
| O.D. | = | OUTSIDE DIAMETER |
| SF | = | SQUARE FEET |
| TBD | = | TO BE DETERMINED |

LIST OF BUILDINGS AT

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME BUILDING USED AS (#FLOORS) CONSTRUCTION | BUILDING AREA (APPROXIMATE) |
|--|--------------------------------|
| GROUNDS STORAGE BUILDING | |
| Storage (1) Wood, Concrete, Metal | 240 SF |
| MAINTENANCE GARAGE BUILDING | |
| Garage and Storage (1) Wood, Metal, Concrete | 730 SF |
| MAINTENANCE SHOPS OFFICE PORTABLE BUILDING | |
| Offices, Shops, Storage, Plumbing, and Locksmith (1) Wood and Metal Portable | 1,780 SF |
| MENTOR'S HOUSE | |
| Daycare (1) Wood, Metal, Plaster | 1,840 SF |
| METAL STORAGE CONTAINERS (8 EA) | |
| Storage (1) Metal | 2,560 SF |
| METAL STORAGE SHED | |
| Storage (1) Metal Wall and Ceiling, Wood, and Asphalt | 725 SF |
| PG&E NORTH TOWER BUILDING | |
| PG&E (1) Metal and Concrete | 154 SF |
| PG&E SOUTH TOWER ENCLOSURE | |
| PG&E (1) Wood Fence, and Concrete Floor | 533 SF |
| PORTABLE | |
| Storage (1) Wood, Metal | 480 SF |
| STORAGE PORTABLE BUILDING (REMOVED) | |
| Storage, Shops (1) Wood and Metal Portable | 0 SF |
| TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING | |
| Office, Lounge, Storage, Restrooms (1) Portable with Wood Floor and Preformed Walls | 3,750 SF |
| WAREHOUSE BUILDING | |
| Warehouse, Office, Storage, Lounge, Restrooms (1) Wood, Metal, Concrete | 9,000 SF |
| WELDING SHOP BUILDING | |
| Welding Shop (1) Wood, Metal, Concrete | 760 SF |

LIST OF BUILDINGS AT

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | BUILDING AREA (APPROXIMATE) |
|--|---------------------------------------|--|
| BUILDING USED AS (#FLOORS) CONSTRUCTION | | |
| WOOD SHEDS (2 EA) | | |
| Storage | | 200 SF |
| (1) | Wood | |
| WOOD STORAGE SHED | | |
| Storage | | 330 SF |
| (1) | Wood Wall and Ceiling, Concrete Floor | |
| Total Number Of Buildings : <u>15</u> | | (Approximate) Total Sq Ft. : <u>23,082</u> |
| End Of Report, Total Of 2 Pages | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

GROUPS STORAGE BUILDING

GROUPS STORAGE BUILDING

| | |
|------------|--|
| 03/06/2017 | BUILDING NOTES: |
| 10/13/2008 | Metal Ceiling, Wood Wall, Concrete Floor. |
| 12/01/2016 | Building name changed from GROUPS SHED to GROUPS STORAGE BUILDING. |

GROUPS STORAGE BUILDING

EXTERIOR

| | | | |
|---------------------------|-------|-----------|---------|
| FIRE DOOR CORE INSULATION | 21 SF | 15-174AAA | ASSUMED |
|---------------------------|-------|-----------|---------|

| | |
|------------|--|
| 09/16/2015 | Fire Door Core Insulation. (1 EA Doors). This Material is in GOOD condition as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

GROUPS STORAGE BUILDING

STORAGE

| | | | |
|---------------|--------|-----------|---------|
| MISCELLANEOUS | 240 SF | 08-241AAA | ASSUMED |
|---------------|--------|-----------|---------|

| | |
|------------|---|
| 10/13/2008 | Metal Ceiling, Wood Wall and Concrete Floor Shed. This Material is in GOOD condition as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

MAINTENANCE GARAGE BUILDING

MAINTENANCE GARAGE BUILDING

03/06/2017 BUILDING NOTES:

03/05/2007 Building Name changed from BUS GARAGE to BUS GARAGE BUILDING.

12/01/2016 Building Name changed from BUS GARAGE BUILDING to MAINTENANCE GARAGE BUILDING.

MAINTENANCE GARAGE BUILDING

OFFICE

SINK UNDERCOATING

5 SF

09-098AAA

ASSUMED

05/11/2009 Black Thermal Undercoating on Sink. (1 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 08/30/10.)

08/30/2010 Undercoating is Black. Original entry updated. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

MAINTENANCE GARAGE BUILDING

OFFICE

SUSPENDED CEILING TILE

260 SF

05-212AAA

ASSUMED

05/11/2009 * Damages observed on.

09/06/2005 2'X4' SUSPENDED CEILING TILE. This Material is in GOOD condition as of this date.

05/11/2009 Damage: <5% Physical Damage in the form of minor cuts and holes. <10% Water Damage due to 3 Tiles with water stains. Material Condition changed from GOOD to FAIR overall as of this date. Friability changed from Moderate to High to reflect this change.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

| | |
|------------|---|
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | Additional Damage Observed. 11 Tiles have Water Damage. No other changes as of this date. |

MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

| | | | | |
|------------|---|----------|-----------|---------|
| | SMOOTH WALL MISCELLANEOUS | 2,650 SF | 05-212AAA | ASSUMED |
| 09/06/2005 | GYPSUM WALLBOARD SYSTEM WALLS and CEILINGS. This Material is in GOOD condition as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

MAINTENANCE GARAGE BUILDING

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

| | | | | |
|------------|---|----------|-----------|---------|
| | SMOOTH WALL SURFACING | 2,650 SF | 05-212AAA | ASSUMED |
| 04/18/2006 | skim coat for GYPSUM WALLBOARD SYSTEM WALLS and CEILINGS. This Material is in GOOD condition as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

MAINTENANCE GARAGE BUILDING

REPAIR / SERVICES GARAGE

| | | | | |
|------------|---|------|-----------|---------|
| | CHALK BOARD | 8 SF | 09-098AAA | ASSUMED |
| 07/30/2010 | * Various changes. | | | |
| 05/11/2009 | 20 SF Green Cementitious Chalkboard, (on Wall next to office). (1 EA). 8 SF Black Cementitious Chalkboard, (located on Door to office). (1 EA). This Material is in GOOD condition as of this date. | | | |

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| 08/30/2010 | Material Description clarified. Green Chalkboard is Wood not Cementitious. Material Description changed from '20 SF Green Cementitious Chalkboard, (on Wall next to office).' | | | | | | | |
| 11/28/2011 | Chalkboard is Black and is located on Door to office. No other changes as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

MAINTENANCE GARAGE BUILDING

REPAIR / SERVICES GARAGE

| | | | | |
|-------------|---|------|-----------|---------|
| WALL MASTIC | | 8 SF | 09-098AAA | ASSUMED |
| 07/30/2010 | * Various changes. | | | |
| 05/11/2009 | Mastic/Adhesive for 20 SF Green Cementitious Chalkboard, (on Wall next to office). (1 EA). 8 SF Black Cementitious Chalkboard, (located on Door to office). (1 EA). This Material is in GOOD condition as of this date. | | | |
| 08/30/2010 | Material Re-Assessed. Material Description changed from '20 SF Green Cementitious Chalkboard, (on Wall next to office).' to '20 SF Green Wood Chalkboard, (on Wall next to office) .8 SF Black Cementitious Chalkboard, (located on Door to office)' Quantity changed from 28 SF to 8 SF. No other changes as of this date. | | | |
| 11/28/2011 | Chalkboard is Black and is located on Door to office. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

MAINTENANCE GARAGE BUILDING

RESTROOMS (2), AND SHOWER ROOM

HEAT SHIELD

7.5 SF

05-212AAA

ASSUMED

| | |
|------------|--|
| 10/08/2012 | * Material Re-Assessed on. |
| 03/05/2007 | Heat Shields. (3 EA Round Light Fixtures). This Material is in GOOD condition as of this date. |
| 04/13/2012 | Quantity Re-Assessed and changed from 7.5 SF to 3.5 SF. No other changes as of this date. |
| 10/08/2012 | Material Re-Assessed and Quantity is 7.5 SF. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

03/06/2017 BUILDING NOTES:

03/05/2007 Building Name changed from OFFICE PORTABLE to OFFICE PORTABLE BUILDING.

12/01/2016 Building Name changed from OFFICE PORTABLE BUILDING to MAINTENANCE SHOPS OFFICE PORTABLE BUILDING.

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

DOORS - EXTERIOR

FIRE DOOR CORE INSULATION

42 SF

12-185AAA

ASSUMED

10/08/2012 Fire Door Core Insulation. (2 EA Doors). This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

DOORS - INTERIOR

FIRE DOOR CORE INSULATION

168 SF

09-095AAA

ASSUMED

10/08/2012 * Various changes.

03/17/2016 * Location Description changed on.

05/11/2009 Fire Door Core Insulation. (6 EA Doors). All Wood Interior Doors to Offices, Storage Rooms, and Utility Closet. This Material is in GOOD condition as of this date.

10/08/2012 Material Description changed from ' Fire Door Core Insulation. (6 EA Doors). ' to ' Fire Door Core Insulation. (8 EA Doors). ' Quantity changed from 144 SF to 168 SF. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | COMMENTS | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------|--|----------------------|------------|-------------------------------|
|---------------|--|----------|--|---------------|--|----------|--|----------------------|------------|-------------------------------|

| | | | | | | | | | |
|------------|--|--|--|--|--|--|--|--|--|
| 03/17/2016 | Location Description changed from OFFICE PORTABLE to DOORS-INTERIOR. No other changes as of this date. | | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

EXTERIOR WALLS

WEATHER PROOFING (OUTSIDE)

2,800 SF

05-212AAA

ASSUMED

| | | | | | | | | | |
|------------|---|--|--|--|--|--|--|--|--|
| 09/23/2013 | * Friability changed on. | | | | | | | | |
| 04/18/2006 | WEATHER PROOFING WALL PANELS. This Material is in GOOD condition as of this date. | | | | | | | | |
| 09/23/2013 | Friability changed from Moderate to Non. No other changes as of this date. | | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date | | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date.. | | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC

20 LF

05-212AAA

ASSUMED

| | | | | | | | | | |
|------------|--|--|--|--|--|--|--|--|--|
| 04/18/2006 | MASTIC/Adhesive FOR 4" BLUE BASEBOARD. This Material is in GOOD condition as of this date. | | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | | |
|---------------|--|---------------|------------|----------|--|
| LOCATION | | | | ASBESTOS | |
| MATERIAL TYPE | | QTY | | CONTENT | |
| COMMENTS | | (APPROXIMATE) | SAMPLE NO. | (TYPE) | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

SMOOTH WALL MISCELLANEOUS

1,000 SF

05-212AAA

ASSUMED

| | |
|------------|---|
| 04/18/2006 | * Location Name change on. |
| 09/06/2005 | Gypsum Wallboard System, Walls. This Material is in GOOD condition as of this date. |
| 04/18/2006 | Location changed from CENTRAL SHOP AREA to HVAC OFFICE AND HALLWAY. Quantity changed from 900 SF to 1,000 SF. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING

1,000 SF

05-212AAA

ASSUMED

| | |
|------------|---|
| 04/18/2006 | * Location Name change on. |
| 09/06/2005 | Skim Coat for Gypsum Wallboard System, Walls. This Material is in GOOD condition as of this date. |
| 04/18/2006 | Location changed from CENTRAL SHOP AREA to HVAC OFFICE AND HALLWAY. Quantity changed from 900 SF to 1,000 SF. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date.. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

BASEBOARD MASTIC

265 LF

05-212AAA

ASSUMED

| | |
|------------|---|
| 11/08/2007 | * Various changes as of. |
| 11/28/2011 | * Damage observed. |
| 08/28/2014 | * Damage observed. |
| 09/06/2005 | MASTIC/Adhesive for 3" Cream BASEBOARD. This Material is in GOOD condition as of this date. |
| 11/05/2007 | Material Re-Assessed. Damage: <5% Physical Damage - due to 5 LF loose in Front Office. Friability changed from Low to Moderate. Material condition changed from GOOD to FAIR overall. No other changes as of this date. |
| 11/28/2011 | Additional Damage observed - in the form of approximately 20 LF is loose in 1 Office. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | Material Re-Assessed. Additional 40 LF of Damage found. Baseboard is missing and Mastic/Adhesive is exposed. No other changes as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | Additional Damage Observed. 8 LF Loose Mastic Exposed in Office 1. 8 LF Loose and 4 LF Missing in Office 2. No other changes as of this date. |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

2,660 SF

08-241AAA

ASSUMED

| | |
|------------|---|
| 03/27/2017 | Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 10/13/2008 | 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

09/09/2016 This Material is unchanged as of this date.

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

PRESSED WOOD WALL PANEL MASTIC 2,660 SF

10/13/2008 Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

SUSPENDED CEILING TILE 1,600 SF

05-212AAA

ASSUMED

11/28/2011 * Damage observed.

09/09/2016 * Additional Damage observed on.

09/06/2005 2'X4' SUSPENDED CEILING TILE. This Material is in GOOD condition as of this date.

11/28/2011 Damage: <10% Water Damage - in the form of 2 Tiles are Water Damaged in Office; <5% Physical Damage - in the form of 1 Tile is broken. Material condition changed from GOOD to FAIR overall. Friability changed from Moderate to High. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 Additional Damage observed. 1 Tile is missing in Office. No other changes as of this date.

03/27/2017 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|---------------|------------|-------------------------------|
| COMMENTS | | | | | | (APPROXIMATE) | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

VINYL WALL COVER

2,660 SF

05-212AAA

ASSUMED

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 03/27/2017 | Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 09/06/2005 | 4'X10' VINYL COVER on Pressed Wood WALL PANELS. This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

VINYL WALL COVER MASTIC

2,660 SF

08-241AAA

ASSUMED

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 10/13/2008 | Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|--|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| MAINTENANCE SHOPS OFFICE PORTABLE BUILDING | | | | | | | | |
| OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE | | | | | | | | |
| CARPET MASTIC | | 1,600 SF | | 05-212AAA | | ASSUMED | | |
| 03/18/2015 | * Damage observed. | | | | | | | |
| 04/18/2006 | MASTIC/Adhesive FOR GREEN CARPET. This Material is in GOOD condition as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | Damage Observed. Offices have Approximately 1 SF of Carpet Damaged exposing Mastic/Adhesive. Material Condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

MENTOR'S HOUSE

MENTOR'S HOUSE

03/07/2017 BUILDING NOTES:

09/09/2016 Building name changed from DAYCARE BUILDING to MENTOR'S HOUSE.

MENTOR'S HOUSE

ALL ROOMS

BASEBOARD MASTIC

640 LF

05-212AAA

ASSUMED

03/27/2017 Material Re-assessed. 1 Office has the Basebaord removed. Quantity changed from 940 LF to 640 LF. No other changes as of this date

04/18/2006 MASTIC/Adhesive for 4" BROWN BASEBOARD. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

MENTOR'S HOUSE

ATTIC

LOOSE FILL INSULATION

800 SF

05-212AAA

ASSUMED

09/06/2005 BLOWN-IN INSULATION. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|-----------------|---|----------------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | |
| MENTOR'S HOUSE | | | | | | |
| DAYCARE KITCHEN | | | | | | |
| | | VINYL SHEETING | 250 SF | 05-212AAA | ASSUMED | |
| 09/23/2013 | * Friability changed on. | | | | | |
| 09/06/2005 | GREEN VINYL SHEETING. This Material is in GOOD condition as of this date. | | | | | |
| 04/18/2006 | Vinyl Sheeting has Square Patterns. No other changes as of this date. | | | | | |
| 04/14/2008 | 1 SF is cut and missing in the center of the Kitchen and this Material is in FAIR condition as of this date. | | | | | |
| 10/13/2008 | Damages Re-Assessed. Material has been Repaired. This Material changed from FAIR to GOOD condition as of this date. | | | | | |
| 09/23/2013 | Friability changed from Low to Non. No other changes as of this date. | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | |
| 03/17/2016 | New Gray Speckled Vinyl Floor Sheeting installed. Old Material may remain under New Material. No other changes as of this date. | | | | | |
| 03/17/2016 | Gray Speckle Vinyl Floor Sheeting. This Material is in GOOD condition as of this date. | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | |

| MENTOR'S HOUSE | | | | |
|-------------------------------------|--|--------|-----------|---------|
| DAYCARE KITCHEN | | | | |
| VINYL SHEETING BACKING PAPER/MASTIC | | 250 SF | 05-212AAA | ASSUMED |
| 09/23/2013 | * Friability changed on. | | | |
| 09/06/2005 | BACKING PAPER FOR GREEN VINYL SHEETING. This Material is in GOOD condition as of this date. | | | |
| 04/14/2008 | 1 SF is cut and missing in the center of the Kitchen and this Material is in FAIR condition as of this date. | | | |
| 10/13/2008 | Damages reassessed. Material has been replaced. This Material has changed from FAIR to GOOD condition as of this date. | | | |
| 09/23/2013 | Friability changed from High to Low. No other changes as of this date. | | | |
| 03/03/2014 | Friability changed from Low to Moderate. No other changes as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------------------|------------|-------------------------------|
| LOCATION | MATERIAL TYPE | | | |
| COMMENTS | | | | |
| | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | New Gray Speckled Vinyl Floor Sheeting installed. Old Material may remain under New Material. No other changes as of this date. | | | |
| 03/17/2016 | Backing Paper for Gray Speckle Vinyl Floor Sheeting. This Material is in GOOD condition as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

MENTOR'S HOUSE

DAYCARE ROOM AND ENTRY TO KITCHEN

| | | | | |
|----------------|---|--------|-----------|---------|
| CEILING MASTIC | | 500 SF | 05-212AAA | ASSUMED |
| 09/06/2005 | MASTIC/Adhesive FOR 1'X1' CEILING TILE. This Material is in GOOD condition as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

MENTOR'S HOUSE

DAYCARE ROOM AND ENTRY TO KITCHEN

| | | | | |
|--------------|---|--------|-----------|---------|
| CEILING TILE | | 500 SF | 05-212AAA | ASSUMED |
| 09/06/2005 | 1'X1' CEILING TILE. This Material is in GOOD condition as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

MENTOR'S HOUSE

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

240 SF

08-075AAA

ASSUMED

04/14/2008 Mastic/Adhesive for Brown/Grey Carpet. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

6,400 SF

05-212AAA

ASSUMED

08/28/2014 * Damage observed on.

03/17/2016 * Additional Damage observed on.

03/27/2017 Additional Damage Observed. 12 LF is Cracked in Kitchen. No other changes as of this date.

09/06/2005 GYPSUM WALLBOARD SYSTEM WALLS, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.

04/18/2006 This Material is also on ceilings. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 Damage observed. Physical Damage <5% in the of form of a crack in the Hallway. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 Additional Damage observed. 6 LF is cracked in Kitchen. No other changes as of this date.

09/09/2016 This Material is unchanged as of this date.

MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL SURFACING

6,400 SF

05-212AAA

ASSUMED

08/28/2014 * Damage observed.

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| 03/17/2016 | * Additional Damage observed on. | | | | | | | |
| 03/27/2017 | Additional Damage Observed. 12 LF is Cracked in Kitchen. 2 Small Holes in Large Room with Wood Ceilings. No other changes as of this date. | | | | | | | |
| 04/18/2006 | skim coat for GYPSUM WALLBOARD SYSTEM WALLS, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | Damage observed. Physical Damage <5% in the of form of a crack in the Hallway. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | Additional Damage observed. 6 LF is cracked in Kitchen. No other changes as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |

MENTOR'S HOUSE

EXTERIOR WALLS

ROUGH WALL

1,400 SF

05-212AAA

ASSUMED

| | | | | | | | | |
|------------|---|--|--|--|--|--|--|--|
| 03/05/2007 | * Material Description changed on. | | | | | | | |
| 09/06/2005 | STUCCO WALLS. This Material is in GOOD condition as of this date. | | | | | | | |
| 03/05/2007 | Material changed from 'Stucco Walls.' to 'Exterior Stucco Walls.' No other changes as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

MENTOR'S HOUSE

EXTERIOR WALLS

ROUGH WALL SURFACING

1,400 SF

05-212AAA

ASSUMED

| | | | | | | | | |
|------------|---|--|--|--|--|--|--|--|
| 09/06/2005 | SKIM COAT for STUCCO WALLS. This Material is in GOOD condition as of this date. | | | | | | | |
| 03/05/2007 | Material changed from 'Skim Coat for Stucco Walls.' to 'Skim Coat for Exterior Stucco Walls.' No other changes as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) | | | |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|--|--|--|
| COMMENTS | | | | | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | | | | |

MENTOR'S HOUSE

EXTERIOR WINDOWS

| CAULKING | | 400 LF | 05-212AAA | ASSUMED |
|------------|---|--------|-----------|---------|
| 05/11/2009 | * Additional Damage observed as of. | | | |
| 09/06/2005 | WINDOW CAULKING. Damaged in various areas. This Material is in FAIR condition as of this date. | | | |
| 05/11/2009 | Damage: <10% Water Damage due to moisture and heat degradation on various surfaces. Material remains in FAIR condition overall as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

MENTOR'S HOUSE

KITCHEN (COUNTER TOP) AND RESTROOM

| MORTAR MISCELLANEOUS | | 820 SF | 05-212AAA | ASSUMED |
|----------------------|---|--------|-----------|---------|
| 05/11/2009 | * Various changes on. | | | |
| 04/18/2006 | Grout/Mortar for 4"x4" Tan/Light Brown Ceramic Tile. This Material is in GOOD condition as of this date. (Original Entry updated on 04/14/08.) | | | |
| 04/14/2008 | 4"x4" Ceramic Tile are Tan/Light Brown. Original entry updated. No other changes as of this date. | | | |
| 05/11/2009 | Material Re-Assessed. Approximately 70 SF is covering the floor, and approx. 50 SF is under the rubber floor mat. Quantity changed from 750 SF to 820 SF. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------|--|---------------|--|---------------|------------|-------------------------------|
| COMMENTS | | | | | | (APPROXIMATE) | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

MENTOR'S HOUSE

OFFICE AND DAYCARE ROOMS

| | | | | |
|---------------|--|----------|-----------|---------|
| CARPET MASTIC | | 1,300 SF | 05-212AAA | ASSUMED |
| 09/06/2005 | MASTIC/Adhesive fOR Blue CARPET. This Material is in GOOD condition as of this date. (Original Entry updated on 04/14/08.) | | | |
| 04/14/2008 | Carpet is Blue. Original entry updated. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

MENTOR'S HOUSE

RESTROOM

| BASEBOARD MASTIC | | 20 LF | 08-241AAA | ASSUMED |
|------------------|--|-------|-----------|---------|
| 10/13/2008 | Mastic/Adhesive for 4" Blue Baseboard. This Material is in GOOD condition as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

MENTOR'S HOUSE

RESTROOM

VINYL FLOOR TILE

32 SF

08-241AAA

ASSUMED

| | |
|------------|---|
| 09/23/2013 | * Friability changed on. |
| 10/13/2008 | 12"x12" Off-White Vinyl Floor Tile. This Material is in GOOD condition as of this date. |
| 09/23/2013 | Friability changed from Low to Non. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

MENTOR'S HOUSE

RESTROOM

VINYL FLOOR TILE MASTIC

32 SF

08-241AAA

ASSUMED

| | |
|------------|---|
| 10/13/2008 | Mastic/Adhesive for 12"x12" off White Vinyl Floor Tile. This Material is in GOOD condition as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------------------------|--|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | |
| METAL STORAGE CONTAINERS (8 EA) | | | | | | |
| METAL STORAGE CONTAINERS (8 EA) | | | | | | |
| 03/06/2017 | BUILDING NOTES: | | | | | |
| 09/06/2005 | Assumed Non-ACM. All Metal Construction. | | | | | |
| 11/28/2011 | Building Name changed from METAL STORAGE SHEDS to METAL STORAGE CONTAINERS (8 EA). Area changed from 3,180 SF to 2,560 SF. | | | | | |
| METAL STORAGE CONTAINERS (8 EA) | | | | | | |
| METAL STORAGE CONTAINERS (8 EA) | | | | | | |
| | STORAGE CONTAINER | 2,560 SF | 05-212.NS | | ASSUMED | |
| 04/18/2006 | * Various changes on. | | | | | |
| 03/05/2007 | * Location Name changed on. | | | | | |
| 07/30/2010 | * Various changes on. | | | | | |
| 11/28/2011 | * Various changes on. | | | | | |
| 09/06/2005 | Metal Storage Containers. 6 EA, approximately 426 SF EA. | | | | | |
| 04/18/2006 | Material redefined as (3) Metal Storage Units. Quantity changed from 530 SF to 1,590 SF. No other changes as of this date. | | | | | |
| 03/05/2007 | Location Name changed from METAL STORAGE SHEDS to METAL STORAGE SHEDS (3). No other changes as of this date. | | | | | |
| 08/30/2010 | Location Description changed from METAL STORAGE SHEDS (3) to METAL STORAGE SHEDS (6). Quantity changed from 1,590 SF to 3,180 SF. No other changes as of this date. | | | | | |
| 11/28/2011 | Location Description changed from METAL STORAGE SHEDS (6) to METAL STORAGE CONTAINERS (8). Quantity changed from 3,180 SF to 2,560 SF. No other changes as of this date. | | | | | |
| 11/28/2011 | This Material is unchanged as of this date. | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

METAL STORAGE SHED

METAL STORAGE SHED

03/07/2017 BUILDING NOTES:

11/28/2011 Metal Storage Shed.

METAL STORAGE SHED

METAL STORAGE SHED

STORAGE BUILDING

725 SF

11-202.NS

ASSUMED

11/28/2011 Metal Storage Shed. 1 EA.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

PG&E NORTH TOWER BUILDING

PG&E NORTH TOWER BUILDING

03/07/2017 BUILDING NOTES:

11/28/2011 Metal and Concrete Building.

12/01/2016 Building name changed from PG&E to PG&E NORTH TOWER BUILDING.

PG&E NORTH TOWER BUILDING

PG&E

MISCELLANEOUS

154 SF

16-074.NS

ASSUMED

03/17/2016 Metal and Concrete Building. This Material is in GOOD condition as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

PG&E SOUTH TOWER ENCLOSURE

PG&E SOUTH TOWER ENCLOSURE

03/07/2017 BUILDING NOTES:

12/01/2016 Building name changed from TOWER to PG&E SOUTH TOWER ENCLOSURE.

PG&E SOUTH TOWER ENCLOSURE

TOWER

WOOD WALL

533 SF

11-202.NS

NON-ACM

11/28/2011 Wood Wall. Non-ACM Material identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

PORTABLE

PORTABLE

EXTERIOR DOOR

FIRE DOOR CORE INSULATION

42 SF

10-174AAA

ASSUMED

| | |
|------------|---|
| 11/28/2011 | * Material Description changed. |
| 07/30/2010 | Fire Door Core Insulation. (2 EA Double-Doors). This Material is in GOOD condition as of this date. |
| 11/28/2011 | Material Description reassessed and changed from 'Fire Door Core Insulation. (2 EA Double-Doors).' to 'Fire Door Core Insulation. (2 EA Single-Doors).' No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

PORTABLE

INTERIOR DOOR

FIRE DOOR CORE INSULATION

21 SF

10-174AAA

ASSUMED

| | |
|------------|---|
| 11/28/2011 | * Material Description changed. |
| 07/30/2010 | Fire Door Core Insulation. (1 EA Double-Doors). This Material is in GOOD condition as of this date. |
| 11/28/2011 | Material Description reassessed and changed from ' Fire Door Core Insulation. (1 EA Double-Doors). ' to ' Fire Door Core Insulation. (1 EA Single-Doors). ' No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

PORTABLE

PORTABLES

BASEBOARD MASTIC

130 LF

10-174AAA

ASSUMED

| | |
|------------|---|
| 07/30/2010 | Mastic/Adhesive for 4" Brown Baseboard. This Material is in GOOD condition as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

PORTABLE

PORTABLES

SUSPENDED CEILING TILE

450 SF

10-174AAA

ASSUMED

| | |
|------------|---|
| 08/28/2014 | * Damage observed on. |
| 07/30/2010 | 2'x4' Vinyl Covered Fiberglass Suspended Ceiling Tile. This Material is in GOOD condition as of this date. |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | Damage observed. <5% Physical Damage - 1 Tile is Damaged. Friability changed from Non to Low. No other changes as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

PORTABLE

PORTABLES

VINYL FLOOR TILE

480 SF

10-174AAA

ASSUMED

| | |
|------------|--|
| 11/28/2011 | * Damage observed. |
| 03/27/2017 | Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date. |

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) | | | |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|--|--|--|
| COMMENTS | | | | | | | | | | | |
| 07/30/2010 | 12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date. | | | | | | | | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | | | | |

PORTABLE

PORTABLES

VINYL FLOOR TILE MASTIC

480 SF

10-174AAA

ASSUMED

| | |
|------------|---|
| 11/28/2011 | * Damage observed on. |
| 03/27/2017 | Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date. |
| 07/30/2010 | Mastic/Adhesive for 12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 09/23/2013 | This Material is unchanged as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE BUILDING (REMOVED)

03/06/2017 BUILDING NOTES:

03/05/2007 Building Name changed from STORAGE PORTABLE to STORAGE PORTABLE BUILDING.

09/09/2016 Building Removed as of this date. Building Quantity changed from 3,000 SF to 0 SF.

STORAGE PORTABLE BUILDING (REMOVED)

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING

0 SF

16-213REM

REMOVED

09/09/2016 * Building Removed as of.

09/06/2005 BEIGE VINYL SHEETING. This Material is in GOOD condition as of this date.

04/18/2006 Material is in POOR condition due to Major Damages. >10% Physical and >10% Water Damages noted. Friability changed from Low to High. Condition changed from GOOD to POOR. Recommendation changed to reflect this fact. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 Building removed as of this date. Material Quantity changed from 50 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date.

STORAGE PORTABLE BUILDING (REMOVED)

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING BACKING PAPER/MASTIC

0 SF

16-213REM

REMOVED

09/06/2005 BACKING PAPER/Adhesive for BEIGE VINYL SHEETING. This Material is in GOOD condition as of this date.

04/18/2006 Material is in poor condition due to major damages. >10% physical and >10% water damages noted. Friability changed from Low to High. Condition changed from GOOD to POOR. Recommendation changed to reflect this fact. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

| | |
|------------|---|
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 50 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

BASEBOARD MASTIC

0 LF

16-213REM

REMOVED

| | |
|------------|---|
| 03/17/2016 | * Friability changed on. |
| 09/09/2016 | * Building Removed as of. |
| 09/06/2005 | MASTIC/Adhesive FOR 4" BASEBOARD. This Material is in GOOD condition as of this date. |
| 04/18/2006 | Material is in FAIR condition due to approximately 20 LF noted to be loose. Friability changed from Low to Moderate. Condition changed from GOOD to FAIR. No other changes as of this date. |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 312 LF to 0 LF and Recommendation changed to reflect this fact. No other changes as of this date. |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

CARPET MASTIC

0 SF

16-213REM

REMOVED

| | |
|------------|--|
| 09/23/2013 | * Condition changed on. |
| 09/09/2016 | * Building Removed as of. |
| 09/06/2005 | MASTIC/Adhesive FOR CARPET, ON WOOD FLOOR. This Material is in GOOD condition as of this date. |
| 04/18/2006 | Material is in POOR condition due to major Damages. Approximately 50% is cut and damaged. Friability changed from Low to High. Condition changed from GOOD to POOR. Recommendation changed to reflect this fact. No other changes as of this date. |
| 09/23/2013 | Material Re-Assessed. Material changed from POOR condition to FAIR condition as of this date. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

| | |
|------------|--|
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 3,000 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

| | | | | |
|------------|--|------|------------------|----------------|
| | PRESSED WOOD WALL PANEL | 0 SF | 16-213REM | REMOVED |
| 11/28/2011 | * Damage observed. | | | |
| 09/09/2016 | * Building Removed as of. | | | |
| 04/14/2008 | 4'x10' Pressed Wood Wall Panel, (with Wood Wall Cover). This Material is in GOOD condition as of this date. | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF is damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 800 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. | | | |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

| | | | | |
|------------|---|------|------------------|----------------|
| | PRESSED WOOD WALL PANEL MASTIC | 0 SF | 16-213REM | REMOVED |
| 11/28/2011 | * Damage observed. | | | |
| 09/23/2013 | * Friability changed on. | | | |
| 09/09/2016 | * Building Removed as of. | | | |
| 04/14/2008 | Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel, (with Wood Wall Cover). This Material is in GOOD condition as of this date. | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF is damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Low to Moderate to reflect this change. | | | |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|--|----------------------|------------|-------------------------------|
| 08/28/2014 | | This Material is unchanged as of this date. | | | |
| 03/18/2015 | | This Material is unchanged as of this date. | | | |
| 09/16/2015 | | This Material is unchanged as of this date. | | | |
| 03/17/2016 | | This Material is unchanged as of this date. | | | |
| 09/09/2016 | | Building removed as of this date. Material Quantity changed from 800 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. | | | |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

SUSPENDED CEILING TILE

0 SF

16-213REM

REMOVED

| | |
|------------|--|
| 11/28/2011 | * Additional damage observed. |
| 09/16/2015 | * Damage and Quantity Re-Assessed. |
| 09/09/2016 | * Building Removed as of. |
| 09/06/2005 | 2'X4' SUSPENDED CEILING TILE. Approximately 30% missing and loose. This Material is in POOR condition as of this date. |
| 04/18/2006 | Damages extended to approximately 50% including broken Tiles noted. No other changes as of this date. |
| 10/13/2008 | Material Re-Assessed. Approximately 40% is missing. No other changes as of this date. |
| 11/28/2011 | Damage: <10% Water Damage - in the form of 6 Tiles are Water Damaged. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | Damage and Quantity Re-Assessed. Approximately 50% of Material is missing. Quantity changed from 2,000 to 1,000 SF. No other changes as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 1,000 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

VINYL WALL COVER

0 SF

16-213REM

REMOVED

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 09/23/2013 | * Friability changed on. |
| 09/09/2016 | * Building Removed as of. |
| 09/06/2005 | 4'X10' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date. |

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| 04/18/2006 | Quantity changed from 3,640 SF to 500 SF. Approximatly 3,140 SF is Wood Wall Panels. No other changes as of this date. | | | | | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF is damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Low to Moderate to reflect this change. | | | | | | | |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 500 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. | | | | | | | |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

VINYL WALL COVER MASTIC

0 SF

16-213REM

REMOVED

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 09/23/2013 | * Friability changed on. |
| 09/09/2016 | * Building Removed as of. |
| 03/05/2007 | mASTIC/Adhesive for 4'X10' VINYL COVERED WALL PANELS. This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF is damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Low to Moderate to reflect this change. |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 500 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

WALL MASTIC

0 SF

16-213REM

REMOVED

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 09/23/2013 | * Friability changed on. |
| 09/09/2016 | * Building Removed as of. |
| 04/14/2008 | Mastic/Adhesive for Wood Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF is damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Low to Moderate to reflect this change. |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | Building removed as of this date. Material Quantity changed from 800 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. |

STORAGE PORTABLE BUILDING (REMOVED)

STORAGE PORTABLE

WOOD WALL PANEL

0 SF

16-213REM

REMOVED

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 09/23/2013 | * Friability changed on. |
| 09/09/2016 | * Building Removed as of. |
| 04/14/2008 | Wood Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF is damaged. Material condition changed from GOOD to FAIR overall as of this date. Friability changed from Low to Moderate to reflect this change. |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | | SAMPLE NO. | | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|--|--|----------------------|--|------------|--|-------------------------------|
| COMMENTS | | | | | | | | | | |
| 09/16/2015 | | | | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | | | | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | | | | Building removed as of this date. Material Quantity changed from 800 SF to 0 SF and Recommendation changed to reflect this fact. No other changes as of this date. | | | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

03/06/2017 BUILDING NOTES:

03/05/2007 Building Name changed from MAIN OFFICE to MAIN OFFICE BUILDING.

12/01/2016 Building Name changed from MAIN OFFICE BUILDING to TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE

38 SF

11-202AAA

ASSUMED

03/27/2017 Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

11/28/2011 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

38 SF

11-202AAA

ASSUMED

03/27/2017 Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

11/28/2011 Mastic/Adhesive for 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

35

HazMat Doc

AHERA Report B - Survey

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---|--|------------------------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | |
| TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING | | | | | | |
| CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM | | | | | | |
| | | SUSPENDED CEILING TILE | 1,500 SF | 09-098AAA ASSUMED | | |
| 03/08/2010 | * Various changes on. | | | | | |
| 07/30/2010 | * Various changes on. | | | | | |
| 11/28/2011 | * Additional Damage observed on. | | | | | |
| 10/08/2012 | * Additional Damage observed on. | | | | | |
| 09/23/2013 | * Additional Damage observed on. | | | | | |
| 08/28/2014 | * Additional Damage observed on. | | | | | |
| 03/18/2015 | * Additional Damage observed on. | | | | | |
| 03/17/2016 | * Additional Damage observed on . | | | | | |
| 09/09/2016 | * Partial Repairs observed on. | | | | | |
| 03/27/2017 | Additional Damage Observed. 2 Tiles with Water Stains and Several Tiels Have been repainted in Staff Room. However 11 Tiles have Cracks and Cuts with Broken Edges in Staff Room. 5 Tiles have Water Damage while other have been Painted Over. Several Tiles have Cracks and Borken Edges in the Conferecnce Room. 2 Tiles have have Water Damage in the Storage by Front of the Building. 2 Tiles have Water Damage and 1 Tile Missing in the Storage by Rear of the Building. No other changes as of this date. | | | | | |
| 05/12/2009 | 2'x4' Suspended Ceiling Tile, (with small uneven cuts and holes pattern). Damage: <5% Physical Damage due to 3 missing Tiles. This Material is in FAIR condition as of this date. | | | | | |
| 03/08/2010 | Location Description changed from STAFF'S LOUNGE ROOM to CONFERENCE ROOM AND STAFF'S LOUNGE ROOM. Quantity changed from 500 SF to 1,500 SF. Additional Damage: <10% Water Damage in the form of 2 Tiles are Water Damaged. No other changes as of this date. | | | | | |
| 08/30/2010 | Location Description changed from CONFERENCE ROOM AND STAFF'S LOUNGE ROOM to CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND STORAGE ROOM. Additional Damage observed in Conference Room in the form of 3 Tiles are Water Damaged and 1 has a hole. No other changes as of this date. | | | | | |
| 11/28/2011 | Additional Damage observed - in the form of 3 more Tiles are Water Damaged, and 1 Tile is missing in Storage Room. No other changes as of this date. | | | | | |
| 10/08/2012 | Damage Re-Assessed and Conference Room now has a total of 4 Water Damaged Tiles. No other changes as of this date. | | | | | |
| 09/23/2013 | Material Re-Assessed. Conference Room now has Debris on Floor due to Water leaks from the Roof. No other changes as of this date. | | | | | |
| 03/03/2014 | Debris has been cleaned up. No other changes as of this date. | | | | | |
| 08/28/2014 | Material Re-Assessed. 2 Suspended Ceiling Tiles have Water Damage in the Office. | | | | | |
| 03/18/2015 | Additional Damage Observed. 3 Suspended Ceiling Tiles Water Damaged. No other change as of this date. | | | | | |

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|---|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | |
| 03/17/2016 | Additional Damage observed. 1 Tile is missing in Director's Office. No other changes as of this date. | | | | |
| 09/09/2016 | Partial Repairs observed. Current Damage: 2 Tiles with Water Damage in the Storage Room, and 1 Tile with Water Damage in the Conference Room. No other changes as of this date. | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ENTIRE BUILDING

| | | | | | |
|---------------------------|---|--|--------|-----------|---------|
| FIRE DOOR CORE INSULATION | | | 252 SF | 05-212AAA | ASSUMED |
| 09/06/2005 | FIRE DOOR CORE INSULATION. (12 EA DOORS). This Material is in GOOD condition as of this date. | | | | |
| 03/05/2007 | Friability changed from Low to High. No other changes as of this date. | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

EXTERIOR BUILDING

| | | | | | |
|----------------------------|--|--|----------|-----------|---------|
| WEATHER PROOFING (OUTSIDE) | | | 1,100 SF | 07-041AAA | ASSUMED |
| 11/28/2011 | * Damage observed. | | | | |
| 03/03/2014 | * Friability changed. | | | | |
| 03/17/2016 | * Repairs observed on. | | | | |
| 03/05/2007 | Weather Proofing Material. This Material is in GOOD condition as of this date. | | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 2 SF of Wall is peeling. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date. | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | |
| 03/17/2016 | Repairs observed. Damage has been Repaired. Material condition changed from FAIR to GOOD. Friability changed from Low to Non. No other changes as of this date. | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

LOUNGE ROOM

SINK UNDERCOATING

4 SF

08-075AAA

ASSUMED

04/14/2008 Black Thermal Undercoating on Sink. (1 EA Sink). This Material is in GOOD condition as of this date. (Original Entry updated on 03/17/16.)

08/30/2010 Undercoating is Black. Original entry updated. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

BASEBOARD MASTIC

1,400 LF

05-212AAA

ASSUMED

03/18/2015 * New material installed.

03/06/2017 * Material Re-Assessed 03.

03/27/2017 Damage Observed. <5% Physical Damage - in the form of 4" of Baseboard is missing in Main Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date.

09/06/2005 MASTIC/Adhesive FOR BASEBOARD. Approximately 15 LF exposed in Womens Restroom. This Material is in FAIR condition as of this date.

04/18/2006 Material redefined as 4" Black Baseboard (in Offices and Hallways) and 4" Blue Baseboard (in Conference Room). All Damages have been repaired. Friability changed from Low to Non. No other changes as of this date.

03/08/2010 Material Re-Assessed. 4" Brown Baseboard was also observed in several Offices and Main Entry Office. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 New Material Installed. Men's and Women's Restrooms Floor and Baseboard now Covered with Vinyl Sheeting. Old Material is Possibly Behind. No other changes as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

SMOOTH WALL MISCELLANEOUS

5,100 SF

05-212AAA

ASSUMED

05/11/2009 * Additional Damages observed on.

11/28/2011 * Additional Damage observed on.

09/06/2005 GYPSUM WALLBOARD SYSTEM, WALLS. Damages noticed. This Material is in FAIR condition as of this date.

05/11/2009 Additional Damages observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date.

11/28/2011 Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. Friability changed from Low to Moderate. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

SMOOTH WALL SURFACING

5,100 SF

05-212AAA

ASSUMED

11/28/2011 * Additional Damage observed.

04/18/2006 Skim coat for GYPSUM WALLBOARD SYSTEM, WALLS. Various Damages noticed. This Material is in FAIR condition as of this date.

05/11/2009 Additional Damages observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date.

11/28/2011 Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. Friability changed from Low to Moderate. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY | SAMPLE No. | ASBESTOS |
|---------------|---|----------|--|---------------|--|---------------|------------|----------|
| COMMENTS | | | | | | (APPROXIMATE) | | CONTENT |
| | | | | | | | | (TYPE) |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

| SUSPENDED CEILING TILE | | 2,150 SF | 05-212AAA | ASSUMED |
|------------------------|--|----------|-----------|---------|
| 11/08/2007 | * Various changes as of. | | | |
| 05/11/2009 | * Additional Damages observed as of. | | | |
| 09/03/2009 | * Various changes. | | | |
| 03/08/2010 | * Various changes. | | | |
| 11/28/2011 | * Additional Damage observed. | | | |
| 10/08/2012 | * Additional Damage observed. | | | |
| 08/28/2014 | * Additional Damage observed. | | | |
| 09/09/2016 | * Additional Damage observed on. | | | |
| 03/27/2017 | Additional Damage Observed. 4 Tiles with Water Damage and Several other have broken edges and are Cracked in the Director's Office. 4 Water Damage Tiles, 7 other Tiles have Cracks, in the Project Manager's Office. 4 Tiles with Cracked and Chipped Tiles in the Executive Assistant Office. No other changes as of this date. | | | |
| 09/06/2005 | 2'X4' SUSPENDED CEILING TILE. Several Tiles Damaged and Water stained. This Material is in FAIR condition as of this date. | | | |
| 11/05/2007 | Material Re-Assessed. Damage: <5% Physical Damage - 1 Tile in Telephone Panel Closet and 1 Tile in Mens Restroom; <10% Water Damage - 2 Tiles in Blueprint Office and 4 Tiles in Trainer Office. This Material is in FAIR condition overall as of this date. | | | |
| 04/14/2008 | Additional Damage noted: 1/2 Tile is missing in the Supply Storage Room as of this date. | | | |
| 10/13/2008 | Additional 3 Tiles missing at Lounge area. Also several Tiles Damaged at Hallway. No other changes as of this date. | | | |
| 05/11/2009 | Damages Re-Assessed. 1 Tile is missing above the Main Entry Door, (next to Receptionist Office). Physical damage is in various locations. Tiles damaged in Telephone Panel Closet has increased to 3 Tiles. Quantity changed from 2,650 SF to 3,150 SF. No change to damage in Hallway. Friability changed from Moderate to High to reflect these changes. | | | |
| 09/03/2009 | Repairs have been made in Main Lobby. Missing Tile has been replaced. Also, 3 Tiles Damaged at Hallway have been repaired. Telephone Panel Closet and Storage Closet are Water Damaged. No other changes as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | | SAMPLE NO. | | ASBESTOS CONTENT (TYPE) | | COMMENTS | |
|---------------|--|----------|--|--|--|----------------------|--|------------|--|-------------------------------|--|----------|--|
| 03/08/2010 | | | | Material Re-Assessed. Approx. 1,000 SF of 2'x4' Suspended Ceiling Tile is the same as Staff's Lounge. Quantity changed from 3,150 SF to 2,150 SF. Additional Damage in the form of 6 Tiles are cracked in Hallway and Main Office. Also, 2 Tiles are Water Damaged in Office, adjacent to Lounge Room. Material remains in FAIR condition. No other changes as of this date. | | | | | | | | | |
| 11/28/2011 | | | | Additional Damage observed - in the form of Hallway has some Tiles broken. No other changes as of this date. | | | | | | | | | |
| 10/08/2012 | | | | Additional Damage - in the form of 1 hole observed on Hallway Ceiling. Also, 2 additional Water Damaged Tiles observed in Telephone Panel Closet. No other changes as of this date. | | | | | | | | | |
| 03/03/2014 | | | | This Material is unchanged as of this date. | | | | | | | | | |
| 08/28/2014 | | | | Material Re-Assessed. Additional Water Damage Observed. No other changes as of this date. | | | | | | | | | |
| 03/18/2015 | | | | This Material is unchanged as of this date. | | | | | | | | | |
| 09/16/2015 | | | | This Material is unchanged as of this date. | | | | | | | | | |
| 03/17/2016 | | | | Additional Damage observed and Partial Repairs made. Director's Office has 1 Tile with Water Damage. Missing Tile above Main Entry Door has been Replaced. No other changes as of this date. | | | | | | | | | |
| 09/09/2016 | | | | Additional Damage observed. 2 Tiles with Water Damage in Trainer's Office. No other changes as of this date. | | | | | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

| | | | | | | | |
|---------------|--|---|--|-----------|--|---------|--|
| CARPET MASTIC | | 3,300 SF | | 05-212AAA | | ASSUMED | |
| 05/11/2009 | | * Damage observed as of. | | | | | |
| 03/27/2017 | | Additional Damage Observed. Storage Room by Rear of Building there is Water Damage in the form of Stains and Mold, still damp. 20 LF of Blue Carpet in the Staff Lounge is loose. No other changes as of this date. | | | | | |
| 04/18/2006 | | MASTIC/Adhesive FOR CARPETS (Approximately 80% Blue and 20% Mix of Red, Brown and Grey Colors). This Material is in FAIR condition as of this date. | | | | | |
| 05/11/2009 | | Damage: <5% Physical Damage in the form of the Carpet has been Damaged due to several separations observed in locations of seams. No other changes as of this date. | | | | | |
| 03/03/2014 | | This Material is unchanged as of this date. | | | | | |
| 08/28/2014 | | This Material is unchanged as of this date. | | | | | |
| 03/18/2015 | | This Material is unchanged as of this date. | | | | | |
| 09/16/2015 | | This Material is unchanged as of this date. | | | | | |
| 03/17/2016 | | This Material is unchanged as of this date. | | | | | |
| 09/09/2016 | | This Material is unchanged as of this date. | | | | | |

SF= Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

7,800 SF

08-214AAA

ASSUMED

| | |
|------------|---|
| 03/27/2017 | Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date. |
| 10/13/2008 | Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date. |
| 09/03/2009 | Material remains in <5% Physical Damage. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

7,800 SF

08-241AAA

ASSUMED

| | |
|------------|---|
| 03/27/2017 | Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date. |
| 10/13/2008 | Mastic/Adhesive for Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date. |
| 09/03/2009 | Material remains in <5% Physical Damage. This Material is unchanged as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

7,800 SF

05-212AAA

ASSUMED

| | |
|------------|--|
| 03/27/2017 | Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date. |
|------------|--|

SF= Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|--|--|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| 09/06/2005 | | Pressed wood wall panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date. | | | | | | |
| 10/13/2008 | | Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date. | | | | | | |
| 09/03/2009 | | Material remains in <5% Physical Damage. No changes as of this date. | | | | | | |
| 03/03/2014 | | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | | This Material is unchanged as of this date. | | | | | | |
| 09/16/2015 | | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | | This Material is unchanged as of this date. | | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL MASTIC 7,800 SF

| | | | |
|------------|--|--|--|
| 03/27/2017 | | Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date. | |
| 09/06/2005 | | Mastic/Adhesive for Pressed Wood Wall Panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date. | |
| 10/13/2008 | | Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date. | |
| 09/03/2009 | | Material remains in <5% Physical Damage. No changes as of this date. | |
| 03/03/2014 | | This Material is unchanged as of this date. | |
| 08/28/2014 | | This Material is unchanged as of this date. | |
| 03/18/2015 | | This Material is unchanged as of this date. | |
| 09/16/2015 | | This Material is unchanged as of this date. | |
| 03/17/2016 | | This Material is unchanged as of this date. | |
| 09/09/2016 | | This Material is unchanged as of this date. | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

PLENUM

WALL INSULATION 2,500 SF

05-212AAA ASSUMED

| | | | |
|------------|--|---|--|
| 09/06/2005 | | spray-on foam insulation. Material is loose and Water Damaged in several locations. This Material is in FAIR condition as of this date. | |
|------------|--|---|--|

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY | SAMPLE No. | ASBESTOS |
|---------------|--|----------|--|---------------|--|---------------|------------|----------|
| COMMENTS | | | | | | (APPROXIMATE) | | CONTENT |
| | | | | | | | | (TYPE) |
| 09/03/2009 | Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

STAFF RESTROOMS (2)

| | | | | |
|----------------|--|--------|-----------|---------|
| VINYL SHEETING | | 400 SF | 05-212AAA | ASSUMED |
| 03/05/2007 | * Location Name changed on. | | | |
| 04/18/2006 | Grey Vinyl Sheeting. (Apparent New Material identified by the AHERA Accredited Inspector). This material is in GOOD condition as of this date. | | | |
| 03/05/2007 | Location Name changed from TWO STAFF RESTROOMS to STAFF RESTROOMS (2). No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

STAFF RESTROOMS (2)

| | | | | | | |
|-------------------------------------|--|--------|-----------|--|---------|--|
| VINYL SHEETING BACKING PAPER/MASTIC | | 400 SF | 05-212AAA | | ASSUMED | |
| 03/05/2007 | * Location Name changed on. | | | | | |
| 04/18/2006 | Backing Paper for Grey Vinyl Sheeting. (Apparent New Material identified by the AHERA Accredited Inspector). This material is in GOOD condition as of this date. | | | | | |
| 03/05/2007 | Location Name changed from TWO STAFF RESTROOMS to STAFF RESTROOMS (2). No other changes as of this date. | | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) | | | |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|--|--|--|
| COMMENTS | | | | | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

| VINYL FLOOR TILE | | 700 SF | 05-212AAA | ASSUMED |
|------------------|--|--------|-----------|---------|
| 09/23/2013 | * Condition changed on. | | | |
| 09/06/2005 | 9"X9" VINYL FLOOR TILE, under carpeting in programming room. Approximatly 10 SF missing in Womens Restroom, also Damaged in 2 Restrooms. This Material is in FAIR condition as of this date. | | | |
| 04/18/2006 | Approximately 400 SF of Material Removed in two Restrooms. Quantity changed from 1,100 SF to 700 SF. Material replaced with New Grey Vinyl Sheeting. No other changes as of this date. | | | |
| 05/11/2009 | Material Re-Assessed. Material is not visible in remaining locations due to being covered with existing Carpet. New Grey Vinyl Sheeting is in Restrooms. Material condition is TBD. | | | |
| 09/23/2013 | Material Re-Assessed. This Material changed from FAIR to GOOD condition. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

| | | | | |
|-------------------------|-------------------------|--------|-----------|---------|
| VINYL FLOOR TILE MASTIC | | 700 SF | 05-212AAA | ASSUMED |
| 09/23/2013 | * Condition changed on. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |
| 09/06/2005 | | mastic/Adhesive for 9"X9" VINYL FLOOR TILE, under carpeting in programming room. Approximately 10 SF missing in Womens Restroom, also Damaged in 2 Restrooms. This Material is in FAIR condition as of this date. | | | |
| 04/18/2006 | | Approximately 400 SF of Material removed in 2 Restrooms. Quantity changed from 1,100 SF to 700 SF. Material replaced with New Backing Paper for Grey Vinyl Sheeting. No other changes as of this date. | | | |
| 05/11/2009 | | Material Re-Assessed. Material is not visible in remaining locations due to being covered with existing Carpet. New Grey Vinyl Sheeting is in Restrooms. Material condition is TBD. | | | |
| 09/23/2013 | | Material Re-Assessed. This Material changed from FAIR to GOOD condition. No other changes as of this date. | | | |
| 03/03/2014 | | This Material is unchanged as of this date. | | | |
| 08/28/2014 | | This Material is unchanged as of this date. | | | |
| 03/18/2015 | | This Material is unchanged as of this date. | | | |
| 09/16/2015 | | This Material is unchanged as of this date. | | | |
| 03/17/2016 | | This Material is unchanged as of this date. | | | |
| 09/09/2016 | | This Material is unchanged as of this date. | | | |
| 03/27/2017 | | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

WAREHOUSE BUILDING

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

470 LF

05-212AAA

ASSUMED

| | |
|------------|--|
| 04/18/2006 | * Various changes on. |
| 09/06/2005 | MASTIC/Adhesive FOR 4" Black and brown BASEBOARDS. Material is exposed in Carpenters Shop and Restroom. This Material is in FAIR condition as of this date. |
| 04/18/2006 | Approximately 120 LF is exposed in Shop and Main Office. Friability changed from Moderate to High. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date. |
| 05/11/2009 | Damages Re-Assessed. Physical Damages remains at <50%. This Material is unchanged as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

2,310 SF

05-212AAA

ASSUMED

| | |
|------------|---|
| 05/11/2009 | * Additional damages observed as of. |
| 04/13/2012 | * Location Description changed. |
| 10/08/2012 | * Additional Damage observed. |
| 08/28/2014 | * Various changes. |
| 09/06/2005 | 12"X12" MULTI-COLOR VINYL FLOOR TILE. Broken and missing in various locations. This Material is in FAIR condition as of this date. |
| 04/14/2008 | 50 SF Removed in the Restroom. Quantity changed from 2,360 SF to 2,310 SF. This Material condition is unchanged as of this date. |
| 05/11/2009 | Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Friability changed from Low to Moderate. Recommendation changed to reflect this change. |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| 04/13/2012 | Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date. | | | | | | | |
| 10/08/2012 | Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

| | | | | |
|-------------------------|--|----------|-----------|---------|
| VINYL FLOOR TILE MASTIC | | 2,360 SF | 05-212AAA | ASSUMED |
| 04/13/2012 | * Location Description changed. | | | |
| 10/08/2012 | * Additional Damage observed. | | | |
| 08/28/2014 | * Various changes. | | | |
| 09/06/2005 | MASTIC/Adhesive for 12"X12" MULTI-COLOR VINYL FLOOR TILE. Material is exposed in broken and missing Tile locations. This Material is in FAIR condition as of this date. | | | |
| 04/14/2008 | 50 SF is exposed in the Restroom. This Material condition is unchanged as of this date. | | | |
| 05/11/2009 | Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is Damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Friability changed from Low to Moderate. Recommendation changed to reflect this change. 50 SF that was exposed in Restroom has been repaired. Material has been replaced with Off-White 12"x12". | | | |
| 04/13/2012 | Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date. | | | |
| 10/08/2012 | Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |

SF=Sq. Ft, l=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

| | |
|------------|---|
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM

| | | | |
|----------------|---|-----------|---------|
| CEILING MASTIC | 1,000 SF | 07-041AAA | ASSUMED |
| 10/08/2012 | * Additional Damage observed. | | |
| 08/28/2014 | * Various changes. | | |
| 03/27/2017 | Additional Damage Observed. Storage Room has 100 SF of Water Damage and 6 Tiles are Missing. 40 Sf of Water Damage and 25 loose Tiles in the Shop. No other changes as of this date. | | |
| 03/05/2007 | Mastic/Adhesive for 1'x1' Ceiling Tile. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. No other changes as of this date. | | |
| 05/11/2009 | Material condition is FAIR overall. This Material is unchanged as of this date. | | |
| 09/03/2009 | Material Re-Assessed. Physical Damage is <50% and remains in FAIR condition overall as of this date. | | |
| 10/08/2012 | Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date. | | |
| 03/03/2014 | This Material is unchanged as of this date. | | |
| 08/28/2014 | Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. Friability changed from Low to Moderate. No other changes as of this date. | | |
| 03/18/2015 | This Material is unchanged as of this date. | | |
| 09/16/2015 | This Material is unchanged as of this date. | | |
| 03/17/2016 | This Material is unchanged as of this date. | | |
| 09/09/2016 | This Material is unchanged as of this date. | | |

WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM

| | | | |
|--------------|-------------------------------|-----------|---------|
| CEILING TILE | 1,000 SF | 05-212AAA | ASSUMED |
| 04/18/2006 | * Condition changed on. | | |
| 03/05/2007 | * Various changes on. | | |
| 10/08/2012 | * Additional Damage observed. | | |
| 08/28/2014 | * Material Re-Assessed. | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|---------------|---|---------------|------------|----------------|
| LOCATION | | | | |
| MATERIAL TYPE | | QTY | ASBESTOS | |
| COMMENTS | | (APPROXIMATE) | SAMPLE NO. | CONTENT (TYPE) |
| 09/06/2005 | 1'X1' NAILED-ON CEILING TILE. Material is damaged in the form of holes and cuts. This Material is in FAIR condition as of this date. | | | |
| 04/18/2006 | >10% of Material is Water Damaged. Friability changed from Moderate to High. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date. | | | |
| 03/05/2007 | Material Description changed from ' 1'x1' Nailed-on Ceiling Tile. ' to '1'x1' Ceiling Tile, (Glued-on). Mastic/Adhesive entry added for this Material. Damage reassessed. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. Friability changed to High. No other changes as of this date. | | | |
| 09/03/2009 | Damage Re-Assessed. Physical Damage has changed to <50% due to scratches and gouging observed. Water Damage remains <10% and in POOR condition as of this date. | | | |
| 10/08/2012 | Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. Friability changed from Low to Moderate. No other changes as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

WAREHOUSE BUILDING

ENTIRE BUILDING

| FIRE DOOR CORE INSULATION | | 294 SF | 05-212AAA | ASSUMED |
|---------------------------|---|--------|-----------|---------|
| 09/16/2015 | * Location and Quantity Re-Assessed. | | | |
| 09/06/2005 | FIRE DOOR CORE INSULATION. (14 EA DOOR). This Material is in GOOD condition as of this date. (Original entry updated 09/16/15) | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | Location and Quantity Re-Assessed. Location Description changed from 'SPRINKLER AND GROUND SHOP' to 'ENTIRE BUILDING'. There are 14 Fire Doors. Original entry updated, Material description changed from 'FIRE DOOR CORE INSULATION. (1 EA DOOR)' to ' FIRE DOOR CORE INSULATION. (14 EA DOOR)'. Quantity changed from 21 SF to 294 SF. No other change as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

03/27/2017 This Material is unchanged as of this date.

WAREHOUSE BUILDING

EXTERIOR WALL OF WAREHOUSE OFFICE

CHALK BOARD

20 SF

09-098AAA

ASSUMED

05/11/2009 Green Cementitious Chalkboard. (1 EA). This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

WAREHOUSE BUILDING

EXTERIOR WALL OF WAREHOUSE OFFICE

WALL MASTIC

20 SF

09-098AAA

ASSUMED

05/11/2009 Mastic/Adhesive for Green Cementitious Chalkboard. (1 EA). This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

WAREHOUSE BUILDING

WAREHOUSE OFFICE

CARPET MASTIC

72 SF

05-212AAA

ASSUMED

09/06/2005 MASTIC/Adhesive for grey CARPET. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

| | |
|------------|---|
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

| | | | | |
|------------|--|----------|-----------|---------|
| | SMOOTH WALL MISCELLANEOUS | 6,620 SF | 05-212AAA | ASSUMED |
| 03/05/2007 | * Various changes on. | | | |
| 09/23/2013 | * Friability changed on. | | | |
| 09/06/2005 | GYPSUM WALLBOARD SYSTEM WALLS and CEILINGS. This Material is in GOOD condition as of this date. | | | |
| 03/05/2007 | Damage Re-Assessed. Damage: <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date. | | | |
| 04/14/2008 | Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF Damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date. | | | |
| 09/03/2009 | Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date. | | | |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date. | | | |

WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

| | | | | |
|------------|--------------------------|----------|-----------|---------|
| | SMOOTH WALL SURFACING | 6,620 SF | 05-212AAA | ASSUMED |
| 03/05/2007 | * Various changes on. | | | |
| 09/23/2013 | * Friability changed on. | | | |
| 03/03/2014 | * Friability changed on. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|---------------|--|------------|-------------------------------|--|
| LOCATION | | | | |
| MATERIAL TYPE | | | | |
| COMMENTS | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) | |
| 04/18/2006 | skim coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. This Material is in GOOD condition as of this date. | | | |
| 03/05/2007 | Damage Re-Assessed. Damage: <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date. | | | |
| 04/14/2008 | Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date. | | | |
| 09/03/2009 | Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date. | | | |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. | | | |
| 03/03/2014 | Friability changed from Low to Moderate. No other changes as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date. | | | |

WAREHOUSE BUILDING

WOOD SHOP

SINK UNDERCOATING

0 SF

15-042REM

REMOVED

| | | | | |
|------------|--|--|--|--|
| 05/11/2009 | Thermal Undercoating on Sink. (1 EA Sink). This Material is in GOOD condition as of this date. | | | |
| 08/30/2010 | Undercoating is Grey. This Material is unchanged as of this date. | | | |
| 11/28/2011 | This Material is unchanged as of this date. Sink is Metal. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 03/18/2015 | This is Metal with no undercoating and this entry is Removed of this date. Quantity changed from 6 SF to 0 SF. | | | |

WAREHOUSE BUILDING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE

50 SF

09-098AAA

ASSUMED

| | | | | |
|------------|---|--|--|--|
| 05/11/2009 | 12"x12" Off-White Vinyl Floor Tile. Old Mastic/Adhesive may exist under new Vinyl Floor Tile and Mastic/Adhesive. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date. | | | |
|------------|---|--|--|--|

SF=Sq. Ft, I=Inches, LF=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | | MATERIAL TYPE | | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|---------------|---|----------|--|---------------|--|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

WAREHOUSE BUILDING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE MASTIC

50 SF

09-098AAA

ASSUMED

| | | | | | | | | |
|------------|---|--|--|--|--|--|--|--|
| 05/11/2009 | Mastic/Adhesive for 12"x12" Off-White Vinyl Floor Tile. Old Mastic/Adhesive may exist under new Vinyl Floor Tile and Mastic/Adhesive. (Apparent New Material identified by the AHERA accredited Inspector). This Material is in GOOD condition as of this date. | | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

WELDING SHOP BUILDING

WELDING SHOP BUILDING

| | |
|------------|---|
| 03/06/2017 | BUILDING NOTES: |
| 03/05/2007 | Building Name changed from SIGNS / TOOLS / PARTS SHOP to SIGNS / TOOLS / PARTS SHOP BUILDING. |
| 03/17/2016 | Building Name changed from SIGNS/TOOLS/PARTS SHOP BUILDING to WELDING SHOP BUILDING. |

WELDING SHOP BUILDING

EXTERIOR

| FIRE DOOR CORE INSULATION | | 21 SF | 15-174AAA | ASSUMED |
|---------------------------|--|-------|-----------|---------|
| 09/16/2015 | Fire Door Core Insulation. (1 EA Doors). This Material is in GOOD condition as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

| SMOOTH WALL MISCELLANEOUS | | 650 SF | 05-212AAA | ASSUMED |
|---------------------------|--|--------|-----------|---------|
| 05/11/2009 | * Additional Damages observed on. | | | |
| 09/06/2005 | GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. This Material is in GOOD condition as of this date. | | | |
| 04/18/2006 | Material Re-Assessed. Damage: <10% Physical Damage - noted in forms of holes and cuts. Friability changed from Low to Moderate. This Material is in FAIR condition overall as of this date. | | | |
| 05/11/2009 | Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Recommendation changed to reflect this change. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|----------------------------|---|------------|-----------|----------|
| LOCATION | | | | |
| MATERIAL TYPE | | | QTY | ASBESTOS |
| COMMENTS | (APPROXIMATE) | SAMPLE No. | CONTENT | |
| (TYPE) | | | | |
| WELDING SHOP BUILDING | | | | |
| SIGNS / TOOLS / PARTS SHOP | | | | |
| SMOOTH WALL SURFACING | | 650 SF | 05-212AAA | ASSUMED |
| 05/11/2009 | * Additional Damages observed on. | | | |
| 09/23/2013 | * Condition changed on. | | | |
| 04/18/2006 | Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. <10% Physical Damages noted in forms of holes and cuts. This Material is in FAIR condition as of this date. | | | |
| 05/11/2009 | Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Friability changed from Non to Moderate. Recommendation changed to reflect this change. | | | |
| 09/23/2013 | This Material changed from POOR condition to FAIR condition as of this date. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is in POOR condition as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE NO. | ASBESTOS CONTENT (TYPE) |
|---------------|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | |

WOOD SHEDS (2 EA)

WOOD SHEDS (2 EA)

03/07/2017 BUILDING NOTES:

03/08/2010 Wood Storage Sheds are located on back side of Daycare Building.

03/17/2016 Building Name changed from WOOD SHEDS (3) to WOOD SHEDS (2 EA) (by Daycare).

WOOD SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

200 SF

10-052AAA

NON-ACM

03/08/2010 Wood Wall Panels. Non-ACM Material identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

SURVEY REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | SAMPLE No. | ASBESTOS CONTENT (TYPE) |
|-------------------|--|----------|---------------|----------------------|------------|-------------------------------|
| COMMENTS | | | | | | |
| WOOD STORAGE SHED | | | | | | |
| WOOD STORAGE SHED | | | | | | |
| WOOD STORAGE SHED | | | | | | |
| WOOD WALL | | | | 330 SF | 11-202.NS | NON-ACM |
| 11/28/2011 | Wood Walls. Non-ACM Material identified by the AHERA Accredited inspector. This Material is in GOOD condition as of this date. | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | |

End Of Report, Total Of 58 Pages

HOMOGENEOUS MATERIALS IN

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

GROUPS STORAGE BUILDING

MISCELLANEOUS MATERIAL

EXTERIOR
STORAGE

FIRE DOOR CORE INSULATION
MISCELLANEOUS

MAINTENANCE GARAGE BUILDING

MISCELLANEOUS MATERIAL

OFFICE
OFFICE
OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SINK UNDERCOATING
SUSPENDED CEILING TILE

REPAIR / SERVICES GARAGE
REPAIR / SERVICES GARAGE
RESTROOMS (2), AND SHOWER ROOM

SMOOTH WALL
MISCELLANEOUS
CHALK BOARD
WALL MASTIC
HEAT SHIELD

SURFACING MATERIAL

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

MISCELLANEOUS MATERIAL

DOORS - EXTERIOR
DOORS - INTERIOR
EXTERIOR WALLS

FIRE DOOR CORE INSULATION
FIRE DOOR CORE INSULATION
WEATHER PROOFING
(OUTSIDE)

HVAC OFFICE AND HALLWAY
HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC
SMOOTH WALL
MISCELLANEOUS

OFFICE PORTABLE
OFFICE PORTABLE
OFFICE PORTABLE

BASEBOARD MASTIC
PRESSED WOOD WALL PANEL
PRESSED WOOD WALL PANEL
MASTIC

OFFICE PORTABLE
OFFICE PORTABLE
OFFICE PORTABLE
OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

SUSPENDED CEILING TILE
VINYL WALL COVER
VINYL WALL COVER MASTIC
CARPET MASTIC

SURFACING MATERIAL

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING

MENTOR'S HOUSE

MISCELLANEOUS MATERIAL

ALL ROOMS
ATTIC
DAYCARE KITCHEN

BASEBOARD MASTIC
LOOSE FILL INSULATION
VINYL SHEETING

HOMOGENEOUS MATERIALS IN

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

DAYCARE KITCHEN

VINYL SHEETING

DAYCARE KITCHEN

VINYL SHEETING BACKING
PAPER/MASTIC

DAYCARE KITCHEN

VINYL SHEETING BACKING
PAPER/MASTIC

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

ENTIRE BUILDING

SMOOTH WALL
MISCELLANEOUS

EXTERIOR WINDOWS

CAULKING

KITCHEN (COUNTER TOP) AND RESTROOM

MORTAR MISCELLANEOUS

OFFICE AND DAYCARE ROOMS

CARPET MASTIC

RESTROOM

BASEBOARD MASTIC

RESTROOM

VINYL FLOOR TILE

RESTROOM

VINYL FLOOR TILE MASTIC

SURFACING MATERIAL

ENTIRE BUILDING

SMOOTH WALL SURFACING

EXTERIOR WALLS

ROUGH WALL

EXTERIOR WALLS

ROUGH WALL SURFACING

METAL STORAGE CONTAINERS (8 EA)

MISCELLANEOUS MATERIAL

METAL STORAGE CONTAINERS (8 EA)

STORAGE CONTAINER

METAL STORAGE SHED

MISCELLANEOUS MATERIAL

METAL STORAGE SHED

STORAGE BUILDING

PG&E NORTH TOWER BUILDING

MISCELLANEOUS MATERIAL

PG&E

MISCELLANEOUS

PG&E SOUTH TOWER ENCLOSURE

MISCELLANEOUS MATERIAL

TOWER

WOOD WALL

PORTABLE

MISCELLANEOUS MATERIAL

EXTERIOR DOOR

FIRE DOOR CORE INSULATION

INTERIOR DOOR

FIRE DOOR CORE INSULATION

PORTABLES

BASEBOARD MASTIC

PORTABLES

SUSPENDED CEILING TILE

HOMOGENEOUS MATERIALS IN

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

PORTABLES

VINYL FLOOR TILE

PORTABLES

VINYL FLOOR TILE MASTIC

STORAGE PORTABLE BUILDING (REMOVED)

MISCELLANEOUS MATERIAL

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING BACKING
PAPER/MASTIC

STORAGE PORTABLE

BASEBOARD MASTIC

STORAGE PORTABLE

CARPET MASTIC

STORAGE PORTABLE

PRESSED WOOD WALL PANEL

STORAGE PORTABLE

PRESSED WOOD WALL PANEL
MASTIC

STORAGE PORTABLE

SUSPENDED CEILING TILE

STORAGE PORTABLE

VINYL WALL COVER

STORAGE PORTABLE

VINYL WALL COVER MASTIC

STORAGE PORTABLE

WALL MASTIC

STORAGE PORTABLE

WOOD WALL PANEL

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MISCELLANEOUS MATERIAL

ASSISTANT DIRECTOR

VINYL FLOOR TILE

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

EXTERIOR BUILDING

WEATHER PROOFING
(OUTSIDE)

LOUNGE ROOM

SINK UNDERCOATING

MAIN OFFICE

BASEBOARD MASTIC

MAIN OFFICE

SMOOTH WALL

MAIN OFFICE

MISCELLANEOUS

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

SUSPENDED CEILING TILE

CARPET MASTIC

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL
MASTIC

PLENUM

WALL INSULATION

STAFF RESTROOMS (2)

VINYL SHEETING

STAFF RESTROOMS (2)

VINYL SHEETING BACKING
PAPER/MASTIC

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

HOMOGENEOUS MATERIALS IN

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

MATERIAL CATEGORY

LOCATION

MATERIAL TYPE

SURFACING MATERIAL

MAIN OFFICE

SMOOTH WALL SURFACING

WAREHOUSE BUILDING

MISCELLANEOUS MATERIAL

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE MASTIC

CARPENTERS SHOP, AND RESTROOM

CEILING MASTIC

CARPENTERS SHOP, AND RESTROOM

CEILING TILE

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

EXTERIOR WALL OF WAREHOUSE OFFICE

CHALK BOARD

EXTERIOR WALL OF WAREHOUSE OFFICE

WALL MASTIC

WAREHOUSE OFFICE

CARPET MASTIC

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL

MISCELLANEOUS

WOOD SHOP

SINK UNDERCOATING

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE MASTIC

SURFACING MATERIAL

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

WELDING SHOP BUILDING

MISCELLANEOUS MATERIAL

EXTERIOR

FIRE DOOR CORE INSULATION

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL

MISCELLANEOUS

SURFACING MATERIAL

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

WOOD SHEDS (2 EA)

MISCELLANEOUS MATERIAL

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

WOOD STORAGE SHED

MISCELLANEOUS MATERIAL

WOOD STORAGE SHED

WOOD WALL

End Of Report, Total Of 4 Pages

FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | FRIABILITY | ASBESTOS CONTENT |
|---|---|--------------------------------|----------------------|------------|---------------------|
| GROUPS STORAGE BUILDING | | | | | |
| | EXTERIOR | | | | |
| | | FIRE DOOR CORE INSULATION | 21 SF | HIGH | Assumed |
| MAINTENANCE GARAGE BUILDING | | | | | |
| | OFFICE | | | | |
| | | SUSPENDED CEILING TILE | 260 SF | HIGH | Assumed |
| | OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM | | | | |
| | | SMOOTH WALL MISCELLANEOUS | 2,650 SF | LOW | Assumed |
| | OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM | | | | |
| | | SMOOTH WALL SURFACING | 2,650 SF | LOW | Assumed |
| | RESTROOMS (2), AND SHOWER ROOM | | | | |
| | | HEAT SHIELD | 7.5 SF | HIGH | Assumed |
| MAINTENANCE SHOPS OFFICE PORTABLE BUILDING | | | | | |
| | DOORS - EXTERIOR | | | | |
| | | FIRE DOOR CORE INSULATION | 42 SF | HIGH | Assumed |
| | DOORS - INTERIOR | | | | |
| | | FIRE DOOR CORE INSULATION | 168 SF | HIGH | Assumed |
| | HVAC OFFICE AND HALLWAY | | | | |
| | | SMOOTH WALL MISCELLANEOUS | 1,000 SF | LOW | Assumed |
| | HVAC OFFICE AND HALLWAY | | | | |
| | | SMOOTH WALL SURFACING | 1,000 SF | LOW | Assumed |
| | OFFICE PORTABLE | | | | |
| | | BASEBOARD MASTIC | 265 LF | LOW | Assumed |
| | OFFICE PORTABLE | | | | |
| | | PRESSED WOOD WALL PANEL | 2,660 SF | MODERATE | Assumed |
| | OFFICE PORTABLE | | | | |
| | | PRESSED WOOD WALL PANEL MASTIC | 2,660 SF | LOW | Assumed |
| | OFFICE PORTABLE | | | | |
| | | SUSPENDED CEILING TILE | 1,600 SF | HIGH | Assumed |
| | OFFICE PORTABLE | | | | |
| | | VINYL WALL COVER | 2,660 SF | LOW | Assumed |
| | OFFICE PORTABLE | | | | |
| | | VINYL WALL COVER MASTIC | 2,660 SF | LOW | Assumed |
| | OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE | | | | |
| | | CARPET MASTIC | 1,600 SF | LOW | Assumed |

FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | FRIABILITY | ASBESTOS CONTENT |
|--|--|-------------------------------------|----------------------|------------|---------------------|
| MENTOR'S HOUSE | | | | | |
| | ATTIC | | | | |
| | | LOOSE FILL INSULATION | 800 SF | HIGH | Assumed |
| | DAYCARE KITCHEN | | | | |
| | | VINYL SHEETING BACKING PAPER/MASTIC | 250 SF | MODERATE | Assumed |
| | DAYCARE KITCHEN | | | | |
| | | VINYL SHEETING BACKING PAPER/MASTIC | 250 SF | HIGH | Assumed |
| | DAYCARE ROOM AND ENTRY TO KITCHEN | | | | |
| | | CEILING TILE | 500 SF | MODERATE | Assumed |
| | ENTIRE BUILDING | | | | |
| | | SMOOTH WALL MISCELLANEOUS | 6,400 SF | MODERATE | Assumed |
| | ENTIRE BUILDING | | | | |
| | | SMOOTH WALL SURFACING | 6,400 SF | MODERATE | Assumed |
| | EXTERIOR WINDOWS | | | | |
| | | CAULKING | 400 LF | LOW | Assumed |
| PORTABLE | | | | | |
| | EXTERIOR DOOR | | | | |
| | | FIRE DOOR CORE INSULATION | 42 SF | HIGH | Assumed |
| | INTERIOR DOOR | | | | |
| | | FIRE DOOR CORE INSULATION | 21 SF | HIGH | Assumed |
| | PORTABLES | | | | |
| | | SUSPENDED CEILING TILE | 450 SF | LOW | Assumed |
| | PORTABLES | | | | |
| | | VINYL FLOOR TILE | 480 SF | LOW | Assumed |
| | PORTABLES | | | | |
| | | VINYL FLOOR TILE MASTIC | 480 SF | LOW | Assumed |
| TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING | | | | | |
| | ASSISTANT DIRECTOR | | | | |
| | | VINYL FLOOR TILE | 38 SF | LOW | Assumed |
| | ASSISTANT DIRECTOR | | | | |
| | | VINYL FLOOR TILE MASTIC | 38 SF | LOW | Assumed |
| | CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM | | | | |
| | | SUSPENDED CEILING TILE | 1,500 SF | HIGH | Assumed |
| | ENTIRE BUILDING | | | | |
| | | FIRE DOOR CORE INSULATION | 252 SF | HIGH | Assumed |

FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|--|-------------------------------------|----------------------|------------|---------------------|
| LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | FRIABILITY | ASBESTOS CONTENT |
| MAIN OFFICE | BASEBOARD MASTIC | 1,400 LF | LOW | Assumed |
| MAIN OFFICE | SMOOTH WALL MISCELLANEOUS | 5,100 SF | MODERATE | Assumed |
| MAIN OFFICE | SMOOTH WALL SURFACING | 5,100 SF | MODERATE | Assumed |
| MAIN OFFICE | SUSPENDED CEILING TILE | 2,150 SF | HIGH | Assumed |
| MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM | CARPET MASTIC | 3,300 SF | LOW | Assumed |
| MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM | VINYL WALL COVER | 7,800 SF | LOW | Assumed |
| MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM | VINYL WALL COVER MASTIC | 7,800 SF | LOW | Assumed |
| MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM | PRESSED WOOD WALL PANEL | 7,800 SF | MODERATE | Assumed |
| MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM | PRESSED WOOD WALL PANEL MASTIC | 7,800 SF | LOW | Assumed |
| PLENUM | WALL INSULATION | 2,500 SF | MODERATE | Assumed |
| STAFF RESTROOMS (2) | VINYL SHEETING BACKING PAPER/MASTIC | 400 SF | HIGH | Assumed |
| WAREHOUSE BUILDING | | | | |
| ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM | BASEBOARD MASTIC | 470 LF | MODERATE | Assumed |
| ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM | VINYL FLOOR TILE | 2,310 SF | MODERATE | Assumed |
| ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM | VINYL FLOOR TILE MASTIC | 2,360 SF | LOW | Assumed |
| CARPENTERS SHOP, AND RESTROOM | CEILING MASTIC | 1,000 SF | MODERATE | Assumed |
| CARPENTERS SHOP, AND RESTROOM | CEILING TILE | 1,000 SF | HIGH | Assumed |
| ENTIRE BUILDING | FIRE DOOR CORE INSULATION | 294 SF | HIGH | Assumed |

S= Sq. Ft, l=Inches, L=Linear Ft., N=Number, EA=Each

HazMat Doc. All Rights Reserved.

FRIABLE LOCATIONS IN BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | QTY (APPROXIMATE) | FRIABILITY | ASBESTOS CONTENT |
|--|---------------------------|----------------------|------------|---------------------|
| LOCATION | MATERIAL TYPE | | | |
| | | | | |
| WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS | | | | |
| | SMOOTH WALL MISCELLANEOUS | 6,620 SF | LOW | Assumed |
| WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS | | | | |
| | SMOOTH WALL SURFACING | 6,620 SF | MODERATE | Assumed |
| WELDING SHOP BUILDING | | | | |
| EXTERIOR | | | | |
| | FIRE DOOR CORE INSULATION | 21 SF | HIGH | Assumed |
| SIGNS / TOOLS / PARTS SHOP | | | | |
| | SMOOTH WALL MISCELLANEOUS | 650 SF | MODERATE | Assumed |
| SIGNS / TOOLS / PARTS SHOP | | | | |
| | SMOOTH WALL SURFACING | 650 SF | MODERATE | Assumed |
| End Of Report. Total Of 4 Pages | | | | |

Non- Friable Locations In BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | QTY (APPROXIMATE) | FRIABILITY | ASBESTOS CONTENT |
|---|---|---------------|----------------------|------------|---------------------|
| GROUPS STORAGE BUILDING | | | | | |
| | STORAGE | | | | |
| | MISCELLANEOUS | | 240 SF | NON | Assumed |
| MAINTENANCE GARAGE BUILDING | | | | | |
| | OFFICE | | | | |
| | SINK UNDERCOATING | | 5 SF | NON | Assumed |
| | REPAIR / SERVICES GARAGE | | | | |
| | CHALK BOARD | | 8 SF | NON | Assumed |
| | REPAIR / SERVICES GARAGE | | | | |
| | WALL MASTIC | | 8 SF | NON | Assumed |
| MAINTENANCE SHOPS OFFICE PORTABLE BUILDING | | | | | |
| | EXTERIOR WALLS | | | | |
| | WEATHER PROOFING (OUTSIDE) | | 2,800 SF | NON | Assumed |
| | HVAC OFFICE AND HALLWAY | | | | |
| | BASEBOARD MASTIC | | 20 LF | NON | Assumed |
| MENTOR'S HOUSE | | | | | |
| | ALL ROOMS | | | | |
| | BASEBOARD MASTIC | | 640 LF | NON | Assumed |
| | DAYCARE KITCHEN | | | | |
| | VINYL SHEETING | | 250 SF | NON | Assumed |
| | DAYCARE KITCHEN | | | | |
| | VINYL SHEETING | | 250 SF | NON | Assumed |
| | DAYCARE ROOM AND ENTRY TO KITCHEN | | | | |
| | CEILING MASTIC | | 500 SF | NON | Assumed |
| | DAYCARE ROOM (IN SE CORNER OF BUILDING) | | | | |
| | CARPET MASTIC | | 240 SF | NON | Assumed |
| | EXTERIOR WALLS | | | | |
| | ROUGH WALL | | 1,400 SF | NON | Assumed |
| | EXTERIOR WALLS | | | | |
| | ROUGH WALL SURFACING | | 1,400 SF | NON | Assumed |
| | KITCHEN (COUNTER TOP) AND RESTROOM | | | | |
| | MORTAR MISCELLANEOUS | | 820 SF | NON | Assumed |
| | OFFICE AND DAYCARE ROOMS | | | | |
| | CARPET MASTIC | | 1,300 SF | NON | Assumed |
| | RESTROOM | | | | |
| | BASEBOARD MASTIC | | 20 LF | NON | Assumed |
| | RESTROOM | | | | |
| | VINYL FLOOR TILE | | 32 SF | NON | Assumed |
| | RESTROOM | | | | |
| | VINYL FLOOR TILE MASTIC | | 32 SF | NON | Assumed |

Non- Friable Locations In BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | QTY (APPROXIMATE) | FRIABILITY | ASBESTOS CONTENT |
|--|---------------|----------------------|------------|---------------------|
| LOCATION | MATERIAL TYPE | | | |
| | | | | |
| METAL STORAGE SHED | | | | |
| | | | NON | |
| PORTABLE | | | | |
| PORTABLES | | | | |
| BASEBOARD MASTIC | 130 LF | NON | Assumed | |
| TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING | | | | |
| EXTERIOR BUILDING | | | | |
| WEATHER PROOFING (OUTSIDE) | 1,100 SF | NON | Assumed | |
| LOUNGE ROOM | | | | |
| SINK UNDERCOATING | 4 SF | NON | Assumed | |
| STAFF RESTROOMS (2) | | | | |
| VINYL SHEETING | 400 SF | NON | Assumed | |
| SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM | | | | |
| VINYL FLOOR TILE | 700 SF | NON | Assumed | |
| SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM | | | | |
| VINYL FLOOR TILE MASTIC | 700 SF | NON | Assumed | |
| WAREHOUSE BUILDING | | | | |
| EXTERIOR WALL OF WAREHOUSE OFFICE | | | | |
| CHALK BOARD | 20 SF | NON | Assumed | |
| EXTERIOR WALL OF WAREHOUSE OFFICE | | | | |
| WALL MASTIC | 20 SF | NON | Assumed | |
| WAREHOUSE OFFICE | | | | |
| CARPET MASTIC | 72 SF | NON | Assumed | |
| WOOD SHOP (RESTROOM ONLY) | | | | |
| VINYL FLOOR TILE | 50 SF | NON | Assumed | |
| WOOD SHOP (RESTROOM ONLY) | | | | |
| VINYL FLOOR TILE MASTIC | 50 SF | NON | Assumed | |
| WELDING SHOP BUILDING | | | | |
| | | | NON | |

End Of Report, Total Of 2 Pages

RECOMMENDATIONS FOR
BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

GROUND'S STORAGE BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

21 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STORAGE

MISCELLANEOUS

240 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAINTENANCE GARAGE BUILDING

OFFICE

SINK UNDERCOATING

5 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

OFFICE

SUSPENDED CEILING TILE 260 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS 2,650 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING 2,650 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

REPAIR / SERVICES GARAGE

CHALK BOARD 8 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME**LOCATION****MATERIAL TYPE****RECOMMENDATION****QTY****(APPROXIMATE)**

REPAIR / SERVICES GARAGE**WALL MASTIC****8 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOMS (2), AND SHOWER ROOM**HEAT SHIELD****7.5 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

DOORS - EXTERIOR**FIRE DOOR CORE INSULATION****42 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DOORS - INTERIOR**FIRE DOOR CORE INSULATION****168 SF**

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS

WEATHER PROOFING (OUTSIDE) 2,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC 20 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HVAC OFFICE AND HALLWAY

SMOOTH WALL MISCELLANEOUS 1,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING 1,000 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

OFFICE PORTABLE

BASEBOARD MASTIC

265 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

2,660 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE PORTABLE

PRESSED WOOD WALL PANEL MASTIC

2,660 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE PORTABLE

SUSPENDED CEILING TILE

1,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | |
|----------------|---------------|
| LOCATION | |
| MATERIAL TYPE | QTY |
| RECOMMENDATION | (APPROXIMATE) |

OFFICE PORTABLE

VINYL WALL COVER 2,660 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE PORTABLE

VINYL WALL COVER MASTIC 2,660 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

CARPET MASTIC 1,600 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MENTOR'S HOUSE

ALL ROOMS

BASEBOARD MASTIC

640 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ATTIC

LOOSE FILL INSULATION

800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE KITCHEN

VINYL SHEETING

250 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE KITCHEN

VINYL SHEETING

250 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

250 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

250 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING TILE

500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

DAYCARE ROOM (IN SE CORNER OF BUILDING)

CARPET MASTIC

240 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS

6,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

SMOOTH WALL SURFACING

6,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALLS

ROUGH WALL

1,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR WALLS

ROUGH WALL SURFACING

1,400 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WINDOWS

CAULKING

400 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

KITCHEN (COUNTER TOP) AND RESTROOM

MORTAR MISCELLANEOUS

820 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

OFFICE AND DAYCARE ROOMS

CARPET MASTIC

1,300 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

RESTROOM

BASEBOARD MASTIC

20 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOM

VINYL FLOOR TILE

32 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RESTROOM

VINYL FLOOR TILE MASTIC

32 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.
-

RECOMMENDATIONS FOR
BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

METAL STORAGE CONTAINERS (8 EA)

METAL STORAGE CONTAINERS (8 EA)

STORAGE CONTAINER

2,560 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

METAL STORAGE SHED

METAL STORAGE SHED

STORAGE BUILDING

725 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

PG&E NORTH TOWER BUILDING

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

PG&E

MISCELLANEOUS

154 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PG&E SOUTH TOWER ENCLOSURE

TOWER

WOOD WALL

533 SF

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

PORTABLE

EXTERIOR DOOR

FIRE DOOR CORE INSULATION 42 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

INTERIOR DOOR

FIRE DOOR CORE INSULATION 21 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLES

BASEBOARD MASTIC 130 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLES

SUSPENDED CEILING TILE 450 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

PORTABLES

VINYL FLOOR TILE 480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PORTABLES

VINYL FLOOR TILE MASTIC 480 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

STORAGE PORTABLE BUILDING (REMOVED)

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING 0 SF

The material has been removed. No further recommendation is required

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING BACKING PAPER/MASTIC 0 SF

The material has been removed. No further recommendation is required

STORAGE PORTABLE

BASEBOARD MASTIC 0 LF

The material has been removed. No further recommendation is required

STORAGE PORTABLE

CARPET MASTIC 0 SF

The material has been removed. No further recommendation is required

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | |
|--|--|---------------|
| LOCATION | | |
| MATERIAL TYPE | | QTY |
| RECOMMENDATION | | (APPROXIMATE) |
| STORAGE PORTABLE | | |
| PRESSED WOOD WALL PANEL | | 0 SF |
| The material has been removed. No further recommendation is required | | |
| STORAGE PORTABLE | | |
| PRESSED WOOD WALL PANEL MASTIC | | 0 SF |
| The material has been removed. No further recommendation is required | | |
| STORAGE PORTABLE | | |
| SUSPENDED CEILING TILE | | 0 SF |
| The material has been removed. No further recommendation is required | | |
| STORAGE PORTABLE | | |
| VINYL WALL COVER | | 0 SF |
| The material has been removed. No further recommendation is required | | |
| STORAGE PORTABLE | | |
| VINYL WALL COVER MASTIC | | 0 SF |
| The material has been removed. No further recommendation is required | | |
| STORAGE PORTABLE | | |
| WALL MASTIC | | 0 SF |
| The material has been removed. No further recommendation is required | | |
| STORAGE PORTABLE | | |
| WOOD WALL PANEL | | 0 SF |
| The material has been removed. No further recommendation is required | | |

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE 38 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC 38 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE 1,500 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
 - (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

ENTIRE BUILDING

FIRE DOOR CORE INSULATION 252 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

EXTERIOR BUILDING

WEATHER PROOFING (OUTSIDE) 1,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

LOUNGE ROOM

SINK UNDERCOATING 4 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICE

BASEBOARD MASTIC 1,400 LF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICE

SMOOTH WALL MISCELLANEOUS 5,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MAIN OFFICE

SMOOTH WALL SURFACING

5,100 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICE

SUSPENDED CEILING TILE

2,150 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC

3,300 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

7,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

7,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

7,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL MASTIC

7,800 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

PLENUM

WALL INSULATION

2,500 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

STAFF RESTROOMS (2)

VINYL SHEETING

400 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

STAFF RESTROOMS (2)

VINYL SHEETING BACKING PAPER/MASTIC

400 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE

700 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

700 SF

- (a) No abatement is necessary.
- (b) Maintain the material in an intact and undamaged condition.
- (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
- (d) Include this material in the long term surveillance and re-inspection program
- (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

470 LF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

2,310 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE MASTIC

2,360 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CARPENTERS SHOP, AND RESTROOM

CEILING MASTIC

1,000 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

CARPENTERS SHOP, AND RESTROOM

CEILING TILE

1,000 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

294 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL OF WAREHOUSE OFFICE

CHALK BOARD

20 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

EXTERIOR WALL OF WAREHOUSE OFFICE

WALL MASTIC

20 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WAREHOUSE OFFICE

CARPET MASTIC

72 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL MISCELLANEOUS 6,620 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING 6,620 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

WOOD SHOP

SINK UNDERCOATING 0 SF

The material has been removed. No further recommendation is required

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE 50 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

WOOD SHOP (RESTROOM ONLY)

VINYL FLOOR TILE MASTIC 50 SF

- (a) This is a replacement/new material.
- (b) The District should obtain documentation from the manufacturer/installer that no asbestos has been used in the manufacture or installation of this building material.
- (c) This documentation is to be maintained with the District's AHERA records.

RECOMMENDATIONS FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WELDING SHOP BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

21 SF

- (a) No abatement is necessary.
 - (b) Maintain the material in an intact and undamaged condition.
 - (c) Include this material in the Operations and Maintenance (O & M) program until it has been replaced with a material that does not contain Asbestos.
 - (d) Include this material in the long term surveillance and re-inspection program
 - (e) Remove the material if it becomes damaged or repairs and maintenance work may impact this material.
- Removal must be designed and performed by accredited personnel only.

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL MISCELLANEOUS

650 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

650 SF

- (a) Sample the material. If ACM include this material in the Operations and Maintenance (O & M) manual. Maintain the material in an intact and undamaged condition
- (b) Remove the material if it becomes damaged or repairs and maintenance work may impact this material. Removal must be designed and performed by accredited personnel only.

RECOMMENDATIONS FOR
BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

RECOMMENDATION

QTY

(APPROXIMATE)

WOOD SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

200 SF

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

WOOD STORAGE SHED

WOOD STORAGE SHED

WOOD WALL

330 SF

This material has been deemed as Non-Asbestos Containing Material (Non-ACM) by the AHERA accredited Inspector. No recommendations are necessary.

End Of Report, Total Of 26 Pages

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

GROUPS STORAGE BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

15-174AAA

9/16/2015

Positive

ASSUMED

NS

STORAGE

MISCELLANEOUS

08-241AAA

10/13/2008

Positive

ASSUMED

NS

Metal Ceiling, Wood Wall, and Concrete Floor.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

MAINTENANCE GARAGE BUILDING

OFFICE

SINK UNDERCOATING

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

OFFICE

SUSPENDED CEILING TILE

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL MISCELLANEOUS

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

OFFICE, RESTROOM, SHOWER ROOM, AND STORAGE ROOM

SMOOTH WALL SURFACING

| | | | | |
|-----------|-----------|----------|---------|----|
| 05-212AAA | 4/18/2006 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

REPAIR / SERVICES GARAGE

CHALK BOARD

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

REPAIR / SERVICES GARAGE

WALL MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

RESTROOMS (2), AND SHOWER ROOM

HEAT SHIELD

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 3/5/2007 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

**ASBESTOS
AMOUNT**

**ASBESTOS CONTENT
(TYPE)**

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

DOORS - EXTERIOR

FIRE DOOR CORE INSULATION

12-185AAA

10/8/2012

Positive

ASSUMED

NS

DOORS - INTERIOR

FIRE DOOR CORE INSULATION

09-095AAA

5/11/2009

Positive

ASSUMED

NS

EXTERIOR WALLS

WEATHER PROOFING (OUTSIDE)

05-212AAA

4/18/2006

Positive

ASSUMED

NS

HVAC OFFICE AND HALLWAY

BASEBOARD MASTIC

05-212AAA

4/18/2006

Positive

ASSUMED

NS

HVAC OFFICE AND HALLWAY

SMOOTH WALL MISCELLANEOUS

05-212AAA

9/6/2005

Positive

ASSUMED

NS

HVAC OFFICE AND HALLWAY

SMOOTH WALL SURFACING

05-212AAA

4/18/2006

Positive

ASSUMED

NS

OFFICE PORTABLE

BASEBOARD MASTIC

05-212AAA

9/6/2005

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

08-241AAA

10/13/2008

Positive

ASSUMED

NS

OFFICE PORTABLE

SUSPENDED CEILING TILE

05-212AAA

9/6/2005

Positive

ASSUMED

NS

OFFICE PORTABLE

VINYL WALL COVER

05-212AAA

9/6/2005

Positive

ASSUMED

NS

OFFICE PORTABLE

VINYL WALL COVER MASTIC

08-241AAA

10/13/2008

Positive

ASSUMED

NS

OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

CARPET MASTIC

05-212AAA

4/18/2006

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

MENTOR'S HOUSE

ALL ROOMS

BASEBOARD MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 05-212AAA | 4/18/2006 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

ATTIC

LOOSE FILL INSULATION

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

DAYCARE KITCHEN

VINYL SHEETING

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

DAYCARE KITCHEN

VINYL SHEETING

| | | | | |
|-----------|-----------|----------|---------|----|
| 16-074AAA | 3/17/2016 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

DAYCARE KITCHEN

VINYL SHEETING BACKING PAPER/MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 16-074AAA | 3/17/2016 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

DAYCARE ROOM AND ENTRY TO KITCHEN

CEILING MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

**ASBESTOS
AMOUNT**

**ASBESTOS CONTENT
(TYPE)**

DAYCARE ROOM AND ENTRY TO KITCHEN
CEILING TILE

05-212AAA

9/6/2005

Positive

ASSUMED

NS

DAYCARE ROOM (IN SE CORNER OF BUILDING)
CARPET MASTIC

08-075AAA

4/14/2008

Positive

ASSUMED

NS

ENTIRE BUILDING
SMOOTH WALL MISCELLANEOUS

05-212AAA

9/6/2005

Positive

ASSUMED

NS

ENTIRE BUILDING
SMOOTH WALL SURFACING

05-212AAA

4/18/2006

Positive

ASSUMED

NS

EXTERIOR WALLS
ROUGH WALL

05-212AAA

9/6/2005

Positive

ASSUMED

NS

EXTERIOR WALLS
ROUGH WALL SURFACING

05-212AAA

9/6/2005

Positive

ASSUMED

NS

EXTERIOR WINDOWS
CAULKING

05-212AAA

9/6/2005

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

KITCHEN (COUNTER TOP) AND RESTROOM
MORTAR MISCELLANEOUS

05-212AAA

4/18/2006

Positive

ASSUMED

NS

OFFICE AND DAYCARE ROOMS
CARPET MASTIC

05-212AAA

9/6/2005

Positive

ASSUMED

NS

RESTROOM
BASEBOARD MASTIC

08-241AAA

10/13/2008

Positive

ASSUMED

NS

RESTROOM
VINYL FLOOR TILE

08-241AAA

10/13/2008

Positive

ASSUMED

NS

RESTROOM
VINYL FLOOR TILE MASTIC

08-241AAA

10/13/2008

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

METAL STORAGE CONTAINERS (8 EA)

METAL STORAGE CONTAINERS (8 EA)

STORAGE CONTAINER

05-212.NS

9/6/2005

Positive

ASSUMED

NS

Metal Storage Containers.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

METAL STORAGE SHED

METAL STORAGE SHED
STORAGE BUILDING

| | | | | |
|-----------|------------|----------|---------|----|
| 11-202.NS | 11/28/2011 | Positive | ASSUMED | NS |
|-----------|------------|----------|---------|----|

Metal Storage Shed.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

PG&E NORTH TOWER BUILDING

PG&E

MISCELLANEOUS

16-074.NS

3/17/2016

Positive

ASSUMED

NS

Metal and Concrete Building.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

PG&E SOUTH TOWER ENCLOSURE

TOWER

WOOD WALL

11-202.NS

11/28/2011

Negative

NON-ACM

NS

Wood Walls.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

PORTABLE

EXTERIOR DOOR

FIRE DOOR CORE INSULATION

| | | | | |
|-----------|-----------|----------|---------|----|
| 10-174AAA | 7/30/2010 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

INTERIOR DOOR

FIRE DOOR CORE INSULATION

| | | | | |
|-----------|-----------|----------|---------|----|
| 10-174AAA | 7/30/2010 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

PORTABLES

BASEBOARD MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 10-174AAA | 7/30/2010 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

PORTABLES

SUSPENDED CEILING TILE

| | | | | |
|-----------|-----------|----------|---------|----|
| 10-174AAA | 7/30/2010 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

PORTABLES

VINYL FLOOR TILE

| | | | | |
|-----------|-----------|----------|---------|----|
| 10-174AAA | 7/30/2010 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

PORTABLES

VINYL FLOOR TILE MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 10-174AAA | 7/30/2010 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

STORAGE PORTABLE BUILDING (REMOVED)

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

RESTROOM USED AS STORAGE CLOSET

VINYL SHEETING BACKING PAPER/MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

STORAGE PORTABLE

BASEBOARD MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

STORAGE PORTABLE

CARPET MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

STORAGE PORTABLE

PRESSED WOOD WALL PANEL

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

STORAGE PORTABLE

PRESSED WOOD WALL PANEL MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

STORAGE PORTABLE

SUSPENDED CEILING TILE

| | | | | |
|-----------|----------|----------|---------|----|
| 16-213REM | 9/9/2016 | Negative | REMOVED | NS |
|-----------|----------|----------|---------|----|

Material Removed as of this date.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

STORAGE PORTABLE

VINYL WALL COVER

16-213REM

9/9/2016

Negative

REMOVED

NS

Material Removed as of this date.

STORAGE PORTABLE

VINYL WALL COVER MASTIC

16-213REM

9/9/2016

Negative

REMOVED

NS

Material Removed as of this date.

STORAGE PORTABLE

WALL MASTIC

16-213REM

9/9/2016

Negative

REMOVED

NS

Material Removed as of this date.

STORAGE PORTABLE

WOOD WALL PANEL

16-213REM

9/9/2016

Negative

REMOVED

NS

Material Removed as of this date.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

**ASBESTOS
AMOUNT**

**ASBESTOS CONTENT
(TYPE)**

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

VINYL FLOOR TILE

11-202AAA

11/28/2011

Positive

ASSUMED

NS

ASSISTANT DIRECTOR

VINYL FLOOR TILE MASTIC

11-202AAA

11/28/2011

Positive

ASSUMED

NS

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

09-098AAA

5/11/2009

Positive

ASSUMED

NS

ENTIRE BUILDING

FIRE DOOR CORE INSULATION

05-212AAA

9/6/2005

Positive

ASSUMED

NS

EXTERIOR BUILDING

WEATHER PROOFING (OUTSIDE)

07-041AAA

3/5/2007

Positive

ASSUMED

NS

LOUNGE ROOM

SINK UNDERCOATING

08-075AAA

4/14/2008

Positive

ASSUMED

NS

MAIN OFFICE

BASEBOARD MASTIC

05-212AAA

9/6/2005

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

MAIN OFFICE

SMOOTH WALL MISCELLANEOUS

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

MAIN OFFICE

SMOOTH WALL SURFACING

| | | | | |
|-----------|-----------|----------|---------|----|
| 05-212AAA | 4/18/2006 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

MAIN OFFICE

SUSPENDED CEILING TILE

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

CARPET MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 05-212AAA | 4/18/2006 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER

| | | | | |
|-----------|------------|----------|---------|----|
| 08-214AAA | 10/13/2008 | Positive | ASSUMED | NS |
|-----------|------------|----------|---------|----|

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

VINYL WALL COVER MASTIC

| | | | | |
|-----------|------------|----------|---------|----|
| 08-241AAA | 10/13/2008 | Positive | ASSUMED | NS |
|-----------|------------|----------|---------|----|

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

**ASBESTOS
AMOUNT**

**ASBESTOS CONTENT
(TYPE)**

PLENUM

WALL INSULATION

05-212AAA

9/6/2005

Positive

ASSUMED

NS

STAFF RESTROOMS (2)

VINYL SHEETING

05-212AAA

4/18/2006

Positive

ASSUMED

NS

Apparent New Material as of this date.

STAFF RESTROOMS (2)

VINYL SHEETING BACKING PAPER/MASTIC

05-212AAA

4/18/2006

Positive

ASSUMED

NS

Apparent New Material as of this date.

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE

05-212AAA

9/6/2005

Positive

ASSUMED

NS

SUPPLY ROOM, DISPATCH, DRIVER TRAINING OFFICE, DRIVERS LOUNGE, KITCHEN, AND PROGRAMMING ROOM

VINYL FLOOR TILE MASTIC

05-212AAA

9/6/2005

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

COMMENT

DATE

RESULT

**ASBESTOS
AMOUNT**

**ASBESTOS CONTENT
(TYPE)**

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM
BASEBOARD MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM
VINYL FLOOR TILE

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM
VINYL FLOOR TILE MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

CARPENTERS SHOP, AND RESTROOM
CEILING MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 07-041AAA | 3/5/2007 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

CARPENTERS SHOP, AND RESTROOM
CEILING TILE

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

ENTIRE BUILDING
FIRE DOOR CORE INSULATION

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

EXTERIOR WALL OF WAREHOUSE OFFICE
CHALK BOARD

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

| SAMPLE NO. COMMENT | DATE | RESULT | ASBESTOS AMOUNT | ASBESTOS CONTENT (TYPE) |
|-----------------------|------|--------|--------------------|----------------------------|
|-----------------------|------|--------|--------------------|----------------------------|

EXTERIOR WALL OF WAREHOUSE OFFICE
WALL MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

WAREHOUSE OFFICE
CARPET MASTIC

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS
SMOOTH WALL MISCELLANEOUS

| | | | | |
|-----------|----------|----------|---------|----|
| 05-212AAA | 9/6/2005 | Positive | ASSUMED | NS |
|-----------|----------|----------|---------|----|

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS
SMOOTH WALL SURFACING

| | | | | |
|-----------|-----------|----------|---------|----|
| 05-212AAA | 4/18/2006 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

WOOD SHOP
SINK UNDERCOATING

| | | | | |
|-----------|-----------|----------|---------|----|
| 15-042REM | 3/18/2015 | Negative | REMOVED | NS |
|-----------|-----------|----------|---------|----|

WOOD SHOP (RESTROOM ONLY)
VINYL FLOOR TILE

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

WOOD SHOP (RESTROOM ONLY)
VINYL FLOOR TILE MASTIC

| | | | | |
|-----------|-----------|----------|---------|----|
| 09-098AAA | 5/11/2009 | Positive | ASSUMED | NS |
|-----------|-----------|----------|---------|----|

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

WELDING SHOP BUILDING

EXTERIOR

FIRE DOOR CORE INSULATION

15-174AAA

9/16/2015

Positive

ASSUMED

NS

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL MISCELLANEOUS

05-212AAA

9/6/2005

Positive

ASSUMED

NS

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING

05-212AAA

4/18/2006

Positive

ASSUMED

NS

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

WOOD SHEDS (2 EA)

WOOD STORAGE SHEDS (2 EA)

WOOD WALL

10-052AAA

3/8/2010

Negative

NON-ACM

NS

Wood Wall Panels.

SAMPLES REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

BUILDING NAME

LOCATION

MATERIAL TYPE

SAMPLE NO.

DATE

RESULT

ASBESTOS
AMOUNT

ASBESTOS CONTENT
(TYPE)

COMMENT

WOOD STORAGE SHED

WOOD STORAGE SHED

WOOD WALL

11-202.NS

11/28/2011

Negative

NON-ACM

NS

Wood Walls.

End Of Report, Total Of 22 Pages

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|--|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|--|

MAINTENANCE GARAGE BUILDING

MAINTENANCE GARAGE BUILDING

OFFICE

| | | | |
|------------------------|--------|------|--|
| SUSPENDED CEILING TILE | 260 SF | HIGH | P: Less Than 5% W: <10% Stains or Flaking |
|------------------------|--------|------|--|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 05/11/2009 | * Damages observed on. |
| 09/06/2005 | 2'X4' SUSPENDED CEILING TILE. This Material is in GOOD condition as of this date. |
| 05/11/2009 | Damage: <5% Physical Damage in the form of minor cuts and holes. <10% Water Damage due to 3 Tiles with water stains. Material Condition changed from GOOD to FAIR overall as of this date. Friability changed from Moderate to High to reflect this change. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | Additional Damage Observed. 11 Tiles have Water Damage. No other changes as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

BASEBOARD MASTIC

265 LF

LOW

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 11/08/2007 | * Various changes as of. |
| 11/28/2011 | * Damage observed. |
| 08/28/2014 | * Damage observed. |
| 09/06/2005 | MASTIC/Adhesive for 3" Cream BASEBOARD. This Material is in GOOD condition as of this date. |
| 11/05/2007 | Material Re-Assessed. Damage: <5% Physical Damage - due to 5 LF loose in Front Office. Friability changed from Low to Moderate. Material condition changed from GOOD to FAIR overall. No other changes as of this date. |
| 11/28/2011 | Additional Damage observed - in the form of approximately 20 LF is loose in 1 Office. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | Material Re-Assessed. Additional 40 LF of Damage found. Baseboard is missing and Mastic/Adhesive is exposed. No other changes as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | Additional Damage Observed. 8 LF Loose Mastic Exposed in Office 1. 8 LF Loose and 4 LF Missing in Office 2. No other changes as of this date. |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

PRESSED WOOD WALL PANEL

2,660 SF

MODERATE

P: No Visible Damage

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 03/27/2017 | Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 10/13/2008 | 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

| | | | | | | | |
|------------|---|--|--|--|--|--|--|
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

| | | | |
|--------------------------------|----------|-----|---|
| PRESSED WOOD WALL PANEL MASTIC | 2,660 SF | LOW | P: No Visible Damage W: <10% Stains or Flaking |
|--------------------------------|----------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | | | | | | | |
|------------|---|--|--|--|--|--|--|
| 10/13/2008 | Mastic/Adhesive for 4'x10' Pressed Wood Wall Panel with Vinyl Wall Cover. This Material is in GOOD condition as of this date. | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | |
| 03/27/2017 | Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

| | | | |
|------------------------|----------|------|--|
| SUSPENDED CEILING TILE | 1,600 SF | HIGH | P: Less Than 5% W: <10% Stains or Flaking |
|------------------------|----------|------|--|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | | | | | | | |
|------------|--|--|--|--|--|--|--|
| 11/28/2011 | * Damage observed. | | | | | | |
| 09/09/2016 | * Additional Damage observed on. | | | | | | |
| 09/06/2005 | 2'X4' SUSPENDED CEILING TILE. This Material is in GOOD condition as of this date. | | | | | | |
| 11/28/2011 | Damage: <10% Water Damage - in the form of 2 Tiles are Water Damaged in Office; <5% Physical Damage - in the form of 1 Tile is broken. Material condition changed from GOOD to FAIR overall. Friability changed from Moderate to High. No other changes as of this date. | | | | | | |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W): |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

| | | | | | | | |
|------------|--|--|--|--|--|--|--|
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | Additional Damage observed. 1 Tile is missing in Office. No other changes as of this date. | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

| | | | |
|------------------|----------|-----|---|
| VINYL WALL COVER | 2,660 SF | LOW | P: Less Than 5% W: No Evidence |
|------------------|----------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | | | | | | | |
|------------|---|--|--|--|--|--|--|
| 11/28/2011 | * Damage observed. | | | | | | |
| 03/27/2017 | Damage Observed. <10% Water Damage - in the form of 16 SF of Loose and Peeling Vinyl. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | |
| 09/06/2005 | 4'X10' VINYL COVER on Pressed Wood WALL PANELS. This Material is in GOOD condition as of this date. | | | | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICE PORTABLE

| | | | |
|-------------------------|----------|-----|---|
| VINYL WALL COVER MASTIC | 2,660 SF | LOW | P: Less Than 5% W: No Evidence |
|-------------------------|----------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | | | | | | | |
|------------|--------------------|--|--|--|--|--|--|
| 11/28/2011 | * Damage observed. | | | | | | |
|------------|--------------------|--|--|--|--|--|--|

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|

| | | | | | | | |
|------------|---|--|--|--|--|--|--|
| 10/13/2008 | Mastic/Adhesive for Vinyl Wall Cover, (on 4'x10' Pressed Wood Wall Panel). This Material is in GOOD condition as of this date. | | | | | | |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of approximately 1 SF is Damaged. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | |

MAINTENANCE SHOPS OFFICE PORTABLE BUILDING

OFFICES, LOUNGE ROOM AND LOCKSMITH OFFICE

| | | | |
|---------------|----------|-----|---|
| CARPET MASTIC | 1,600 SF | LOW | P: Less Than 5% W: No Evidence |
|---------------|----------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | | | | | | | |
|------------|--|--|--|--|--|--|--|
| 03/18/2015 | * Damage observed. | | | | | | |
| 04/18/2006 | MASTIC/Adhesive FOR GREEN CARPET. This Material is in GOOD condition as of this date. | | | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | | | |
| 03/18/2015 | Damage Observed. Offices have Approximately 1 SF of Carpet Damaged exposing Mastic/Adhesive. Material Condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | | | | |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|--|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|--|

MENTOR'S HOUSE

MENTOR'S HOUSE

ENTIRE BUILDING

SMOOTH WALL MISCELLANEOUS 6,400 SF MODERATE P: Less Than 5%
W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

08/28/2014 * Damage observed on.

03/17/2016 * Additional Damage observed on.

03/27/2017 Additional Damage Observed. 12 LF is Cracked in Kitchen. No other changes as of this date.

09/06/2005 GYPSUM WALLBOARD SYSTEM WALLS, (with Vinyl Wall Cover in some areas). This Material is in GOOD condition as of this date.

04/18/2006 This Material is also on ceilings. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 Damage observed. Physical Damage <5% in the of form of a crack in the Hallway. Material condition changed from GOOD to FAIR overall. Friability changed from Low to Moderate. No other changes as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 Additional Damage observed. 6 LF is cracked in Kitchen. No other changes as of this date.

09/09/2016 This Material is unchanged as of this date.

MENTOR'S HOUSE

EXTERIOR WINDOWS

CAULKING 400 LF LOW P: Less Than 5%
W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/11/2009 * Additional Damage observed as of.

09/06/2005 WINDOW CAULKING. Damaged in various areas. This Material is in FAIR condition as of this date.

05/11/2009 Damage: <10% Water Damage due to moisture and heat degradation on various surfaces. Material remains in FAIR condition overall as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|-------------------------|--|----------------------|------------|---|
| LOCATION | | | | |
| MATERIAL TYPE | | | | |
| RISK ASSESMENT CATEGORY | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
| COMMENTS | | | | |

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|-------------------------|--|----------------------|------------|--|
| LOCATION | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P: WATER DAMAGE (W:) |
| MATERIAL TYPE | | | | |
| RISK ASSESMENT CATEGORY | | | | |
| COMMENTS | | | | |

PORTABLE

PORTABLE

PORTABLES

| | | | |
|------------------|--------|-----|---|
| VINYL FLOOR TILE | 480 SF | LOW | P: Less Than 5% W: No Evidence |
|------------------|--------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 11/28/2011 | * Damage observed. |
| 03/27/2017 | Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date. |
| 07/30/2010 | 12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

PORTABLE

PORTABLES

| | | | |
|-------------------------|--------|-----|---|
| VINYL FLOOR TILE MASTIC | 480 SF | LOW | P: Less Than 5% W: No Evidence |
|-------------------------|--------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 11/28/2011 | * Damage observed on. |
| 03/27/2017 | Additional Damage Observed. Several Tiles appear to have Cracks on them. No other changes as of this date. |
| 07/30/2010 | Mastic/Adhesive for 12"x12" Beige and Cream Vinyl Floor Tile. This Material is in GOOD condition as of this date. |
| 11/28/2011 | Damage: <5% Physical Damage - in the form of a hairline crack observed on Tile. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 09/23/2013 | This Material is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|

| | |
|------------|---|
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|-------------------------|--|----------------------|------------|----------------------|
| LOCATION | | | | |
| MATERIAL TYPE | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) |
| RISK ASSESMENT CATEGORY | | | | WATER DAMAGE (W:) |
| COMMENTS | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

| | | | |
|------------------|-------|-----|---|
| VINYL FLOOR TILE | 38 SF | LOW | P: Less Than 5% W: No Evidence |
|------------------|-------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 03/27/2017 | Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 11/28/2011 | 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

ASSISTANT DIRECTOR

| | | | |
|-------------------------|-------|-----|---|
| VINYL FLOOR TILE MASTIC | 38 SF | LOW | P: Less Than 5% W: No Evidence |
|-------------------------|-------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 03/27/2017 | Damage Observed. <5% Physical Damage - in the form of 2 Tiles are Sliding and Exposing Mastic. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. |
| 11/28/2011 | Mastic/Adhesive for 12"x12" Grey Vinyl Floor Tile. This Material is in GOOD condition as of this date |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|--|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|--|

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND 2 STORAGE ROOM

SUSPENDED CEILING TILE

1,500 SF

HIGH

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 03/08/2010 | * Various changes on. |
| 07/30/2010 | * Various changes on. |
| 11/28/2011 | * Additional Damage observed on. |
| 10/08/2012 | * Additional Damage observed on. |
| 09/23/2013 | * Additional Damage observed on. |
| 08/28/2014 | * Additional Damage observed on. |
| 03/18/2015 | * Additional Damage observed on. |
| 03/17/2016 | * Additional Damage observed on . |
| 09/09/2016 | * Partial Repairs observed on. |
| 03/27/2017 | Additional Damage Observed. 2 Tiles with Water Stains and Several Tiels Have been repainted in Staff Room. However 11 Tiles have Cracks and Cuts with Broken Edges in Staff Room. 5 Tiles have Water Damage while other have been Painted Over. Several Tiles have Cracks and Borken Edges in the Conferecnce Room. 2 Tiles have have Water Damage in the Storage by Front of the Building. 2 Tiles have Water Damage and 1 Tile Missing in the Storage by Rear of the Building. No other changes as of this date. |
| 05/12/2009 | 2'x4' Suspended Ceiling Tile, (with small uneven cuts and holes pattern). Damage: <5% Physical Damage due to 3 missing Tiles. This Material is in FAIR condition as of this date. |
| 03/08/2010 | Location Description changed from STAFF'S LOUNGE ROOM to CONFERENCE ROOM AND STAFF'S LOUNGE ROOM. Quantity changed from 500 SF to 1,500 SF. Additional Damage: <10% Water Damage in the form of 2 Tiles are Water Damaged. No other changes as of this date. |
| 08/30/2010 | Location Description changed from CONFERENCE ROOM AND STAFF'S LOUNGE ROOM to CONFERENCE ROOM, STAFF'S LOUNGE ROOM, AND STORAGE ROOM. Additional Damage observed in Conference Room in the form of 3 Tiles are Water Damaged and 1 has a hole. No other changes as of this date. |
| 11/28/2011 | Additional Damage observed - in the form of 3 more Tiles are Water Damaged, and 1 Tile is missing in Storage Room. No other changes as of this date. |
| 10/08/2012 | Damage Re-Assessed and Conference Room now has a total of 4 Water Damaged Tiles. No other changes as of this date. |
| 09/23/2013 | Material Re-Assessed. Conference Room now has Debris on Floor due to Water leaks from the Roof. No other changes as of this date. |
| 03/03/2014 | Debris has been cleaned up. No other changes as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|-------------------------|--|----------------------|------------|---|
| LOCATION | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
| MATERIAL TYPE | | | | |
| RISK ASSESMENT CATEGORY | | | | |
| COMMENTS | | | | |

| | | | | | |
|------------|---|--|--|--|--|
| 08/28/2014 | Material Re-Assessed. 2 Suspended Ceiling Tiles have Water Damage in the Office. | | | | |
| 03/18/2015 | Additional Damage Observed. 3 Suspended Ceiling Tiles Water Damaged. No other change as of this date. | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | |
| 03/17/2016 | Additional Damage observed. 1 Tile is missing in Director's Office. No other changes as of this date. | | | | |
| 09/09/2016 | Partial Repairs observed. Current Damage: 2 Tiles with Water Damage in the Storage Room, and 1 Tile with Water Damage in the Conference Room. No other changes as of this date. | | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

BASEBOARD MASTIC

1,400 LF

LOW

P: Less Than 5%

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | | | | | |
|------------|--|--|--|--|--|
| 03/18/2015 | * New material installed. | | | | |
| 03/06/2017 | * Material Re-Assessed 03. | | | | |
| 03/27/2017 | Damage Observed. <5% Physical Damage - in the form of 4" of Baseboard is missing in Main Office. Material condition changed from GOOD to FAIR overall. Friability changed from Non to Low. No other changes as of this date. | | | | |
| 09/06/2005 | MASTIC/Adhesive FOR BASEBOARD. Approximately 15 LF exposed in Womens Restroom. This Material is in FAIR condition as of this date. | | | | |
| 04/18/2006 | Material redefined as 4" Black Baseboard (in Offices and Hallways) and 4" Blue Baseboard (in Conference Room). All Damages have been repaired. Friability changed from Low to Non. No other changes as of this date. | | | | |
| 03/08/2010 | Material Re-Assessed. 4" Brown Baseboard was also observed in several Offices and Main Entry Office. No other changes as of this date. | | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | | |
| 08/28/2014 | This Material is unchanged as of this date. | | | | |
| 03/18/2015 | New Material Installed. Men's and Women's Restrooms Floor and Baseboard now Covered with Vinyl Sheeting. Old Material is Possibly Behind. No other changes as of this date. | | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | | |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

| | | | |
|---------------------------|----------|----------|---|
| SMOOTH WALL MISCELLANEOUS | 5,100 SF | MODERATE | P: Less Than 5% W: No Evidence |
|---------------------------|----------|----------|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 05/11/2009 | * Additional Damages observed on. |
| 11/28/2011 | * Additional Damage observed on. |
| 09/06/2005 | GYPSUM WALLBOARD SYSTEM, WALLS. Damages noticed. This Material is in FAIR condition as of this date. |
| 05/11/2009 | Additional Damages observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date. |
| 11/28/2011 | Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. Friability changed from Low to Moderate. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

| | | | |
|-----------------------|----------|----------|---|
| SMOOTH WALL SURFACING | 5,100 SF | MODERATE | P: Less Than 5% W: No Evidence |
|-----------------------|----------|----------|---|

DAMAGED FRIABLE SURFACING ACM

| | |
|------------|--|
| 11/28/2011 | * Additional Damage observed. |
| 04/18/2006 | Skim coat for GYPSUM WALLBOARD SYSTEM, WALLS. Various Damages noticed. This Material is in FAIR condition as of this date. |
| 05/11/2009 | Additional Damages observed. <5% Physical Damage in the form of small holes, gauging, and scratches on various surfaces. Material remains in FAIR condition overall as of this date. |
| 11/28/2011 | Additional Damage observed - in the form of Kitchen Ceiling has a crack, and approximately 1 SF of Material is peeling. Material condition changed from GOOD to FAIR. Friability changed from Low to Moderate. No other changes as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|-------------------------|---------------|----------------------|------------|--|
| LOCATION | MATERIAL TYPE | | | |
| RISK ASSESMENT CATEGORY | | | | |
| COMMENTS | | | | |

| | |
|------------|---|
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICE

| | | | |
|-----------------------|----------|------|--|
| SUSPENDE CEILING TILE | 2,150 SF | HIGH | P: Less Than 5% W: <10% Stains or Flaking |
|-----------------------|----------|------|--|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 11/08/2007 | * Various changes as of. |
| 05/11/2009 | * Additional Damages observed as of. |
| 09/03/2009 | * Various changes. |
| 03/08/2010 | * Various changes. |
| 11/28/2011 | * Additional Damage observed. |
| 10/08/2012 | * Additional Damage observed. |
| 08/28/2014 | * Additional Damage observed. |
| 09/09/2016 | * Additional Damage observed on. |
| 03/27/2017 | Additional Damage Observed. 4 Tiles with Water Damage and Several other have broken edges and are Cracked in the Director's Office. 4 Water Damage Tiles, 7 other Tiles have Cracks, in the Project Manager's Office. 4 Tiles with Cracked and Chipped Tiles in the Executive Assistant Office. No other changes as of this date. |
| 09/06/2005 | 2'X4' SUSPENDE CEILING TILE. Several Tiles Damaged and Water stained. This Material is in FAIR condition as of this date. |
| 11/05/2007 | Material Re-Assessed. Damage: <5% Physical Damage - 1 Tile in Telephone Panel Closet and 1 Tile in Mens Restroom; <10% Water Damage - 2 Tiles in Blueprint Office and 4 Tiles in Trainer Office. This Material is in FAIR condition overall as of this date. |
| 04/14/2008 | Additional Damage noted: 1/2 Tile is missing in the Supply Storage Room as of this date. |
| 10/13/2008 | Additional 3 Tiles missing at Lounge area. Also several Tiles Damaged at Hallway. No other changes as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|-------------------------|--|----------------------|------------|---|
| LOCATION | | | | |
| MATERIAL TYPE | | | | |
| RISK ASSESMENT CATEGORY | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
| COMMENTS | | | | |
| 05/11/2009 | Damages Re-Assessed. 1 Tile is missing above the Main Entry Door, (next to Receptionist Office). Physical damage is in various locations. Tiles damaged in Telephone Panel Closet has increased to 3 Tiles. Quantity changed from 2,650 SF to 3,150 SF. No change to damage in Hallway. Friability changed from Moderate to High to reflect these changes. | | | |
| 09/03/2009 | Repairs have been made in Main Lobby. Missing Tile has been replaced. Also, 3 Tiles Damaged at Hallway have been repaired. Telephone Panel Closet and Storage Closet are Water Damaged. No other changes as of this date. | | | |
| 03/08/2010 | Material Re-Assessed. Approx. 1,000 SF of 2'x4' Suspended Ceiling Tile is the same as Staff's Lounge. Quantity changed from 3,150 SF to 2,150 SF. Additional Damage in the form of 6 Tiles are cracked in Hallway and Main Office. Also, 2 Tiles are Water Damaged in Office, adjacent to Lounge Room. Material remains in FAIR condition. No other changes as of this date. | | | |
| 11/28/2011 | Additional Damage observed - in the form of Hallway has some Tiles broken. No other changes as of this date. | | | |
| 10/08/2012 | Additional Damage - in the form of 1 hole observed on Hallway Ceiling. Also, 2 additional Water Damaged Tiles observed in Telephone Panel Closet. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | Material Re-Assessed. Additional Water Damage Observed. No other changes as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | Additional Damage observed and Partial Repairs made. Director's Office has 1 Tile with Water Damage. Missing Tile above Main Entry Door has been Replaced. No other changes as of this date. | | | |
| 09/09/2016 | Additional Damage observed. 2 Tiles with Water Damage in Trainer's Office. No other changes as of this date. | | | |

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, HALLWAY, CONFERENCE ROOM, STORAGE ROOM AND LOUNGE ROOM

| | | | |
|---------------|----------|-----|--|
| CARPET MASTIC | 3,300 SF | LOW | P: Less Than 5% W: <10% Stains or Flaking |
|---------------|----------|-----|--|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 05/11/2009 | * Damage observed as of. |
| 03/27/2017 | Additional Damage Observed. Storage Room by Rear of Building there is Water Damage in the form of Stains and Mold, still damp. 20 LF of Blue Carpet in the Staff Lounge is loose. No other changes as of this date. |
| 04/18/2006 | MASTIC/Adhesive for CARPETS (Approximately 80% Blue and 20% Mix of Red, Brown and Grey Colors). This Material is in FAIR condition as of this date. |
| 05/11/2009 | Damage: <5% Physical Damage in the form of the Carpet has been Damaged due to several separations observed in locations of seams. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

| | | | |
|------------------|----------|-----|---|
| VINYL WALL COVER | 7,800 SF | LOW | P: Less Than 5% W: No Evidence |
|------------------|----------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/27/2017 Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.

10/13/2008 Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date.

09/03/2009 Material remains in <5% Physical Damage. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOM, HALLWAY, CONFERENCE ROOM

| | | | |
|-------------------------|----------|-----|---|
| VINYL WALL COVER MASTIC | 7,800 SF | LOW | P: Less Than 5% W: No Evidence |
|-------------------------|----------|-----|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/27/2017 Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.

10/13/2008 Mastic/Adhesive for Vinyl Wall Cover, (on Pressed Wood Wall Panel). Damage in the form of cuts and holes. This Material is in FAIR condition as of this date.

09/03/2009 Material remains in <5% Physical Damage. This Material is unchanged as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|-------------------------|--|----------------------|------------|---|
| LOCATION | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
| MATERIAL TYPE | | | | |
| RISK ASSESMENT CATEGORY | | | | |
| COMMENTS | | | | |

03/18/2015 This Material is unchanged as of this date.
09/16/2015 This Material is unchanged as of this date.
03/17/2016 This Material is unchanged as of this date.
09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL 7,800 SF MODERATE **P:** Less Than 5%
W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/27/2017 Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.
09/06/2005 Pressed wood wall panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date.
10/13/2008 Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date.
09/03/2009 Material remains in <5% Physical Damage. No changes as of this date.
03/03/2014 This Material is unchanged as of this date.
08/28/2014 This Material is unchanged as of this date.
03/18/2015 This Material is unchanged as of this date.
09/16/2015 This Material is unchanged as of this date.
03/17/2016 This Material is unchanged as of this date.
09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM

PRESSED WOOD WALL PANEL MASTIC 7,800 SF LOW **P:** Less Than 5%
W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

03/27/2017 Additional Damage Observed. 20 SF of Loose Vinyl and Wall Boards in the Conference Room. No other changes as of this date.
09/06/2005 Mastic/Adhesive for Pressed Wood Wall Panels. Damaged in forms of cuts and holes in Receptionist Area. This Material is in FAIR condition as of this date.
10/13/2008 Material Location changed from MAIN OFFICE to MAIN OFFICES, RESTROOMS, HALLWAY CONFERENCE ROOM. No other changes as of this date.
09/03/2009 Material remains in <5% Physical Damage. No changes as of this date.

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | | |
|-------------------------|--|---------------|--|------------|----------------------|
| LOCATION | | QTY | | FRIABILITY | PHYSICAL DAMAGE (P:) |
| MATERIAL TYPE | | (APPROXIMATE) | | | WATER DAMAGE (W:) |
| RISK ASSESMENT CATEGORY | | | | | |
| COMMENTS | | | | | |

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

TRANSPORTATION AND MAINTENANCE DEPARTMENT OFFICE BUILDING

PLENUM

WALL INSULATION

2,500 SF

MODERATE

P: Less Than 10%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

09/06/2005 spray-on foam insulation. Material is loose and Water Damaged in several locations. This Material is in FAIR condition as of this date.

09/03/2009 Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

03/18/2015 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

WAREHOUSE BUILDING

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, CARPENTERS SHOP, AND LOUNGE ROOM

BASEBOARD MASTIC

470 LF

MODERATE **P:** Less Than 50% No Debris
W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 04/18/2006 | * Various changes on. |
| 09/06/2005 | MASTIC/Adhesive fOR 4" Black and brown BASEBOARDS. Material is exposed in Carpenters Shop and Restroom. This Material is in FAIR condition as of this date. |
| 04/18/2006 | Approximately 120 LF is exposed in Shop and Main Office. Friability changed from Moderate to High. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date. |
| 05/11/2009 | Damages Re-Assessed. Physical Damages remains at <50%. This Material is unchanged as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE

2,310 SF

MODERATE **P:** Less Than 50% No Debris
W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 05/11/2009 | * Additional damages observed as of. |
| 04/13/2012 | * Location Description changed. |
| 10/08/2012 | * Additional Damage observed. |
| 08/28/2014 | * Various changes. |
| 09/06/2005 | 12"X12" MULTI-COLOR VINYL FLOOR TILE. Broken and missing in various locations. This Material is in FAIR condition as of this date. |
| 04/14/2008 | 50 SF Removed in the Restroom. Quantity changed from 2,360 SF to 2,310 SF. This Material condition is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|-------------------------|---|----------------------|------------|---|
| LOCATION | MATERIAL TYPE | | | |
| RISK ASSESMENT CATEGORY | | | | |
| COMMENTS | | | | |
| 05/11/2009 | Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Friability changed from Low to Moderate. Recommendation changed to reflect this change. | | | |
| 04/13/2012 | Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date. | | | |
| 10/08/2012 | Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | Material Re-Assessed. Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

WAREHOUSE BUILDING

ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM

VINYL FLOOR TILE MASTIC

2,360 SF

LOW

P: Less Than 50% No Debris

W: No Evidence

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 04/13/2012 | * Location Description changed. |
| 10/08/2012 | * Additional Damage observed. |
| 08/28/2014 | * Various changes. |
| 09/06/2005 | MASTIC/Adhesive for 12"X12" MULTI-COLOR VINYL FLOOR TILE. Material is exposed in broken and missing Tile locations. This Material is in FAIR condition as of this date. |
| 04/14/2008 | 50 SF is exposed in the Restroom. This Material condition is unchanged as of this date. |
| 05/11/2009 | Damages Re-Assessed. Physical Damage has increased to <50% and approx. 100 SF is Damaged due to oil spills and degradation in Wood Shop (Warehouse Storage Room) by the South Wall. Material condition changed from FAIR to POOR. Friability changed from Low to Moderate. Recommendation changed to reflect this change. 50 SF that was exposed in Restroom has been repaired. Material has been replaced with Off-White 12"x12". |
| 04/13/2012 | Location Description changed from ALL OFFICES, RESTROOMS, SHOPS, AND LOUNGE ROOM to ALL OFFICES, RESTROOMS, SHOPS, LOUNGE ROOM, AND WAREHOUSE STORAGE ROOM. No other changes as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|-------------------------|--|----------------------|------------|---|
| LOCATION | MATERIAL TYPE | | | |
| RISK ASSESMENT CATEGORY | | | | |
| COMMENTS | | | | |
| 10/08/2012 | Additional Damage - in the form of 4 Tiles are becoming loose in Wood Shop. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | Material Re-Assessed.Warehouse Storage Room has Several Tiles Broken and Missing. Friability changed from Moderate to Low. No other changes as of this date. | | | |
| 03/18/2015 | This Material is unchanged as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |

WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM

| | | | |
|----------------|----------|----------|---|
| CEILING MASTIC | 1,000 SF | MODERATE | P: Less Than 50% No Debris W: <10% Stains or Flaking |
|----------------|----------|----------|---|

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 10/08/2012 | * Additional Damage observed. |
| 08/28/2014 | * Various changes. |
| 03/27/2017 | Additional Damage Observed. Storage Room has 100 SF of Water Damage and 6 Tiles are Missing. 40 Sf of Water Damage and 25 loose Tiles in the Shop. No other changes as of this date. |
| 03/05/2007 | Mastic/Adhesive for 1'x1' Ceiling Tile. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. No other changes as of this date. |
| 05/11/2009 | Material condition is FAIR overall. This Material is unchanged as of this date. |
| 09/03/2009 | Material Re-Assessed. Physical Damage is <50% and remains in FAIR condition overall as of this date. |
| 10/08/2012 | Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. Friability changed from Low to Moderate. No other changes as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

WAREHOUSE BUILDING

CARPENTERS SHOP, AND RESTROOM

CEILING TILE

1,000 SF

HIGH

P: Less Than 5%

W: >10% Evident

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|---|
| 04/18/2006 | * Condition changed on. |
| 03/05/2007 | * Various changes on. |
| 10/08/2012 | * Additional Damage observed. |
| 08/28/2014 | * Material Re-Assessed. |
| 09/06/2005 | 1'X1' NAILED-ON CEILING TILE. Material is damaged in the form of holes and cuts. This Material is in FAIR condition as of this date. |
| 04/18/2006 | >10% of Material is Water Damaged. Friability changed from Moderate to High. Condition changed from FAIR to POOR. Recommendation changed to reflect this fact. No other changes as of this date. |
| 03/05/2007 | Material Description changed from ' 1'x1' Nailed-on Ceiling Tile. ' to '1'x1' Ceiling Tile, (Glued-on). Mastic/Adhesive entry added for this Material. Damage reassessed. Damage: <5% Physical Damage - in the form of approximately 10 SF missing in Entry Area; <10% Water Damage - in the form of loose and falling Ceiling Tiles. Friability changed to High. No other changes as of this date. |
| 09/03/2009 | Damage Re-Assessed. Physical Damage has changed to <50% due to scratches and gouging observed. Water Damage remains <10% and in POOR condition as of this date. |
| 10/08/2012 | Material condition Re-Assessed and Wood Shop has 4 Tiles becoming loose. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | Carpenter's Shop has 300 Ceiling Tiles Missing and Mastic/Adhesive is exposed. It is now Covered with Plywood. Friability changed from Low to Moderate. No other changes as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | This Material is unchanged as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESSMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|--------------------------|----------|----------------------|------------|---|

WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL MISCELLANEOUS

6,620 SF

LOW

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

| | |
|------------|--|
| 03/05/2007 | * Various changes on. |
| 09/23/2013 | * Friability changed on. |
| 09/06/2005 | GYPSUM WALLBOARD SYSTEM WALLS AND CEILINGS. This Material is in GOOD condition as of this date. |
| 03/05/2007 | Damage Re-Assessed. Damage: <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date. |
| 04/14/2008 | Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF Damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date. |
| 09/03/2009 | Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date. |
| 09/23/2013 | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | This Material is unchanged as of this date. |
| 08/28/2014 | This Material is unchanged as of this date. |
| 03/18/2015 | This Material is unchanged as of this date. |
| 09/16/2015 | This Material is unchanged as of this date. |
| 03/17/2016 | This Material is unchanged as of this date. |
| 09/09/2016 | This Material is unchanged as of this date. |
| 03/27/2017 | No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date. |

WAREHOUSE BUILDING

WAREHOUSE RESTROOMS, LOUNGE ROOM, OFFICES, AND SHOPS

SMOOTH WALL SURFACING

6,620 SF

MODERATE

P: Less Than 5%

W: <10% Stains or Flaking

DAMAGED FRIABLE SURFACING ACM

| | |
|------------|--------------------------|
| 03/05/2007 | * Various changes on. |
| 09/23/2013 | * Friability changed on. |
| 03/03/2014 | * Friability changed on. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS |
|---------------|----------|---------------|-------------------------|--|
| | | | QTY (APPROXIMATE) | FRIABILITY PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
| 04/18/2006 | | | | skim coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. This Material is in GOOD condition as of this date. |
| 03/05/2007 | | | | Damage Re-Assessed. Damage: <5% Physical Damage - in the form of small cuts and holes in Restrooms and Entry Hall. Material Condition changed from GOOD to FAIR. No other changes as of this date. |
| 04/14/2008 | | | | Water Damage (<10% overall) under the 1'x1' Ceiling Tiles and 5 SF damaged or missing on the Wall next to the Entry Door. This Material is in FAIR condition as of this date. |
| 09/03/2009 | | | | Material remains in <5% Physical Damage and <10% Water Damage. This Material is unchanged as of this date. |
| 09/23/2013 | | | | Friability changed from Moderate to Low. No other changes as of this date. |
| 03/03/2014 | | | | Friability changed from Low to Moderate. No other changes as of this date. |
| 08/28/2014 | | | | This Material is unchanged as of this date. |
| 03/18/2015 | | | | This Material is unchanged as of this date. |
| 09/16/2015 | | | | This Material is unchanged as of this date. |
| 03/17/2016 | | | | This Material is unchanged as of this date. |
| 09/09/2016 | | | | This Material is unchanged as of this date. |
| 03/27/2017 | | | | No Access to Lounge Room as of this date. Other locations were Accessable. No other changes as of this date. |

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | LOCATION | MATERIAL TYPE | RISK ASSESMENT CATEGORY | COMMENTS | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P): WATER DAMAGE (W:) |
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|
|---------------|----------|---------------|-------------------------|----------|----------------------|------------|---|

WELDING SHOP BUILDING

WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL MISCELLANEOUS 650 SF MODERATE **P:** Less Than 50% No Debris
W: <10% Stains or Flaking

DAMAGED OR SIGNIFICANTLY DAMAGED FRIABLE MISCELLANEOUS ACM

05/11/2009 * Additional Damages observed on.

09/06/2005 GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. This Material is in GOOD condition as of this date.

04/18/2006 Material Re-Assessed. Damage: <10% Physical Damage - noted in forms of holes and cuts. Friability changed from Low to Moderate. This Material is in FAIR condition overall as of this date.

05/11/2009 Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Recommendation changed to reflect this change. No other changes as of this date.

03/03/2014 This Material is unchanged as of this date.

08/28/2014 This Material is unchanged as of this date.

09/16/2015 This Material is unchanged as of this date.

03/17/2016 This Material is unchanged as of this date.

09/09/2016 This Material is unchanged as of this date.

03/27/2017 This Material is unchanged as of this date.

WELDING SHOP BUILDING

SIGNS / TOOLS / PARTS SHOP

SMOOTH WALL SURFACING 650 SF MODERATE **P:** Less Than 50% No Debris
W: <10% Stains or Flaking

DAMAGED FRIABLE SURFACING ACM

05/11/2009 * Additional Damages observed on.

09/23/2013 * Condition changed on.

04/18/2006 Skim Coat for GYPSUM WALLBOARD SYSTEM WALLS aND CEILINGS. <10% Physical Damages noted in forms of holes and cuts. This Material is in FAIR condition as of this date.

05/11/2009 Damages Re-Assessed. Physical Damages changed to <50% due to deterioration of Material in the form of cuts, holes, and gauging. <10% Water Damage in the form of degradation. Material condition changed from FAIR to POOR overall. Friability changed from Non to Moderate. Recommendation changed to reflect this change.

DAMAGE REPORT FOR

BUESD MAINTENANCE AND TRANSPORTATION YARD

| BUILDING NAME | | | | |
|----------------------------------|--|----------------------|------------|--|
| LOCATION | | | | |
| MATERIAL TYPE | | | | |
| RISK ASSESMENT CATEGORY | | QTY (APPROXIMATE) | FRIABILITY | PHYSICAL DAMAGE (P:) WATER DAMAGE (W:) |
| COMMENTS | | | | |
| 09/23/2013 | This Material changed from POOR condition to FAIR condition as of this date. No other changes as of this date. | | | |
| 03/03/2014 | This Material is unchanged as of this date. | | | |
| 08/28/2014 | This Material is in POOR condition as of this date. | | | |
| 09/16/2015 | This Material is unchanged as of this date. | | | |
| 03/17/2016 | This Material is unchanged as of this date. | | | |
| 09/09/2016 | This Material is unchanged as of this date. | | | |
| 03/27/2017 | This Material is unchanged as of this date. | | | |
| End Of Report, Total Of 26 Pages | | | | |

Plumbing
Locksmith

Garage

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: *NOV. 5, 07*

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 04-14-08

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 10/13/08

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 05-11-09

09-09-8 RBZ

Welding Shop

Grounds
Tools
Mower

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

51181
1669

Plumbing
Locksmith

Main Office

Garage

metal storage

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 09-03-09

metal garage



GT
porta

Carpenter shop, Warehouse,
Grounds Supply

metal storage

Towers

Grounds
Tools
Mower

Welding Shop

metal storage

BERREYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 03-08-10

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON:

7/30/10

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Grounds
Tools
Mower

Welding Shop

Plumbing
Locksmith

Main Office

Garage

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 11-29-11

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 04-13-12

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 10-8-12

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON:

04-01-13

Welding Shop

Grounds
Tools
Mower

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 09-23-2013

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 3-3-14

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 8-28-14

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 3/18/15

Grounds
Tools
Mower

Welding Shop

BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Plumbing
Locksmith

Garage

PORTABLE

GT
porta

Carpenter shop, Warehouse,
Grounds Supply

Towers

Main Office

BUESD MAINTENANCE AND TRANSPORATION YARD
INSPECTED ON: 2/15/16


BERRYESSA UNION SCHOOL DISTRICT
Maintenance Yard
945 Piedmont Road
San Jose, CA 95132

Welding Shop





Grounds
Tools
Mower

BUESD MAINTENANCE AND TRANSPORTATION YARD
INSPECTED ON:

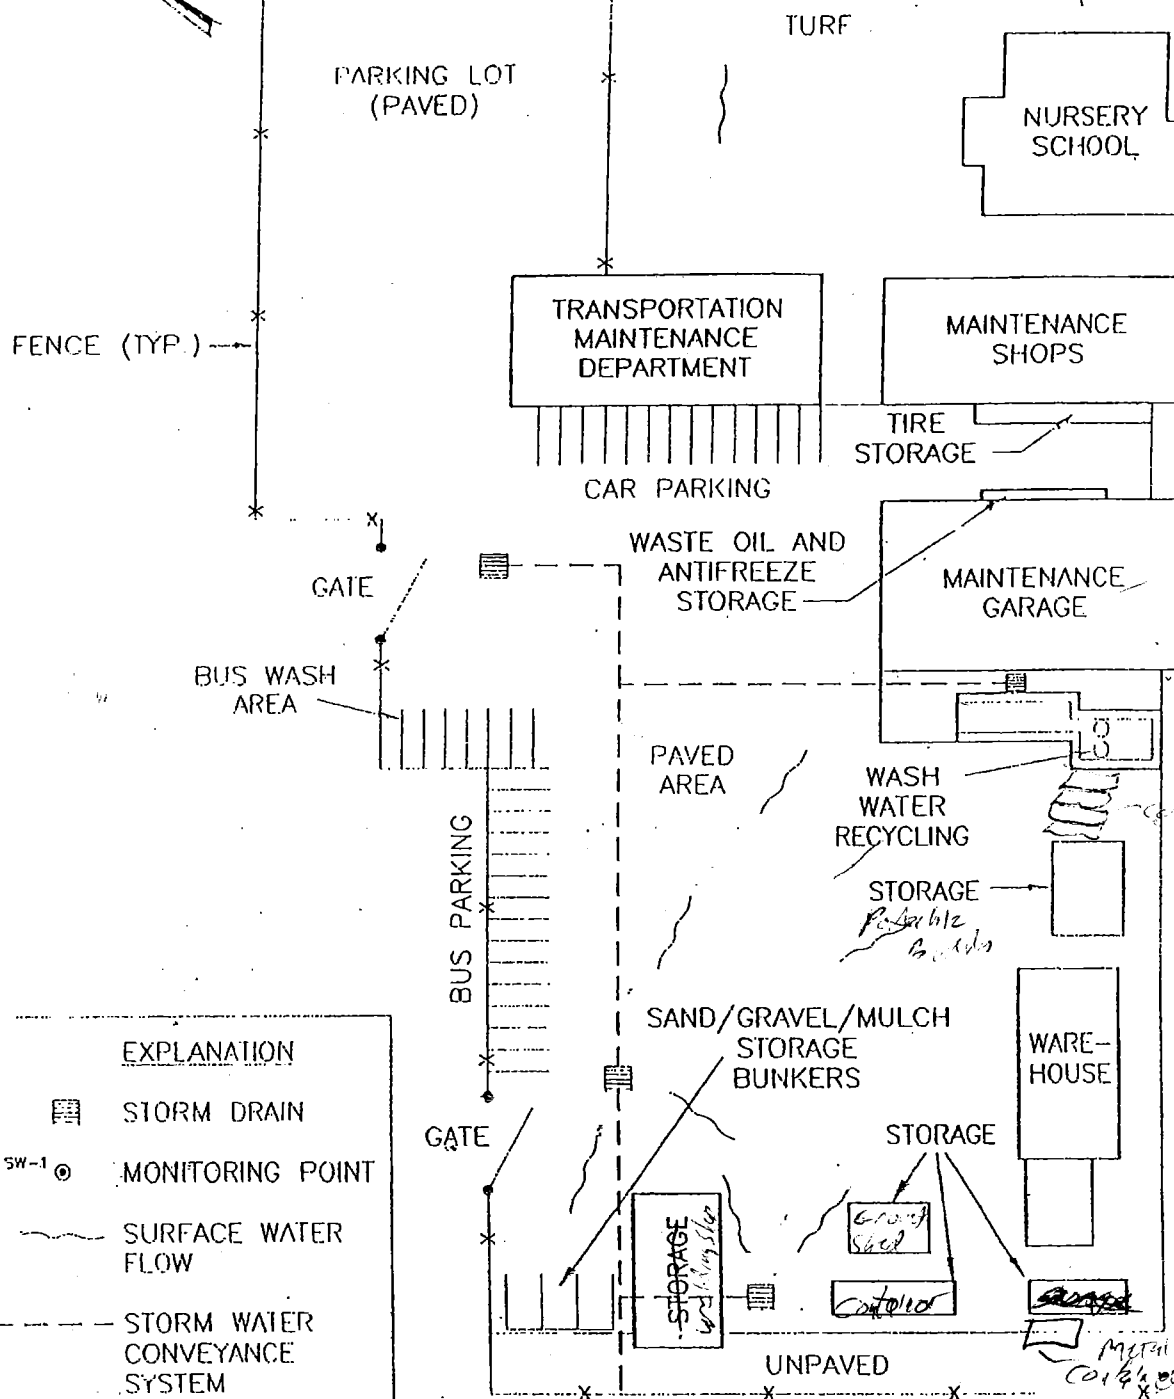3-17-16 *1990*



EXPLANATION

-  STORM DRAIN
-  MONITORING POINT
-  SURFACE WATER FLOW
-  STORM WATER CONVEYANCE SYSTEM


NOT TO SCALE



DATE JUN. 1997
OWN KAJ
APP
REV
PROJECT NO.
2136-001.001

FIGURE 2
BERRYESSA UNION SCHOOL DISTRICT
945 PIEDMONT ROAD
SAN JOSE, CALIFORNIA
CORPORATION YARD
SITE PLAN

BUESD MAINTENANCE AND TRANSPORTATION YARD
INSPECTED ON: 7-9-16

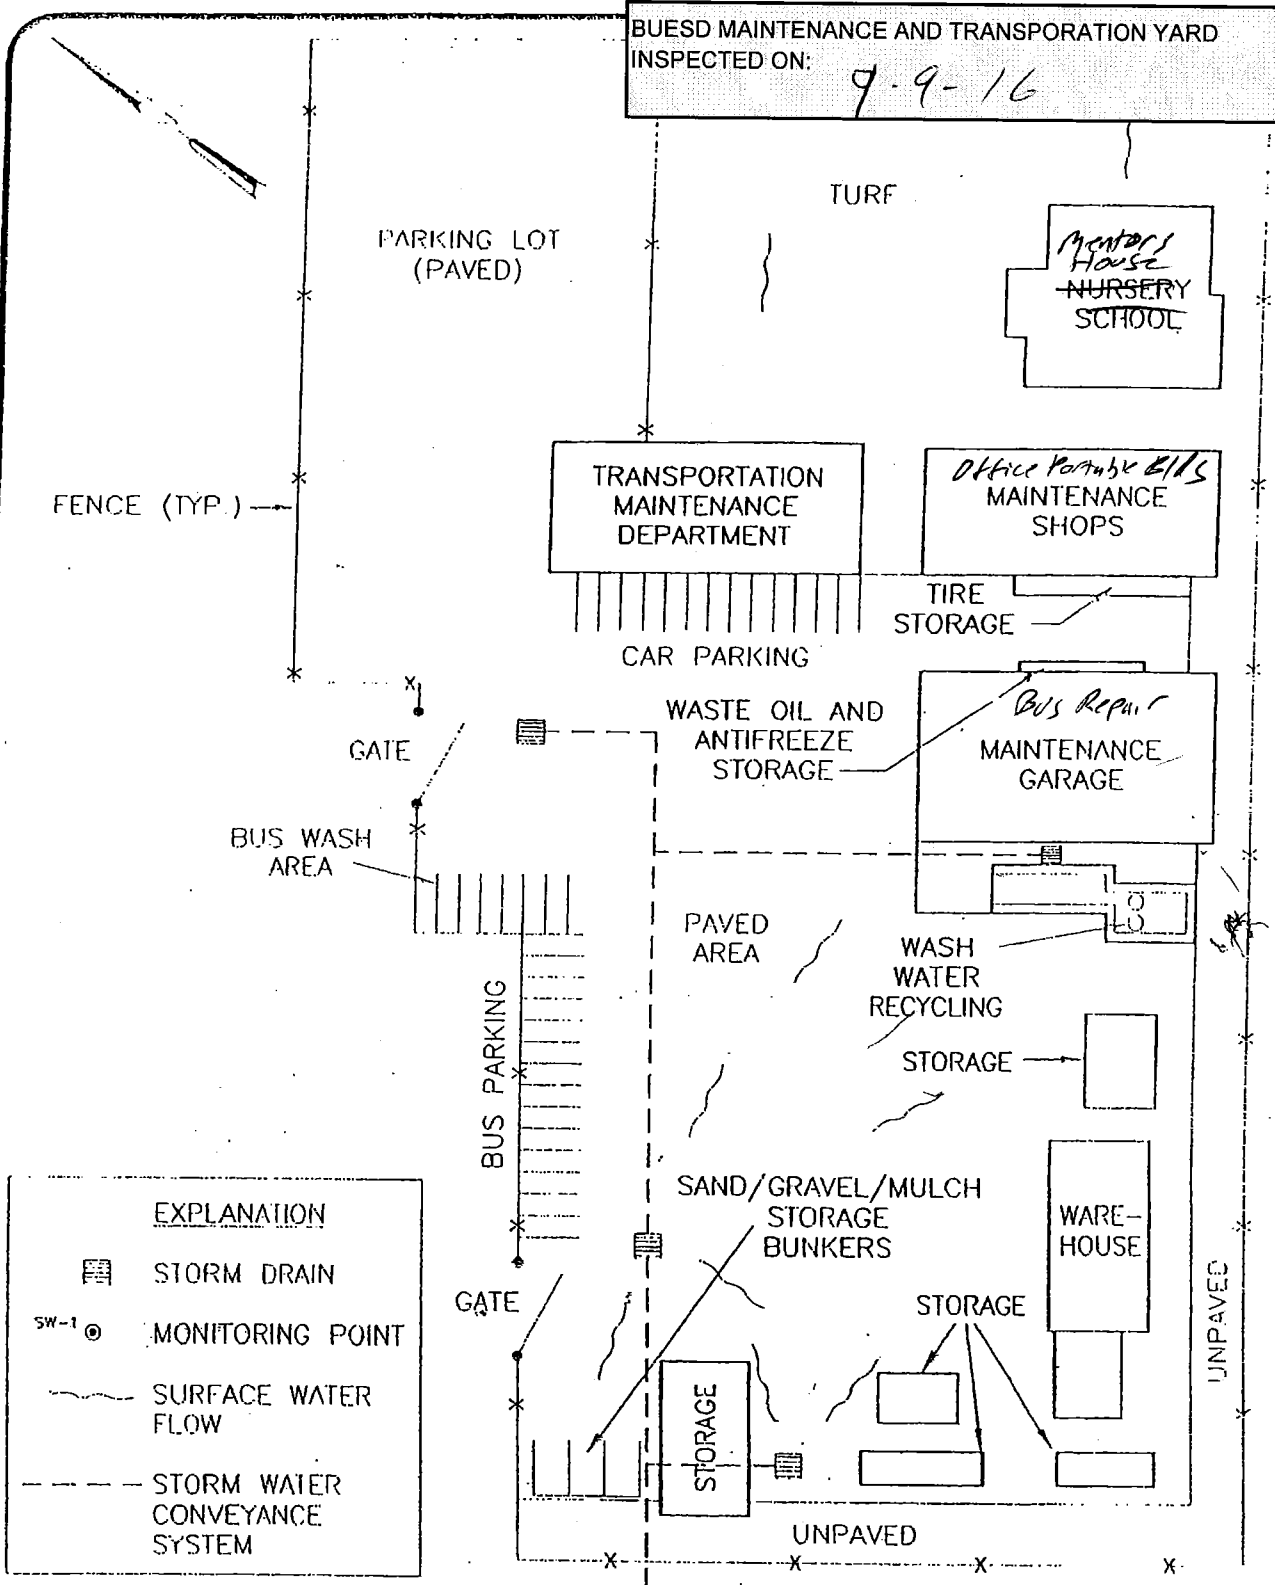

| EXPLANATION | |
|-------------|-------------------------------|
| | STORM DRAIN |
| | MONITORING POINT |
| | SURFACE WATER FLOW |
| | STORM WATER CONVEYANCE SYSTEM |

NOT TO SCALE




Emcon

DATE JUN. 1997
DWN KAJ
APP
REV
PROJECT NO.
2136-001.001

FIGURE 2
BERRYESSA UNION SCHOOL DISTRICT
945 PIEDMONT ROAD
SAN JOSE, CALIFORNIA
CORPORATION YARD
SITE PLAN

EA-SANJOSE-CAD. DRAWINGS. 2:150:1 SITE PLAN. Xrefs: NONE
Scale: 1" = 100' Date: 5/25/97 File: 01:2 AU Operator: AU

BUESD MAINTENANCE AND TRANSPORTATION YARD
INSPECTED ON: 3/27/17

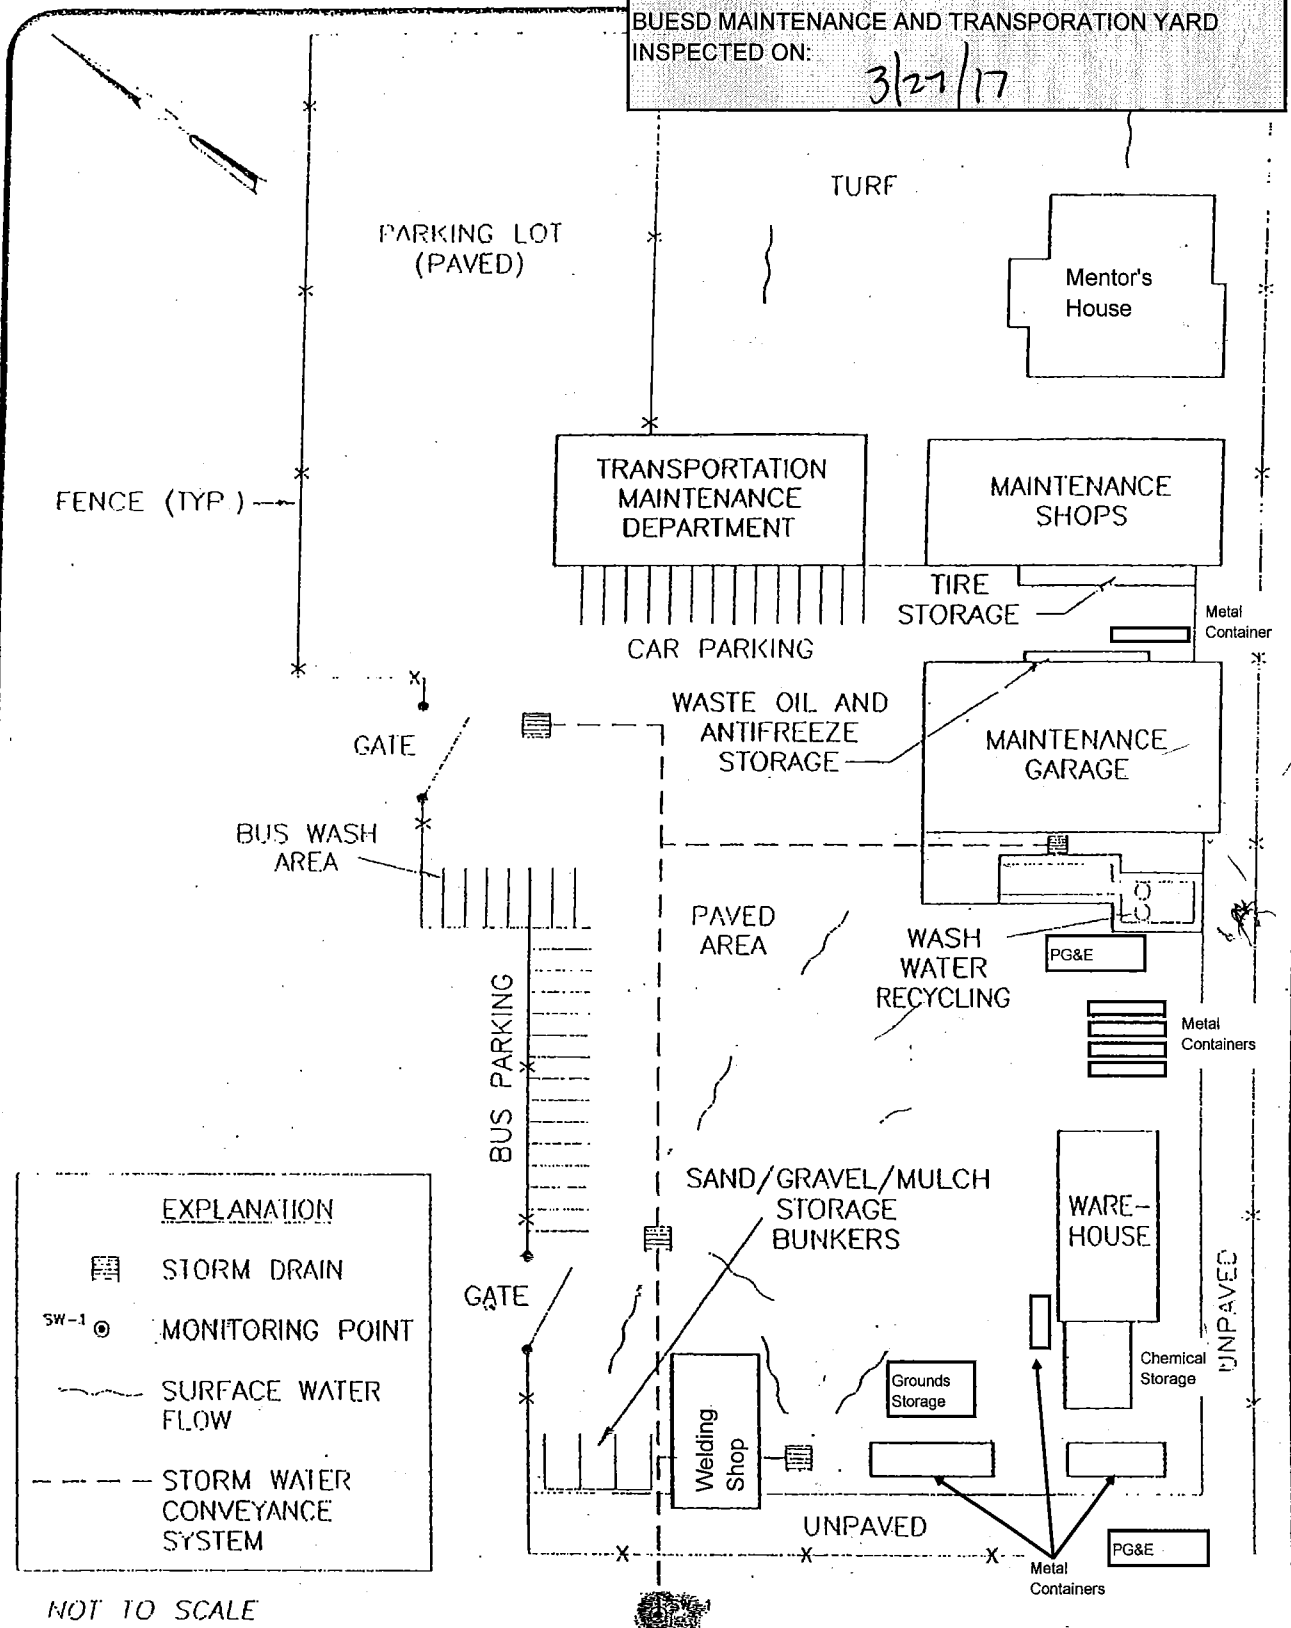

| EXPLANATION | |
|-------------|-------------------------------|
| | STORM DRAIN |
| | MONITORING POINT |
| | SURFACE WATER FLOW |
| | STORM WATER CONVEYANCE SYSTEM |

NOT TO SCALE



DATE JUN. 1997
OWN KAJ
APP
REV
PROJECT NO.
2136-001.001

FIGURE 2
BERRYESSA UNION SCHOOL DISTRICT
945 PIEDMONT ROAD
SAN JOSE, CALIFORNIA
CORPORATION YARD
SITE PLAN

EA-SANJOSE-CAD. DRAWINGS: 213601 SITE.dwg Xrefs: CNDNEP
Scale: 1" = 100' Date: 5/26/97 Time: 10:12 AM Operator: AJ